

Development at West Kowloon Cultural District

Monthly Environmental Monitoring and Audit
(EM&A) Report for May 2019

June 2019

3/F International Trade Tower
348 Kwun Tong Road
Kwun Tong
Kowloon
Hong Kong

T +852 2828 5757
F +852 2827 1823
mottmac.hk

Development at West Kowloon Cultural District

Monthly Environmental Monitoring and Audit
(EM&A) Report for May 2019

June 2019

This Monthly EM&A Report has been reviewed and certified by the Environmental Team Leader (ETL) and verified by the Independent Environmental Checker (IEC).

Certified by:



Brian Tam
Environmental Team Leader (ETL)
West Kowloon Cultural District Authority

Date

14 June 2019

Verified by:



Fredrick Leong
Independent Environmental Checker (IEC)
Meinhardt Infrastructure & Environment Ltd

Date

14 June 2019

Contents

| | |
|--|-----------|
| Executive Summary | 1 |
| 1 Introduction | 3 |
| 1.1 Background | 3 |
| 1.2 Project Organisation | 3 |
| 1.3 Environmental Status in the Reporting Period | 3 |
| 1.4 Summary of EM&A Requirements | 4 |
| 2 Impact Monitoring Methodology | 6 |
| 2.1 Introduction | 6 |
| 2.2 Air Quality | 6 |
| 2.2.1 Monitoring Parameters, Frequency and Duration | 6 |
| 2.2.2 Monitoring Locations | 6 |
| 2.2.3 Monitoring Equipment | 6 |
| 2.2.4 Monitoring Methodology | 7 |
| 2.3 Noise | 8 |
| 2.3.1 Monitoring Parameters, Frequency and Duration | 8 |
| 2.3.2 Monitoring Location | 9 |
| 2.3.3 Monitoring Equipment | 9 |
| 2.3.4 Monitoring Methodology | 9 |
| 2.4 Landscape and Visual | 10 |
| 2.4.1 Monitoring Program | 10 |
| 3 Monitoring Results | 11 |
| 3.1 Impact Monitoring | 11 |
| 3.2 Air Quality Monitoring | 11 |
| 3.2.1 1-hour TSP | 11 |
| 3.2.2 24-hour TSP | 11 |
| 3.3 Noise Monitoring | 12 |
| 3.4 Landscape and Visual Impact | 12 |
| 4 Environmental Site Inspection | 13 |
| 4.1 Site Inspection | 13 |
| 4.1.1 M+ Museum | 13 |
| 4.1.2 Lyric Theatre Complex | 13 |
| 4.2 Advice on the Solid and Liquid Waste Management Status | 14 |
| 4.2.1 M+ Museum | 15 |
| 4.2.2 Lyric Theatre Complex | 15 |
| 4.3 Status of Environmental Licenses and Permits | 15 |
| 4.3.1 M+ Museum | 15 |

| | | |
|----------|--|-----------|
| 4.3.2 | Lyric Theatre Complex | 16 |
| 4.4 | Recommended Mitigation Measures | 16 |
| 4.4.1 | M+ Museum | 16 |
| 4.4.2 | Lyric Theatre Complex | 16 |
| 5 | Compliance with Environmental Permit | 17 |
| 6 | Report in Non-compliance, Complaints, Notification of Summons and Successful Prosecutions | 18 |
| 6.1 | Record on Non-compliance of Action and Limit Levels | 18 |
| 6.2 | Record on Environmental Complaints Received | 18 |
| 6.3 | Record on Notifications of Summons and Successful Prosecution | 18 |
| 7 | Future Key Issues | 19 |
| 7.1 | Construction Works for the Coming Month(s) | 19 |
| 7.1.1 | M+ Museum | 19 |
| 7.1.2 | Lyric Theatre Complex | 19 |
| 7.2 | Key Issues for the Coming Month | 19 |
| 7.2.1 | M+ Museum | 19 |
| 7.2.2 | Lyric Theatre Complex | 20 |
| 7.3 | Monitoring Schedule for the Coming Month | 20 |
| 8 | Conclusions and Recommendations | 21 |
| 8.1 | Conclusions | 21 |
| 8.2 | Recommendations | 21 |

Figure 1 Site Layout Plan and Monitoring Stations

Appendices

- A. Project Organisation
- B. Tentative Construction Programme
- C. Action and Limit Levels for Construction Phase
- D. Event and Action Plan for Air Quality, Noise, Landscape and Visual Impact
- E. Monitoring Schedule
- F. Calibration Certifications
- G. Graphical Plots of the Monitoring Results

| | | |
|----|---|----|
| H. | Meteorological Data Extracted from Hong Kong Observatory | 31 |
| I. | Waste Flow table | 32 |
| J. | Environmental Mitigation Measures – Implementation Status | 33 |
| K. | Cumulative Statistics on Complaints, Notifications of Summons and Successful Prosecutions | 34 |

Executive Summary

Mott MacDonald Hong Kong Limited (MMHK) was commissioned to undertake the Environmental Team (ET) services (including environmental monitoring and audit (EM&A)) for the construction of M+ Museum Main Works (Contract No.: CC/2015/3A/022) and Lyric Theatre Complex including the Foundation Works (Contract No.: CC/2015/3A/014) and L1 Contract (Contract No. CC/2017/3A/030) at West Kowloon Cultural District (WKCD) (The Project) as part of the WKCD development. The Project Proponent is the West Kowloon Cultural District Authority (WKCD). The construction works and EM&A programme for M+ Museum and Lyric Theatre Complex commenced on 31 October 2015 and 1 March 2016 respectively.

The overall works for the WKCD fall under two separate categories of Designated Project (DP) of the Environmental Impact Assessment Ordinance (EIAO), namely an “engineering feasibility study of urban development projects with a study area covering more than 20 ha or involving a total population of more than 100 000” (Item 3 of Schedule 3) and “an underpass more than 100m in length under the built areas” (Item A.9, Part I, Schedule 2). An Environmental Permit No. EP-453/2013/B (EP) was issued with respect to the “Underpass Road and Austin Road Flyover Serving the West Kowloon Cultural District” which specifically includes the abovementioned category of DP under Item A.9, Part I, Schedule 2 of the EIAO.

This Monthly EM&A Report presents the monitoring works at M+ Museum and Lyric Theatre Complex from 1 May to 31 May 2019.

Exceedance of Action and Limit Levels

There was no breach of Action or Limit levels for Air Quality (1-hour TSP and 24-hour TSP) and Noise in this reporting month.

Implementation of Mitigation Measures

Construction phase weekly site inspections were carried out on 7, 14, 21 and 28 May 2019 for M+ Museum and 2, 8, 15, 22 and 29 May 2019 for Lyric Theatre Complex to confirm the implementation measures undertaken by the Contractors in the reporting month. The outcomes are presented in Section 4 and the status of implementation of mitigation measures in the site is shown in **Appendix J**.

Landscape and visual impact inspections were conducted as part of the abovementioned weekly site inspections during the reporting month. No adverse comment on landscape and visual aspects was made during these inspections.

EPD site inspection with Contractor was conducted on 3 May 2019 at M+ Museum. No adverse comment was received.

Record of Complaints

No environmental complaint was recorded in the reporting month.

Record of Notification of Summons and Successful Prosecutions

No notification of summons and successful prosecution were recorded in the reporting month.

Future Key Issues

The major site works for M+ Museum scheduled to be commissioned in the coming month include:

- Structure
 - RDE 14-15F: Structure work for Slab rebar & column preparation

- Facade
 - Erection of 1MF scaffold for 1MF Installation
 - Installation of façade on 5/F of RDE
- MEP
 - BEL, ELV, BFS, BPD, BME works from B2 to 3/F of M+
 - BEL, ELV, BFS, BPD, BME works from G/F to 15/F of RDE,
 - BEL, ELV, BFS, BPD, BME works from G/F to 11/F
- ABWF
 - Block wall erection, Floor screed for plant room area and corridor area, wall plastering work up to M+ G/F – 3/F
 - Blockwork plaster, paint/sealer, plaster, drywall subframe, Front of house work wall plastering work up to M+ 16/F
 - Steel platform, Plastering, Artwall/drywall stud erection, False ceiling sub-frame installation of RDE from 1MF to 5/F
 - Fairface remedial work, gypsum block, waterproofing, floor screed, foam glass and gypsum block, skim coat and painting, self-levelling screed, floating floor of CSF building from 1/F to 8/F

The major site works for Lyric Theatre Complex scheduled to be commissioned in the coming month include:

- Excavation and ELS works at Main Cofferdam
- Drainage and water mains work (PIW works)
- Extended basement structure construction of Area 6
- Artist Square (ASB) bored pile work near Area 6

Potential environmental impacts due to the construction activities, including air quality, noise, water quality, waste, landscape and visual, will be monitored or reviewed. The recommended environmental mitigation measures shall be implemented on site and regular inspections as required will be carried out to ensure that the environmental conditions are acceptable.

1 Introduction

1.1 Background

Mott MacDonald Hong Kong Limited (MMHK) was commissioned to undertake the Environmental Team (ET) services (including environmental monitoring and audit (EM&A)) for the construction of M+ Museum Main Works (Contract No.: CC/2015/3A/022) and Lyric Theatre Complex including the Foundation Works (Contract No.: CC/2015/3A/014) and L1 Contract (Contract No. CC/2017/3A/030) at West Kowloon Cultural District (WKCD) (The Project) as part of the WKCD development. The Project Proponent is the West Kowloon Cultural District Authority (WKCDA). The construction works and EM&A programme for M+ Museum and Lyric Theatre Complex commenced on 31 October 2015 and 1 March 2016 respectively.

The overall works for the WKCD fall under two separate categories of Designated Project (DP) of the Environmental Impact Assessment Ordinance (EIAO), namely an “engineering feasibility study of urban development projects with a study area covering more than 20 ha or involving a total population of more than 100 000” (Item 3 of Schedule 3) and “an underpass more than 100m in length under the built areas” (Item A.9, Part I, Schedule 2). An Environmental Permit No. EP-453/2013/B (EP) was issued with respect to the “Underpass Road and Austin Road Flyover Serving the West Kowloon Cultural District” which specifically includes the abovementioned category of DP under Item A.9, Part I, Schedule 2 of the EIAO. The captioned projects include part of the abovementioned underpass road located within the site boundary also falls under this same category.

The M+ museum development aims to provide an iconic presence for the M+ museum, semi-transparent vertical plane, housing education facilities, a public restaurant and museum offices. At ground and lower levels, generous access will be provided to the park and other West Kowloon Cultural District facilities, alongside a public resource centre, theatres, retail and dining, and back-of-house functions.

The 1,200-seat Lyric Theatre Complex will be Hong Kong’s first world-class facility for dance performances, including ballet, contemporary and Chinese dance forms. In the run up to the opening of further major performing arts venues in the WKCD, it will also be used for a wide variety of performing arts events including drama, opera and musical performances. The Lyric Theatre Complex will act as a platform for Hong Kong’s leading arts organisations, and be a new major venue to show programmes from Asia and worldwide.

The Monthly EM&A Report is prepared in accordance with the Condition 3.4 of the Environmental Permit No. EP-453/2013/B. This Monthly EM&A Report presents the monitoring works at M+ Museum and Lyric Theatre Complex from 1 May to 31 May 2019. The purpose of this report is to summarise the findings in the EM&A of the project over the reporting period.

1.2 Project Organisation

The organisation chart and lines of communication with respect to the on-site environmental management structure together with the contact information of the key personnel are shown in **Appendix A**.

1.3 Environmental Status in the Reporting Period

During the reporting period, construction works at M+ Museum undertaken include:

- Structure
 - RDE 13-14F: Structure work for Slab rebar & column preparation

- Facade
 - Installation of panels on M+ tower up to RT/F
 - Erection of 1MF scaffold for 1MF Installation
 - Installation of façade on 4/F of RDE
- MEP
 - BEL, ELV, BFS, BPD, BME works from B2 to 1/F of M+
 - BEL, ELV, BFS, BPD, BME works from G/F to 15/F of RDE
 - BEL, ELV, BFS, BPD, BME works from G/F to 11/F
- ABWF
 - Block wall erection, Floor screed for plant room area and corridor area, wall plastering work up to M+ G/F – 3/F
 - Blockwork plaster, paint/sealer, plaster, drywall subframe, Front of house work wall plastering work up to M+ 16/F
 - Steel platform, Plastering, Artwall/drywall stud erection, False ceiling sub-frame installation of RDE from 1MF to 5/F
 - Fairface remedial work, gypsum block, waterproofing, floor screed, foam glass and gypsum block, skim coat and painting, self-levelling screed, floating floor of CSF building from 1/F to 8/F

During the reporting period, construction works at Lyric Theatre Complex undertaken include:

- Excavation and ELS works at Main Cofferdam
- Drainage and water mains work (PIW works)
- Extended basement structure construction of Area 6
- Artist Square (ASB) bored pile work near Area 6

The Construction Works Programme of M+ Museum and Lyric Theatre Complex is provided in **Appendix B**. A layout plan of the Project is provided in **Figure 1**. Please refer to **Table 4.3** and **Table 4.4** on the status of the environmental licenses.

1.4 Summary of EM&A Requirements

The EM&A programme requires environmental monitoring of air quality, noise, landscape and visual as specified in the approved EM&A Manual.

A summary of impact EM&A requirements is presented in **Table 1.1**.

Table 1.1: Summary of Impact EM&A Requirements

| Parameters | Descriptions | Locations | Frequencies |
|--------------------|--|---|-------------------------------|
| Air Quality | 24-Hour TSP | AM1 - International Commerce Centre | At least once every 6 days |
| | 1-Hour TSP | AM1 - International Commerce Centre | At least 3 times every 6 days |
| | 24-Hour TSP | AM2B – Austin Road West opposite to The Harbourside Tower 1 | At least once every 6 days |
| | 1-Hour TSP | AM2B – Austin Road West opposite to The Harbourside Tower 1 | At least 3 times every 6 days |
| Noise | Leq, 30 minutes | NM1A- Podium level of The Harbourside Tower 1 | Weekly |
| Landscape & Visual | Monitor implementation of proposed mitigation measures during the construction stage | As described in Table 9.1 and 9.2 of the EM&A Manual | Bi-weekly |

Given that the Project covers only a small part of the whole WKCD area (i.e. M+ Museum, Lyric Theatre Complex and respective portions of underpass road), it was proposed that the EM&A programme for the Project should only require 1 noise monitoring station and 2 air quality monitoring stations located closest to the Project area. Currently, the works under the captioned project are confined in the western part of the WKCD site. Therefore, only the monitoring stations AM1, AM2 and NM1 were set up. Other monitoring locations are too far away (i.e. AM3 to AM5 and NM2 to NM5) are not included in this EM&A programme until the construction of the corresponding area commences.

The Harbourside management office formally rejected our proposal of setting up air quality and noise monitoring equipment on its premises at the podium level of Tower 1 (AM2/NM1) on 10 November 2015. Alternative noise monitoring location was identified at The Arch (NM2), however The Arch management office formally rejected our proposal of setting up noise monitoring equipment on its premises on 23 November 2015. Nevertheless, suitable air quality monitoring location at AM2 was identified on the ground floor in front of The Harbourside Tower 1, which is at the same location as that of baseline monitoring for consistency. No management approval is required at the ground floor for conducting the air monitoring. However, the electricity supply at AM2 was suspended from 31 August 2016 and was no longer available. In order to have a more secure electricity supply, an alternative air monitoring location (AM2A) was identified at Austin Road West opposite to The Harbourside Tower 1, which is close to Lyric Theatre Complex site entrance. This alternative air monitoring location was approved by EPD on 28 September 2016. Due to works programme, the air monitoring location AM2A has been relocated to the alternative monitoring location AM2B at the 1st floor of Gammon's site office, which was approved by EPD on 21 February 2019. Meanwhile, the opportunity of setting up the air monitoring location at The Harbourside is being explored. Noise monitoring at G/F of Harbourside will not be representative. Approval from the management office of the International Commerce Centre has been granted on 29 February 2016 for conducting noise monitoring at the alternative noise monitoring location identified at the podium floor (NM1A) which is free from screening to the construction activities. Therefore, 2 air quality monitoring stations and 1 noise impact monitoring station were confirmed for the impact monitoring.

The Environmental Quality Performance Limits for air quality and noise are shown in **Appendix C**.

The Event and Action Plan for air quality, construction noise, landscape and visual are shown in **Appendix D**.

The EM&A programme followed the recommended mitigation measures in the EM&A Manual. The EM&A requirements as well as the summary of implementation status of the environmental mitigation measures are provided in **Appendix J**.

2 Impact Monitoring Methodology

2.1 Introduction

For air quality and noise, the monitoring methodology, including the monitoring locations, monitoring equipment used, monitoring parameters, and frequency and duration etc., for air quality and noise are detailed in this Section. The environmental monitoring schedules for the reporting period and the tentative monitoring Schedule for the coming month are provided in **Appendix E**.

For landscape and audit impact, the relevant EM&A monitoring requirements and details are also presented in this Section.

2.2 Air Quality

2.2.1 Monitoring Parameters, Frequency and Duration

Table 2.1 summarizes the monitoring parameters, frequency and duration of the TSP monitoring.

Table 2.1: Air Quality Monitoring Parameters, Frequency and Duration

| Parameter | Frequency | Duration |
|-------------|---------------------------------|------------|
| 24-hour TSP | At least once in every six-days | 24 hours |
| 1-hour TSP | At least 3 times every six-days | 60 minutes |

2.2.2 Monitoring Locations

Currently, the works under the captioned project are confined in the western part of the WKCD site. Therefore, only the monitoring stations AM1 and AM2B were set up at the proposed locations in accordance with updated EM&A Manual. Location of the monitoring station is given in **Table 2.2** and shown in **Figure 1**.

Table 2.2: Air Quality Monitoring Station

| Monitoring Station | Location |
|--------------------|--|
| AM1 | International Commerce Centre (ICC) |
| AM2B | Austin Road West opposite to The Harbourside Tower 1 |

2.2.3 Monitoring Equipment

Continuous 24-hour TSP air quality monitoring was conducted using High Volume Sampler (HVS) (Model: TE-5170) located at the designated monitoring station. The HVS meets all the requirements stated in of the EM&A Manual. Portable direct reading dust meter was used to carry out the 1-hour TSP monitoring. **Table 2.3** summarizes the equipment used in the impact air quality monitoring. Copies of the calibration certificates for the HVS, calibration kit and portable dust meters are attached in **Appendix F**.

Table 2.3: TSP Monitoring Equipment

| Equipment | Model |
|------------------------------------|--|
| 24-hour TSP monitoring | |
| High Volume Sampler | TE-5170 (Serial No.: 0767 and 8919) |
| Calibrator | TE-5025A (Orifice I.D.: 2454) |
| 1-hour TSP monitoring | |
| Portable direct reading dust meter | Sibata LD-3B (Serial No.: 235780 and 6Z7784) |

Calibration of the HVS (five point calibration) using Calibration Kit was carried out every two months. The HVS calibration orifice will be calibrated annually. Calibration certificate of the TE-5025A Calibration Kit and the HVS are provided in **Appendix F**

The 1-hour TSP monitoring should be determined periodically (e.g. annually) by the HVS to check the validity and accuracy of the results measured by direct reading method.

2.2.4 Monitoring Methodology

24-hour TSP Monitoring

Installation

The HVS was installed at the site boundary. The following criteria were considered in the installation of the HVS.

- A horizontal platform with appropriate support to secure the sampler against gusty wind was provided.
- The distance between the HVS and any obstacles, such as buildings, was at least twice the height that the obstacle protrudes above the HVS.
- A minimum of 2 metres separation from walls, parapets and penthouse was required for rooftop sampler.
- A minimum of 2 metres separation from any supporting structure, measured horizontally was required.
- No furnace or incinerator flues or building vent were nearby.
- Airflow around the sampler was unrestricted.
- The sampler has been more than 20 metres from any drip line.
- Permission was obtained to set up the sampler and to obtain access to the monitoring station.
- A secured supply of electricity is needed to operate the sampler.

Preparation of Filter Papers

- Glass fibre filters were labelled and sufficient filters that were clean and without pinholes were selected.
- The filters used are specified to have a minimum collection efficiency of 99 percent for 0.3 µm (DOP) particles.
- All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than ±3 °C with relative humidity (RH) < 50% and was not variable by more than ±5 %. A convenient working RH was 40%. All preparation of filters was done by Hong Kong Laboratory Accreditation Scheme (HOKLAS) accredited laboratory.

Field Monitoring Procedures

- The power supply was checked to ensure the HVS works properly.
- The filter holder and the area surrounding the filter were cleaned.
- The filter holder was removed by loosening the four bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully.
- The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter.
- The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges.
- The shelter lid was closed and was secured with the aluminium strip.
- The HVS was warmed-up for about 5 minutes to establish run-temperature conditions.
- A new flow rate record sheet was set into the flow recorder.
- The flow rate of the HVS was checked and adjusted at around 1.3 m³/min. The range specified in the EM&A Manual was between 0.6-1.7 m³/min.

- The programmable timer was set for a sampling period of 24 hours, and the starting time, weather condition and the filter number were recorded.
- The initial elapsed time was recorded.
- At the end of sampling, the sampled filter was removed carefully and folded in half length so that only surfaces with collected particulate matter were in contact.
- It was then placed in a clean plastic envelope and sealed.
- All monitoring information was recorded on a standard data sheet.
- Filters were sent to a Hong Kong Laboratory Accreditation Scheme (HOKLAS) accredited laboratory for analysis.

Maintenance and Calibration

- The HVS and its accessories are maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- HVSs were calibrated upon installation and thereafter at bi-monthly intervals. The calibration kits were calibrated annually.
- Calibration records for HVS and calibration kit are shown in **Appendix F**.

1-hour TSP Monitoring

Field Monitoring

The measuring procedures of the 1-hour dust meter are in accordance with the Manufacturer's Instruction Manual as follows:

- Turn the power on.
- Close the air collecting opening cover.
- Push the "TIME SETTING" switch to [BG].
- Push "START/STOP" switch to perform background measurement for 6 seconds.
- Turn the knob at SENSI ADJ position to insert the light scattering plate.
- Leave the equipment for 1 minute upon "SPAN CHECK" is indicated in the display.
- Push "START/STOP" switch to perform automatic sensitivity adjustment. This measurement takes 1 minute.
- Pull out the knob and return it to MEASURE position.
- Setting time period of 1 hour for the 1-hour TSP measurement.
- Push "START/STOP" to start the 1-hour TSP measurement.
- Regular checking of the time period setting to ensure monitoring time of 1 hour.

Maintenance and Calibration

- The 1-hour dust meter would be checked at 3-month intervals and calibrated at 1-year intervals throughout all stages of the air quality monitoring.
- Calibration records for direct dust meters are shown in **Appendix F**.

Weather Condition

- Meteorological data extracted from Hong Kong Observatory for the reporting month is provided in **Appendix H**.

2.3 Noise

2.3.1 Monitoring Parameters, Frequency and Duration

Table 2.4 summarizes the monitoring parameters, frequency and duration of noise monitoring. The noise in A-weighted levels L_{eq} , L_{10} and L_{90} are recorded in a 30-minute interval between 0700 and 1900 hours.

Table 2.4: Noise Monitoring Parameters, Period and Frequency

| Time Period | Parameters | Frequency |
|---|--|-----------------|
| Daytime on normal weekdays (0700-1900 hours) | L_{eq} (30 min), L_{90} (30 min) & L_{10} (30 min) | Once every week |

2.3.2 Monitoring Location

Currently, the works under the captioned project are confined in the western part of the WKCD site. Therefore, only the monitoring station NM1A was set up at the proposed location in accordance with updated EM&A Manual. Location of the monitoring station is given in **Table 2.5** and shown in **Figure 1**.

Table 2.5: Noise Monitoring Station

| Monitoring Station | Location |
|--------------------|---|
| NM1A | Podium floor of International Commerce Centre (ICC) |

2.3.3 Monitoring Equipment

Integrating Sound Level Meter was used for noise monitoring. It was a Type 1 sound level meter capable of giving a continuous readout of the noise level readings including equivalent continuous sound pressure level (L_{Aeq}) and percentile sound pressure level (L_x). They comply with International Electrotechnical Commission Publications 651:1979 (Type 1) and 804:1985 (Type 1). **Table 2.6** summarizes the noise monitoring equipment model being used.

Table 2.6: Noise Monitoring Equipments

| Monitoring Station | Equipment Model | |
|--------------------|----------------------------------|--|
| | Integrating Sound Level Meter | Calibrator |
| NM1A | Rion NL-52 (Serial No. 00175561) | LARSON DAVIS CAL200 (Serial No. 15678) |

2.3.4 Monitoring Methodology

Field Monitoring

- The microphone of the Sound Level Meter was set at least 1.2 m above the ground.
- Free Field measurement was made at the monitoring locations.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - frequency weighting: A
 - time weighting: Fast
 - time measurement: 30 minutes intervals (between 0700-1900 on normal weekdays)
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1 kHz. If the difference in the calibration level before and after measurement was more than 1 dB, the measurement would be considered invalid and has to be repeated after re-calibration or repair of the equipment.
- During the monitoring period, the L_{eq} , L_{10} and L_{90} were recorded. In addition, any site observations and noise sources were recorded on a standard record sheet.
- A correction of +3dB(A) was made to the free field measurements.

Maintenance and Calibration

- The microphone head of the sound level meter and calibrator is cleaned with soft cloth at quarterly intervals.
- The sound level meter and calibrator are sent to the supplier or HOKLAS laboratory to check and calibrate at yearly intervals.
- Calibration records are shown in **Appendix F**.

Weather Condition

- Meteorological data extracted from Hong Kong Observatory for the reporting month is provided in **Appendix H**.

2.4 Landscape and Visual

2.4.1 Monitoring Program

Table 2.7 details the monitoring program (as proposed in the WKCD EIA report) for landscape and visual impact during the construction phase.

Table 2.7: Monitoring Program for Landscape and Visual Impact during Construction Phase

| Stage | Monitoring Task | Frequency | Report | Approval |
|--------------|---|-----------|---|-----------------------|
| Construction | Monitor implementation of proposed mitigation measures during the construction stage. | Bi-weekly | ET to report on Contractor's compliance | Counter-signed by IEC |

During the landscape and visual impact monitoring, any changes in relation to the landscape and visual amenity should be monitored with reference to the baseline conditions of the site. In addition, mitigation measures were proposed in the WKCD EIA report to minimise the landscape and visual impacts during the construction phase. The proposed mitigation measures as shown in Table 9.1 and Table 9.2 of the EM&A Manual should be checked for proper implementation.

3 Monitoring Results

3.1 Impact Monitoring

Construction impact monitoring for air quality, noise and landscape and visual impact was undertaken in compliance with the EM&A Manual during the reporting month.

3.2 Air Quality Monitoring

3.2.1 1-hour TSP

Results of 1-hour TSP at the monitoring location AM1 and AM2B are summarised in **Table 3.1**. Graphical plots of the monitoring results are shown in **Appendix G**.

Table 3.1: Summary of 1-hour TSP monitoring results

| Monitoring Station | Monitoring Date | Start Time | 1-hour TSP ($\mu\text{g}/\text{m}^3$) | | | Range ($\mu\text{g}/\text{m}^3$) | Action Level ($\mu\text{g}/\text{m}^3$) | Limit Level ($\mu\text{g}/\text{m}^3$) |
|--------------------|-----------------|------------|---|------------|------------|------------------------------------|---|--|
| | | | 1st Result | 2nd Result | 3rd Result | | | |
| AM1 | 03-May-19 | 8:02 | 72 | 80 | 89 | 41 - 89 | 273.7 | 500 |
| | 09-May-19 | 8:07 | 56 | 54 | 62 | | | |
| | 15-May-19 | 8:00 | 45 | 46 | 49 | | | |
| | 21-May-19 | 8:04 | 72 | 80 | 88 | | | |
| | 27-May-19 | 8:07 | 49 | 51 | 56 | | | |
| | 31-May-19 | 8:08 | 41 | 47 | 50 | | | |
| AM2B | 03-May-19 | 8:17 | 75 | 83 | 91 | 51 - 92 | 274.2 | 500 |
| | 09-May-19 | 8:22 | 61 | 59 | 55 | | | |
| | 15-May-19 | 8:16 | 71 | 65 | 69 | | | |
| | 21-May-19 | 8:18 | 75 | 83 | 92 | | | |
| | 27-May-19 | 8:22 | 51 | 60 | 62 | | | |
| | 31-May-19 | 8:25 | 59 | 64 | 60 | | | |

3.2.2 24-hour TSP

Results of 24-hour TSP at the monitoring location AM1 and AM2B are summarised in **Table 3.2**. Graphical plots of the monitoring results are shown in **Appendix G**.

Table 3.2: Summary of 24-hour TSP monitoring results

| Monitoring Station | Monitoring Date | Start Time | Monitoring Results ($\mu\text{g}/\text{m}^3$) | Range ($\mu\text{g}/\text{m}^3$) | Action Level ($\mu\text{g}/\text{m}^3$) | Limit Level ($\mu\text{g}/\text{m}^3$) |
|--------------------|-----------------|------------|---|------------------------------------|---|--|
| AM1 | 3-May-19 | 8:00 | 39 | 34 - 65 | 143.6 | 260 |
| | 9-May-19 | 8:05 | 41 | | | |
| | 15-May-19 | 7:58 | 60 | | | |
| | 21-May-19 | 8:02 | 34 | | | |
| | 27-May-19 | 8:05 | 44 | | | |
| | 31-May-19 | 8:10 | 65 | | | |
| AM2B | 03-May-19 | 8:15 | 91 | 42 - 91 | 151.1 | 260 |
| | 09-May-19 | 8:20 | 51 | | | |
| | 15-May-19 | 8:14 | 80 | | | |

| Monitoring Station | Monitoring Date | Start Time | Monitoring Results ($\mu\text{g}/\text{m}^3$) | Range ($\mu\text{g}/\text{m}^3$) | Action Level ($\mu\text{g}/\text{m}^3$) | Limit Level ($\mu\text{g}/\text{m}^3$) |
|--------------------|-----------------|------------|---|------------------------------------|---|--|
| | 21-May-19 | 8:16 | 42 | | | |
| | 27-May-19 | 8:20 | 53 | | | |
| | 31-May-19 | 8:23 | 76 | | | |

No exceedance of 1-hour and 24-hour TSP (Action or Limit Level) was recorded in the reporting period.

3.3 Noise Monitoring

The construction noise monitoring results at the monitoring location NM1A are summarized in **Table 3.3**. Graphical plots of the monitoring data and the station set-up of a free-field measurement are shown in **Appendix G**.

Table 3.3: Summary of noise monitoring results during normal weekdays

| Monitoring Date | Start Time | End Time | Leq (30 mins)*, dB(A) | Limit Level for Leq (dB(A)) |
|-----------------|------------|----------|-----------------------|-----------------------------|
| 09-May-19 | 10:31 | 11:01 | 69 | |
| 15-May-19 | 10:21 | 10:51 | 69 | |
| 21-May-19 | 10:23 | 10:53 | 69 | 75 |
| 27-May-19 | 10:28 | 10:58 | 69 | |

Remarks:

* +3dB (A) correction was applied to free-field measurement.

No exceedance (Action/Limit Level) of construction noise was recorded in the reporting period as no noise related environmental complaint was received during the reporting period and noise levels recorded during the monitoring period were below 75 dB(A).

3.4 Landscape and Visual Impact

Landscape and visual impact inspections were conducted as part of the weekly site inspections on 14 and 28 May 2019 for M+ Museum, and 8 and 22 May 2019 for Lyric Theatre Complex during the reporting month. As reviewed by the registered Landscape Architect, no adverse comment on landscape and visual aspects was made during these inspections.

The landscape and visual mitigation measures were implemented during the reporting period. The summary of implementation status of the environmental mitigation measures is provided in **Appendix J**.

4 Environmental Site Inspection

4.1 Site Inspection

4.1.1 M+ Museum

Construction phase weekly site inspections were carried out on 7, 14, 21 and 28 May 2019. The joint site inspection with IEC, ET, ER and Contractor was held on 28 May 2019. All observations have been recorded in the site inspection checklist and passed to the Contractor together with the appropriate recommended mitigation measures where necessary.

EPD site inspection was conducted on 3 May 2019. Wastewater treatment facilities, wheel washing and chemical waste storage area have been inspected and no adverse comment was received. The contractor was reminded to maintain wheel washing for the shared haul road and gate.

The key observations from the site inspections and associated recommendations are summarized in **Table 4.1**.

Table 4.1: Summary of Site Inspections and Recommendations for M+ Museum

| Inspection Date | Parameter | Observation / Recommendation | Contractor's Responses / Action(s) Undertaken | Close-out (Date) |
|-----------------|---------------|---|---|------------------|
| 30 Apr 2019 | Water quality | High pH value (9.73) which outside the acceptable range (i.e. pH 6 to 9) was observed at wetsep. The Contractor was reminded to rectify the problem before discharging the effluent offsite. | The contractor has checked the wetsep and the pH is within proper pH range. | 7 May 2019 |
| 7 May 2019 | Water quality | Effluent quality of wetsep was checked. It was found visually clear when comparing with standard solution and within proper pH range. | N/A | N/A |
| 14 May 2019 | Water quality | Effluent quality of wetsep was checked. It was found visually clear when comparing with standard solution and within proper pH range. | N/A | N/A |
| 21 May 2019 | Water quality | Effluent quality of wetsep was checked. It was found visually clear when comparing with standard solution and within proper pH range. | N/A | N/A |
| 28 May 2019 | Water quality | Effluent quality of wetsep was checked. It was found visually clear and within proper pH range. | N/A | N/A |
| 28 May 2019 | Water quality | Stagnant water was observed accumulated at the entrance of the storage area. The contractor was reminded to collect the stormwater/ surface runoff to wetsep and prevent seepage outside site boundary. | Follow-up status will be provided in the next reporting month. | On-going |

4.1.2 Lyric Theatre Complex

Construction phase weekly site inspections were carried out on 2, 8, 15, 22 and 29 May 2019. The joint site inspection with IEC, ET, ER and Contractor was held on 15 May 2019. All observations have been

recorded in the site inspection checklist and passed to the Contractor together with the appropriate recommended mitigation measures where necessary.

The key observations from the site inspections and associated recommendations are summarized in **Table 4.2**.

Table 4.2: Summary of Site Inspections and Recommendations for Lyric Theatre Complex

| Inspection Date | Parameter | Observation / Recommendation | Contractor's Responses / Action(s) Undertaken | Close-out (Date) |
|-----------------|------------------|--|--|------------------|
| 24 Apr 2019 | Water Quality | Turbid water was observed at wetsep. The contractor was reminded to clear the suspended solid in order to keep the quality of discharge effluent. | The contractor has cleared the suspended solid at the wetsep. | 27 April 2019 |
| 2 May 2019 | Air Quality | Discoloured NRMM label was observed for an air-compressor. The contractor was reminded to replace the NRMM label with correct colour. | The contractor has replaced the NRMM label with correct colour. | 8 May 2019 |
| 2 May 2019 | Air Quality | One side of enclosure was opened at the grouting station. The contractor was reminded to enclose 3 sides and top of grouting station to avoid dust impact. | The contractor has rectified the enclosure of grouting station to enclose 3 sides and top. | 6 May 2019 |
| 2 May 2019 | Waste Management | No drip tray was observed for chemicals. The contractor was reminded to provide suitable drip tray for the chemicals. | The contractor has provided suitable drip tray for the chemicals. | 7 May 2019 |
| 8 May 2019 | Water Quality | Turbid water was observed at wetseps #6 and #7. The contractor was reminded to further clear the suspended solid to keep the good quality of discharge effluent. | The contractor has removed the suspended solid in the wetseps #6 and #7 to keep the good quality of discharge effluent.. | 8 May 2019 |
| 8 May 2019 | Waste Management | Broken drip tray was observed for the chemicals of wetsep. The contractor was reminded to replace the drip tray for chemicals to avoid leakage. | The contractor has provided a suitable drip tray for the chemicals of wetsep to avoid leakage. | 9 May 2019 |
| 15 May 2019 | Water Quality | The contractor was reminded to keep the pH value of the wetsep within the acceptable range (6-9) to ensure proper and efficient operation at all time. | The contractor has kept the pH value of the wetsep within the acceptable range (6-9) to ensure proper and efficient operation. | 17 May 2019 |
| 29 May 2019 | Water Quality | The contractor was reminded to keep the pH value of the wetsep within the acceptable range (6-9) to ensure proper and efficient operation at all time. | Follow-up status will be provided in the next reporting month. | On-going |
| 29 May 2019 | Air Quality | Discolour NRMM label was observed at the power generator. The contractor was reminded to replace the NRMM label with correct colour. | Follow-up status will be provided in the next reporting month. | On-going |

4.2 Advice on the Solid and Liquid Waste Management Status

The Contractors have been registered as a chemical waste producer for the Project. Construction and demolition (C&D) material sorting will be carried out on site. A sufficient number of receptacles were available for general refuse collection.

4.2.1 M+ Museum

As advised by the Contractor, 8.64 tonnes and 108.01 tonnes of inert C&D material were disposed of as public fill to Tuen Mun Area 38 and Tseung Kwan O Area 137 Public Fill respectively, while 531.1 tonnes of general refuse were disposed of at SENT landfill. 81.0 tonnes of metals, 0 tonne of paper/cardboard packaging, 0 tonne of plastic and 320.0 tonnes of timber were collected by recycling contractors in the reporting month. 0 tonne of inert C&D materials was reused on site. 361.9 tonnes of inert C&D materials were reused in other projects and 234.3 tonnes of inert C&D materials were disposed to sorting facility. 0 tonne of chemical waste was collected by licensed contractors in the reporting period.

The cumulative waste generation records for M+ Museum are shown in **Appendix I**.

4.2.2 Lyric Theatre Complex

As advised by the Contractor, 27,902.32 tonnes and 6,315.09 tonnes of inert C&D material were disposed of as public fill to Tseung Kwan O Area 137 and Tuen Mun Area 38 Public Fill, while 33.7 tonnes of general refuse were disposed of at SENT and WENT landfill. 27.4 tonnes of metals, 0.2 tonne of paper/cardboard packaging, 0 tonne of plastic and 0 tonne of timber were collected by recycling contractors in the reporting month. 0 tonne of inert C&D materials was reused on site. 3,392.8 tonnes of inert C&D materials were reused in other projects and 0 tonnes of inert C&D materials were imported for reuse at site. 0 tonne of chemical waste were collected by licensed contractors in the reporting period.

The actual amounts of different types of waste generated by the activities of construction works at Lyric Theatre Complex in the reporting month are shown in **Appendix I**.

4.3 Status of Environmental Licenses and Permits

The environmental permits, licenses, and/or notifications on environmental protection for this Project which were valid during the period are summarised in **Tables 4.3** and **4.4**.

4.3.1 M+ Museum

Table 4.3: Status of Environmental Submissions, Licenses and Permits for M+ Museum

| Permit / License No. / Notification / Reference No. | Valid Period | | Status | Remarks |
|--|--------------|-----------|----------------|---------|
| | From | To | | |
| Chemical Waste Producer Registration | | | | |
| 5213-217-G2347-53 | 04-Oct-18 | -- | Valid | -- |
| Billing Account Construction Waste Disposal | | | | |
| 7031993 | 03-Oct-18 | -- | Account Active | -- |
| Construction Noise Permit | | | | |
| GW-RE0094-19 | 16-Feb-19 | 03-Aug-19 | Valid | |
| Wastewater Discharge License | | | | |
| WT-00033363-2019 | 21-Mar-19 | 31-Mar-24 | Valid | -- |
| Notification under Air Pollution Control (Construction Dust) Regulation | | | | |
| 437339 | 12-Sep-18 | -- | Notified | -- |

4.3.2 Lyric Theatre Complex

Table 4.4: Status of Environmental Submissions, Licenses and Permits for Lyric Theatre Complex

| Permit / License No. / Notification / Reference No. | Valid Period | | Status | Remarks |
|--|--------------|-----------|----------------|---------|
| | From | To | | |
| Chemical Waste Producer Registration | | | | |
| 5213-217-G2347-39 | 17-Feb-16 | -- | Valid | -- |
| Billing Account Construction Waste Disposal | | | | |
| 7029925 | 22-Jan-18 | -- | Account Active | -- |
| Billing Account for Vessel Disposal of Construction Waste | | | | |
| 7033007 | 1-May-19 | 31 Jul-19 | Account Active | |
| Construction Noise Permit | | | | |
| GW-RE0862-18 | 18-Dec-18 | 16-Jun-19 | Valid | -- |
| Wastewater Discharge License | | | | |
| WT-00030694-2018 | 6-Apr-18 | 30-Apr-23 | Valid | -- |
| Notification under Air Pollution Control (Construction Dust) Regulation | | | | |
| 429708 | 16-Jan-18 | -- | Notified | -- |

4.4 Recommended Mitigation Measures

The EM&A programme followed the recommended mitigation measures in the EM&A Manual. The EM&A requirements as well as the summary of implementation status of the environmental mitigation measures are provided in **Appendix J**. In particular, the following mitigation measures were brought to attention during the site inspections:

4.4.1 M+ Museum

Water Quality

- All drainage facilities should be regularly maintained to ensure proper and efficient operation at all times.
- Mitigation measures should be provided to prevent the accumulation of stormwater/ surface runoff during rainstorm.

4.4.2 Lyric Theatre Complex

Air Quality

- The grouting station should always be 3 sides and top enclosed.
- All NRMMS should affix with suitable labels with correct colour.

Water Quality

- All drainage facilities should always be regularly maintained to ensure proper and efficient operation.

Waste Management

- Drip trays should be provided for all chemicals on site.

5 Compliance with Environmental Permit

The status of the required submission under the EP during the reporting period is summarized in **Table 5.1**.

Table 5.1: Status of Submissions under the Environmental Permit

| EP Condition | Submission | Submission Date |
|---------------|------------------------------------|-----------------|
| Condition 3.4 | Monthly EM&A Report for April 2019 | 14 May 2019 |

6 Report in Non-compliance, Complaints, Notification of Summons and Successful Prosecutions

6.1 Record on Non-compliance of Action and Limit Levels

There was no breach of Action or Limit Levels for Air Quality and Noise monitoring in the reporting month.

6.2 Record on Environmental Complaints Received

No environmental complaint was received in the reporting month. The cumulative statistics on complaints were provided in **Appendix K**.

6.3 Record on Notifications of Summons and Successful Prosecution

No notifications of summons or successful prosecution were received this month. The cumulative statistics on notifications of summons and successful prosecutions were provided in **Appendix K**.

7 Future Key Issues

7.1 Construction Works for the Coming Month(s)

7.1.1 M+ Museum

The major site works for M+ Museum scheduled to be commissioned in the coming month include:

- Structure
 - RDE 14-15F: Structure work for Slab rebar & column preparation
- Facade
 - Erection of 1MF scaffold for 1MF Installation
 - Installation of façade on 5/F of RDE
- MEP
 - BEL, ELV, BFS, BPD, BME works from B2 to 3/F of M+
 - BEL, ELV, BFS, BPD, BME works from G/F to 15/F of RDE,
 - BEL, ELV, BFS, BPD, BME works from G/F to 11/F
- ABWF
 - Block wall erection, Floor screed for plant room area and corridor area, wall plastering work up to M+ G/F – 3/F
 - Blockwork plaster, paint/sealer, plaster, drywall subframe, Front of house work wall plastering work up to M+ 16/F
 - Steel platform, Plastering, Artwall/drywall stud erection, False ceiling sub-frame installation of RDE from 1MF to 5/F
 - Fairface remedial work, gypsum block, waterproofing, floor screed, foam glass and gypsum block, skim coat and painting, self-levelling screed, floating floor of CSF building from 1/F to 8/F

7.1.2 Lyric Theatre Complex

The major site works for Lyric Theatre Complex scheduled to be commissioned in the coming month include:

- Excavation and ELS works at Main Cofferdam
- Drainage and water mains work (PIW works)
- Extended basement structure construction of Area 6
- Artist Square (ASB) bored pile work near Area 6

7.2 Key Issues for the Coming Month

7.2.1 M+ Museum

Key issues to be considered in the coming month include:

- Generation of dust from construction works;
- Noise impact from operating equipment and machinery on-site;
- Generation of site surface runoffs and wastewater from activities on-site;
- Management of stockpiles and slopes, particularly on rainy days;
- Sorting, recycling, storage and disposal of general refuse and construction waste; and

- Management of chemicals and avoidance of oil spillage on-site.

7.2.2 Lyric Theatre Complex

Key issues to be considered in the coming month include:

- Generation of dust from construction works;
- Noise impact from operating equipment and machinery on-site;
- Generation of site surface runoffs and wastewater from activities on-site;
- Management of stockpiles and slopes, particularly on rainy days;
- Sorting, recycling, storage and disposal of general refuse and construction waste; and
- Management of chemicals and avoidance of oil spillage on-site.

7.3 Monitoring Schedule for the Coming Month

The environmental site inspection and environmental monitoring will be continued in the coming month. Impact monitoring for air quality and noise in accordance with the approved EM&A Manual has commenced since 31 October 2015 and 5 March 2016 respectively. The tentative monitoring schedule for the coming month is shown in the **Appendix E**.

8 Conclusions and Recommendations

8.1 Conclusions

The EM&A programme as recommended in the EM&A Manual has been undertaken since the construction of M+ Museum main works commenced on 31 October 2015, and the construction of Lyric Theatre Complex commenced on 1 March 2016.

Monitoring of air quality and noise with respect to the Projects is underway. In particular, the 1-hour TSP, 24-hour TSP, noise level (as Leq, 30 minutes) under monitoring have been checked against established Action and Limit levels. There was no breach of Action and Limit Levels for 1-hour TSP, 24-hour TSP and noise in the reporting month.

No environmental complaint, notifications of summons or successful prosecution were received during the reporting month.

Weekly construction phase site inspections and bi-weekly landscape and visual impact inspections were conducted during the reporting month as required. It was observed that the Contractors had implemented all possible and feasible mitigation measures to mitigate the potential environmental impacts during construction phase works.

8.2 Recommendations

Potential environmental impacts due to the construction activities, including air quality, noise, water quality, waste, landscape and visual, will be monitored or reviewed. The recommended environmental mitigation measures shall be implemented on site and regular inspections as required will be carried out to ensure that the environmental conditions are acceptable.

Figure 1 Site Layout Plan and Monitoring Stations

Appendices

- A. Project Organisation
- B. Tentative Construction Programme
- C. Action and Limit Levels for Construction Phase
- D. Event and Action Plan for Air Quality, Noise, Landscape and Visual Impact
- E. Monitoring Schedule
- F. Calibration Certifications
- G. Graphical Plots of the Monitoring Results
- H. Meteorological Data Extracted from Hong Kong Observatory
- I. Waste Flow table
- J. Environmental Mitigation Measures – Implementation Status
- K. Cumulative Statistics on Complaints, Notifications of Summons and Successful Prosecutions

A. Project Organisation

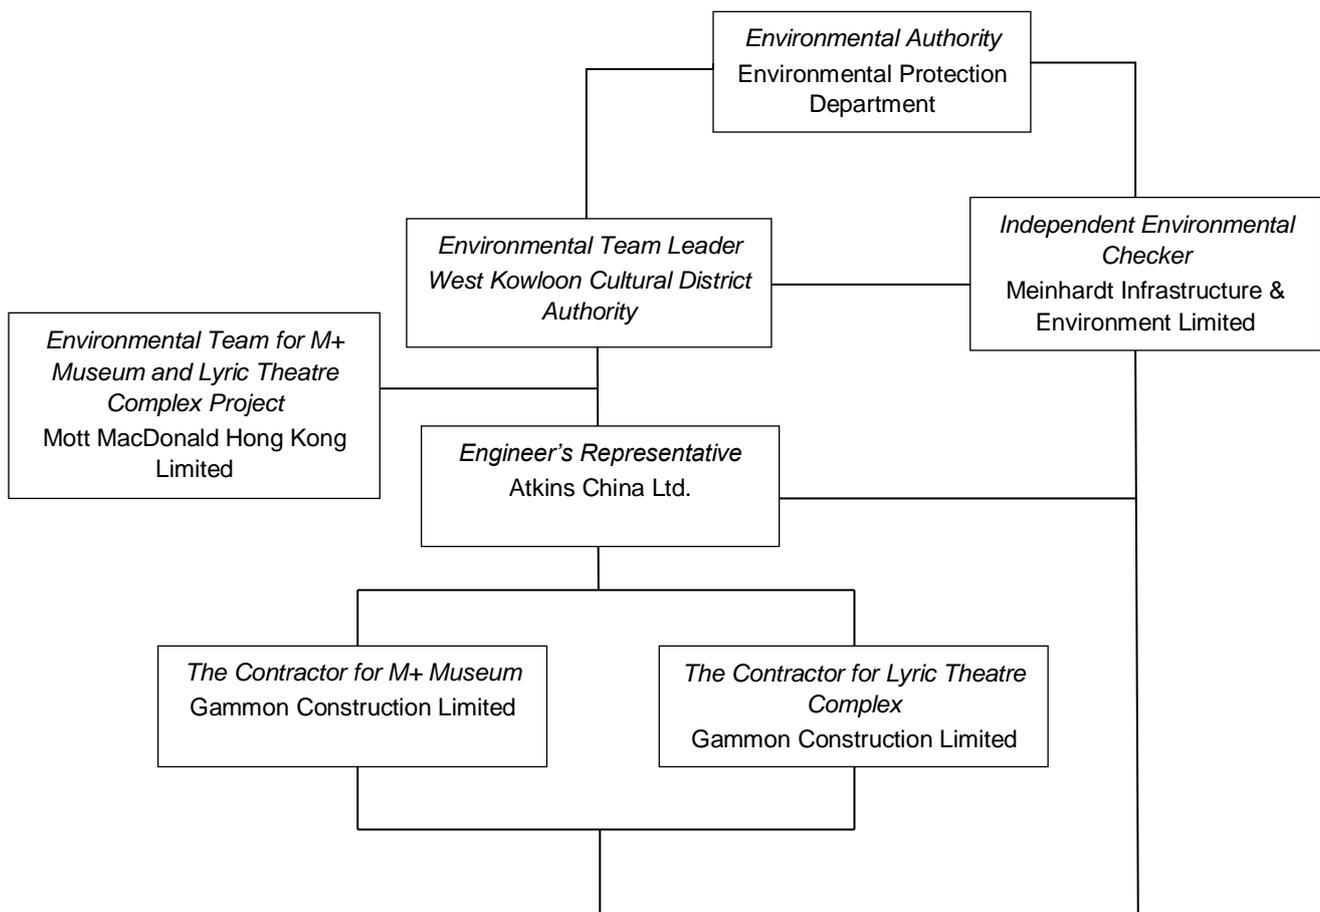


Table A-1: Contact information

| Company Name | Role | Name | Telephone |
|---|--|--------------------|-----------|
| Atkins China Ltd. | Assistant Resident Engineer | Ms. Gloria Lui | 5506 6361 |
| Meinhardt Infrastructure & Environment Limited | Independent Environmental Checker | Mr. Fredrick Leong | 2859 1739 |
| Gammon Construction Limited (M+ Museum) | Environmental Manager | Mr. Andy Leung | 9489 0035 |
| Gammon Construction Limited (Lyric Theatre Complex) | Environmental Manager | Ms. Sammie Chan | 9864 4296 |
| Mott MacDonald Hong Kong Ltd. | Contractor's Environmental Team Leader | Mr. Thomas Chan | 2828 5757 |
| West Kowloon Cultural District Authority | Senior Environmental Specialist | Mr. Brian Tam | 2200 0059 |

B. Tentative Construction Programme

M+ Museum

| ID | Activity | OD | Start | Finish | TF | 2019 | | | | | | | | | | | | 2020 | | | | | | | | | | | |
|-----------------------------------|--|-----|-----------|-----------|-----|-------|-----|-----|-------|-----|-----|-------|-----|-----|-------|-----|-----|-------|-----|-----|-------|-----|-----|-------|-----|-----|-------|-----|-----|
| | | | | | | Qtr 4 | | | Qtr 1 | | | Qtr 2 | | | Qtr 3 | | | Qtr 4 | | | Qtr 1 | | | Qtr 2 | | | Qtr 3 | | |
| | | | | | | Oct | Nov | Dec | Jan | Feb | Mar | Apr | May | Jun | Jul | Aug | Sep | Oct | Nov | Dec | Jan | Feb | Mar | Apr | May | Jun | Jul | Aug | Sep |
| Level 2 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 9543 | [LoE] POD_L2 - Structural Works | 120 | 27-Oct-18 | 25-Mar-19 | 27 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9547 | [LoE] POD_L2_Z01_Temp Exh/Gal/BoH/Lob/Corr - MEP Works | 199 | 26-Feb-19 | 23-Oct-19 | 36 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9548 | [LoE] POD_L2_Z01_Temp Exh/Gal/BoH/Lob/Corr - ABWF Wrks (Drying w/ Wild Air | 201 | 13-Feb-19 | 12-Oct-19 | 205 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9549 | [LoE] POD_L2_Z01_Temp Exh/Gal/BoH/Lob/Corr - ABWF Wrks (Drying w/ Wild Air | 81 | 23-Dec-19 | 06-Apr-20 | 70 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9550 | [LoE] POD_L2_Z02_Gal/BoH/Lob/Corr - MEP Works | 209 | 21-Mar-19 | 27-Nov-19 | 6 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9551 | [LoE] POD_L2_Z02_Gal/BoH/Lob/Corr - ABWF Wrks (Drying w/ Wild Air not req'd) | 211 | 14-Mar-19 | 22-Nov-19 | 176 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9552 | [LoE] POD_L2_Z02_Gal/BoH/Lob/Corr - ABWF Wrks (Drying w/ Wild Air req'd) | 130 | 18-Nov-19 | 28-Apr-20 | 51 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9553 | [LoE] POD_L2_Z03_Gal/BoH/Lob/Corr - MEP Works | 210 | 16-Mar-19 | 23-Nov-19 | 9 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9554 | [LoE] POD_L2_Z03_Gal/BoH/Lob/Corr - ABWF Wrks (Drying w/ Wild Air not req'd) | 232 | 14-Mar-19 | 17-Dec-19 | 155 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9555 | [LoE] POD_L2_Z03_Gal/BoH/Lob/Corr - ABWF Wrks (Drying w/ Wild Air req'd) | 91 | 21-Jan-20 | 15-May-20 | 37 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9557 | [LoE] POD_L2_Z04_Gal/BoH/Lob/Corr - MEP Works | 207 | 23-Mar-19 | 27-Nov-19 | 66 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9558 | [LoE] POD_L2_Z04_Gal/BoH/Lob/Corr - ABWF Wrks (Drying w/ Wild Air not req'd) | 250 | 19-Mar-19 | 14-Jan-20 | 133 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9559 | [LoE] POD_L2_Z04_Gal/BoH/Lob/Corr - ABWF Wrks (Drying w/ Wild Air req'd) | 150 | 18-Nov-19 | 22-May-20 | 31 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9560 | [LoE] POD_L2_Z05_Plaza - MEP Works | 108 | 08-Jul-19 | 14-Nov-19 | 18 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9561 | [LoE] POD_L2_Z05_Plaza - ABWF Works | 186 | 11-Jun-19 | 20-Jan-20 | 128 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level L3 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 9562 | [LoE] POD_L3 - Structural Works | 165 | 31-Oct-18 | 22-May-19 | 65 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9563 | [LoE] POD_L3_Z01 & L3_Z02 - MEP Works | 159 | 19-Apr-19 | 29-Oct-19 | 32 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9564 | [LoE] POD_L3_Z01 & L3_Z02 - ABWF Works | 201 | 25-Mar-19 | 22-Nov-19 | 177 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9751 | [LoE] POD_L3_Hard & Soft Landscaping incl MEP Works | 264 | 27-Mar-19 | 17-Feb-20 | 112 | | | | | | | | | | | | | | | | | | | | | | | | |
| EWS (External Wall System) | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 1210 | [LoE] POD_EWS_1MF - Podium Level 1MF Install Facade | 224 | 24-Oct-18 | 25-Jul-19 | 51 | | | | | | | | | | | | | | | | | | | | | | | | |
| 8049 | [LoE] POD_EWS_L2 - Podium Level 2 Install Facade | 139 | 18-Dec-18 | 10-Jun-19 | 13 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9565 | [LoE] POD_EWS_B1F - Pisa South Peri_Install GW | 110 | 04-May-19 | 11-Sep-19 | 1 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9566 | [LoE] POD_EWS_GF - Pisa Ceramic Tube Wall/GW w/ Ceramic Mullion Install | 60 | 08-Jun-19 | 17-Aug-19 | 18 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9567 | [LoE] POD_EWS_2F_BF/11-13 - Pisa_East/West_Install GW | 72 | 03-Jul-19 | 25-Sep-19 | 118 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9568 | [LoE] POD_EWS_3F_Skylight/Shop Front Glazing/Garden Roof & Wall Install | 154 | 01-Mar-19 | 02-Sep-19 | 16 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9569 | [LoE] POD_EWS_GF - Corrugated Alum Perforated Panels | 216 | 10-Apr-19 | 24-Dec-19 | 43 | | | | | | | | | | | | | | | | | | | | | | | | |
| Vertical Transportation | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 9752 | [LoE] POD_Verti_Transport_Lift - Fireman's Lift | 144 | 08-Dec-18 | 05-Jun-19 | 95 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9753 | [LoE] POD_Verti_Transport_Lift - Other Lift | 168 | 19-Jan-19 | 14-Aug-19 | 37 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9754 | [LoE] POD_Verti_Transport_Esc - Escalators | 175 | 04-May-19 | 29-Nov-19 | 64 | | | | | | | | | | | | | | | | | | | | | | | | |
| Risers | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 9570 | [LoE] POD_Risers (Stg 1_Duct 1/2/3/5) | 136 | 05-Nov-18 | 22-Apr-19 | 108 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9787 | [LoE] POD_Risers (Stg 2_Duct 4) | 42 | 26-Jul-19 | 12-Sep-19 | 2 | | | | | | | | | | | | | | | | | | | | | | | | |
| Staircases | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 9761 | [LoE] POD_Staircases - Not Required for Pressurisation | 174 | 01-Apr-19 | 28-Oct-19 | 198 | | | | | | | | | | | | | | | | | | | | | | | | |
| 9762 | [LoE] POD_Staircases - Required for Pressurisation | 169 | 01-Apr-19 | 22-Oct-19 | 203 | | | | | | | | | | | | | | | | | | | | | | | | |
| M+ TOWER | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Construction | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 4 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 9851 | [LoE] TW_L4 - Rem Structural Works (ST-02/02A) | 18 | 01-Nov-18 | 21-Nov-18 | 201 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6562 | [LoE] TW_L4 - MEP Works (excl other prelim works) | 98 | 01-Jun-19 | 26-Sep-19 | 21 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6561 | [LoE] TW_L4 - ABWF Works (excl wet trades or other prelim works) | 158 | 23-Apr-19 | 30-Oct-19 | 90 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 5 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 6546 | [LoE] TW_L5 - MEP Works (excl other prelim works) | 135 | 30-Apr-19 | 10-Oct-19 | 99 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6545 | [LoE] TW_L5 - ABWF Works (excl wet trades or other prelim works) | 159 | 23-Apr-19 | 31-Oct-19 | 89 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 6 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 6559 | [LoE] TW_L5 - MEP Works (excl other prelim works) | 213 | 26-Feb-19 | 08-Nov-19 | 74 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6558 | [LoE] TW_L6 - ABWF Works (excl wet trades or other prelim works) | 191 | 02-Apr-19 | 18-Nov-19 | 74 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 7 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 6557 | [LoE] TW_L7 - MEP Works (excl other prelim works) | 217 | 26-Feb-19 | 13-Nov-19 | 70 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6556 | [LoE] TW_L7 - ABWF Works (excl wet trades or other prelim works) | 178 | 23-Apr-19 | 22-Nov-19 | 70 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 8 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 6555 | [LoE] TW_L8 - MEP Works (excl other prelim works) | 222 | 26-Feb-19 | 19-Nov-19 | 67 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6554 | [LoE] TW_L8 - ABWF Works (excl wet trades or other prelim works) | 200 | 02-Apr-19 | 28-Nov-19 | 65 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 9 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 6553 | [LoE] TW_L9 - MEP Works (excl other prelim works) | 230 | 26-Feb-19 | 28-Nov-19 | 57 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6552 | [LoE] TW_L9 - ABWF Works (excl wet trades or other prelim works) | 202 | 10-Apr-19 | 07-Dec-19 | 57 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 10 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 6551 | [LoE] TW_L10 - MEP Works (excl other prelim works) | 230 | 26-Feb-19 | 28-Nov-19 | 57 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6550 | [LoE] TW_L10 - ABWF Works (excl wet trades or other prelim works) | 251 | 11-Feb-19 | 07-Dec-19 | 57 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 11 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 6548 | [LoE] TW_L11 - MEP Works (excl other prelim works) | 231 | 22-Feb-19 | 26-Nov-19 | 58 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6547 | [LoE] TW_L11 - ABWF Works (excl wet trades or other prelim works) | 250 | 11-Feb-19 | 06-Dec-19 | 58 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 12 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 6563 | [LoE] TW_L12 - Structural Works (ST-02/02a) | 18 | 15-Oct-18 | 05-Nov-18 | 161 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6565 | [LoE] TW_L12 - MEP Works (excl other prelim works) | 237 | 22-Feb-19 | 03-Dec-19 | 53 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6564 | [LoE] TW_L12 - ABWF Works (excl wet trades or other prelim works) | 255 | 11-Feb-19 | 12-Dec-19 | 53 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 13 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 6566 | [LoE] TW_L13 - Structural Works (ST-02/02a) | 18 | 06-Nov-18 | 26-Nov-18 | 161 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6568 | [LoE] TW_L13 - MEP Works (excl other prelim works) | 242 | 26-Feb-19 | 12-Dec-19 | 50 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6567 | [LoE] TW_L13 - ABWF Works (excl wet trades or other prelim works) | 235 | 15-Mar-19 | 21-Dec-19 | 45 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 14 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 6569 | [LoE] TW_L14 - Structural Works (ST-03, 02, 02a) | 22 | 22-Nov-18 | 17-Dec-18 | 161 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6572 | [LoE] TW_L14 - MEP Works | 242 | 26-Feb-19 | 12-Dec-19 | 50 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6570 | [LoE] TW_L14 - ABWF Works (excl wet trades or other prelim works) | 235 | 15-Mar-19 | 21-Dec-19 | 45 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 15 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 6573 | [LoE] TW_L15 - Structural Works (ST-02/02a/03 & East Core Rem Structure) | 61 | 29-Oct-18 | 09-Jan-19 | 161 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6575 | [LoE] TW_L15 - MEP Works | 225 | 26-Feb-19 | 23-Nov-19 | 67 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6574 | [LoE] TW_L15 - ABWF Works (excl wet trades or other prelim works) | 218 | 15-Mar-19 | 03-Dec-19 | 62 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 16 | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 6576 | [LoE] TW_L16 - Structural Works (Rem Superstructure & Stair Cases) | 65 | 29-Oct-18 | 14-Jan-19 | 101 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6578 | [LoE] TW_L16 - MEP Works | 213 | 26-Feb-19 | 09-Nov-19 | 79 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6577 | [LoE] TW_L16 - ABWF Works (excl wet trades or other prelim works) | 169 | 29-Apr-19 | 19-Nov-19 | 74 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level RF | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| Level 2 Summary | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 6579 | [LoE] TW_RF - Structural Works (Rem Super-structure Works) | 65 | 29-Oct-18 | 14-Jan-19 | 101 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6581 | [LoE] TW_RF - MEP Works | 183 | 29-Jan-19 | 11-Sep-19 | 118 | | | | | | | | | | | | | | | | | | | | | | | | |
| 6580 | [LoE] TW_RF - ABWF Works | 192 | 19-Feb-19 | 09-Oct-19 | 109 | | | | | | | | | | | | | | | | | | | | | | | | |
| Level URF | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |

Lyric Theatre Complex

| Activity ID | Activity Name | Start Date | Finish Date | 2019 | | | |
|---|---|-------------|-------------|--------|--------|--------|--------|
| | | | | May 17 | Jun 18 | Jul 19 | Aug 20 |
| L1 Contract for Lyric Theatre Complex (3MRP) - Enviromental | | | | | | | |
| Cost Centre B - Excavation and Lateral Support (ELS) Stage 2 | | | | | | | |
| Excavation and ELS Works (Stage 2) | | | | | | | |
| CB160800 | [South - Area 1 & 2] Excavate to -9.0, -11.3, -14.2mPD w/ Soil Berm (29,690 cu.m) | 26-Apr-19 A | 08-Jun-19 | | | | |
| CB160900 | [South - Area 1 & 2] Pile Head Treatment at Central Portion (54 nr BP) | 08-May-19 A | 17-Jun-19 | | | | |
| CB161020 | [South - Area 1 & 2] Install 5th Layer of Strut S5 | 05-Jul-19 | 01-Aug-19 | | | | |
| CB161030 | [South - Area 1 & 2] Excavate South / West Soil Berm to -12.4mPD (18,145 cu.m) | 19-Jul-19 | 15-Aug-19 | | | | |
| CB162000 | [North - Area 3 & 4] Excavate to Formation Level -9.6 mPD (46,575 cu.m) | 18-Apr-19 A | 22-Jun-19 | | | | |
| CB162100 | [North - Area 3 & 4] Pile Head Treatment (52 nr BP) | 23-May-19 A | 18-Jul-19 | | | | |
| Cost Centre C - Basement | | | | | | | |
| Cost Centre C1 - Essential Basement Structure (Excl. AET Protection & Box Culvert) | | | | | | | |
| CC100100 | [South - L01] Blinding Layer for Pile Cap / B2 Slab at Central Portion | 30-Apr-19 A | 19-Jun-19 | | | | |
| CC100200 | [South - L01] Construct Central Pile Cap / B2 Slab at -11.3mPD & -14.2mPD | 09-May-19 A | 18-Jul-19 | | | | |
| CC100210 | [South - L01] Blinding Layer for Pile Cap / B2 Slab at South / West | 16-Aug-19 | 05-Sep-19 | | | | |
| CC100220 | [South - L01] Construct South / West Pile Cap / B2 Slab at -12.4mPD | 19-Aug-19 | 27-Sep-19 | | | | |
| CC101400 | [North - L04] Blinding Layer for Pile Cap / B2 Slab | 20-Jun-19 | 25-Jul-19 | | | | |
| CC101500 | [North - L04] Construct Pile Cap / B2 Slab at -9.6mPD | 22-Jun-19 | 22-Aug-19 | | | | |
| CC101600 | [North - L04] Remove Strut Layer S4 | 13-Aug-19 | 17-Sep-19 | | | | |
| CC102420 | [Area 6 - L06] Construct B1-B1M Columns & Structural Walls | 10-Dec-18 A | 04-Jun-19 | | | | |
| CC102430 | [Area 6 - L06] Construct B1M Beam & Slab | 14-Jan-19 A | 12-Jun-19 | | | | |
| CC102510 | [Area 6 - L06] Construct B1M-GF Columns & Structural Walls | 13-May-19 A | 02-Jul-19 | | | | |
| CC102520 | [Area 6 - L06] Construct GF Beam & Slab (South & Northeast) | 01-Jun-19 | 18-Jul-19 | | | | |
| CC102600 | [Area 6 - L06] Modify Pile Wall for Connection M+ Basement | 01-Jun-19 | 18-Jul-19 | | | | |
| CAI No. 012 Advance Works for Artist Square Bridge | | | | | | | |
| P34 Stair & Lift Tower | | | | | | | |
| CAI12264 | Demobilize Plant & Cure Concrete | 02-May-19 A | 08-May-19 A | | | | |
| CAI12268 | Interface Core, Sonic Test & Submit Record | 09-May-19 A | 21-May-19 A | | | | |
| CAI12270 | Full Coring (BP1 & BP3) | 23-May-19 A | 28-May-19 A | | | | |
| CAI12290 | Post Grouting Works | 29-May-19 A | 01-Jun-19 | | | | |
| CAI12310 | ELS Submission for HyD Approval / Consent | 03-Jun-19 | 02-Jul-19 | | | | |
| CAI12320 | ELS Works & Excavate to Formation Level | 03-Jul-19 | 20-Aug-19 | | | | |

| | | | |
|---|---|---|--|
| Remaining Work Critical Remaining Work Actual Work Milestone | Project ID: L13MRP-20190531-Env Layout: L1-3MRP (Env) | <p align="center">West Kowloon Cultural District Authority L1 Contract for Lyric Theatre Complex & Extended Basement Three Month Rolling Programme (3MRP) - Status as of 31 May 2019</p> | |
|---|---|---|--|

| Activity ID | Activity Name | Start Date | Finish Date | 2019 | | | |
|--|--|-------------|-------------|--------|--------|--------|--------|
| | | | | May 17 | Jun 18 | Jul 19 | Aug 20 |
| Cost Centre D - Public Infrastructure Works (PIW) | | | | | | | |
| Cost Centre D2 - Austin Road West Lay-by | | | | | | | |
| Cost Centre D2.1 Roadworks and Remaining | | | | | | | |
| MC30-Ch.170 to MC30-Ch.150 | | | | | | | |
| CD210730 | MC30-Ch170-150: Roadworks & Footpath | 30-Jan-19 A | 15-Jun-19 | | | | |
| CD210750 | MC30-Ch170-150: Install Street Furniture & Lighting | 17-Jun-19 | 08-Jul-19 | | | | |
| MC30-Ch.150 to MC30-Ch.100 | | | | | | | |
| CD210630 | MC30-Ch150-100: Roadworks & Footpath | 13-Feb-19 A | 29-Jun-19 | | | | |
| CD210650 | MC30-Ch150-100: Install Street Furniture & Lighting | 09-Jul-19 | 29-Jul-19 | | | | |
| MC30-Ch.100 to MC30-Ch.50 | | | | | | | |
| CD210530 | MC30-Ch100-50: Roadworks & Footpath | 02-Jul-19 | 16-Aug-19 | | | | |
| CD210535 | MC30-Ch100-50: Maintenance Staircase | 27-Jul-19 | 16-Aug-19 | | | | |
| CD210550 | MC30-Ch100-50: Install Street Furniture & Lighting | 17-Aug-19 | 06-Sep-19 | | | | |
| MC30-Ch.50 to MC30-Ch.00 | | | | | | | |
| CD210420 | MC30-Ch50-00: DN450 Freshwater (0+64 - 0+14) | 24-Jun-19 | 29-Jul-19 | | | | |
| CD210425 | MC30-Ch50-00: DN450 Salt Water (0+062 - 0+12) | 11-Jul-19 | 14-Aug-19 | | | | |
| Cost Centre D2.2 Drainage | | | | | | | |
| MC20-Ch.140 to MC20-Ch.00 | | | | | | | |
| CD220180 | MC20-Ch140-00: 1800mm dia Drainage (SF1.2A_2 to SF1.1) - 20m | 04-Jan-19 A | 30-May-19 A | | | | |
| CD220190 | MC20-Ch140-00: 1800mm dia Drainage (SF1.1 to SF1.1B) - 30m | 01-Jun-19 | 15-Jul-19 | | | | |
| Cost Centre D2.3 Sewerage | | | | | | | |
| MC30-Ch.170 to MC30-Ch.00 | | | | | | | |
| CD230120 | MC30-Ch170-00: 450mm dia Sewer (F1.8 to F1.9) - 30m | 08-Apr-19 A | 15-Jun-19 | | | | |
| CD230130 | MC30-Ch170-00: 450mm dia Sewer (F1.9 to F1.9A) - 22m | 18-May-19 A | 27-Jun-19 | | | | |
| MC20-Ch.140 to MC20-Ch.00 | | | | | | | |
| CD230140 | MC20-Ch140-00: 450mm dia Sewer (F1.9A to F1.10) - 12m | 28-Jun-19 | 19-Jul-19 | | | | |
| CD230150 | MC20-Ch140-00: 450mm dia Sewer (F1.10 to F1.6B) - 32m | 20-Jul-19 | 30-Aug-19 | | | | |

Remaining Work
 Critical Remaining Work
 Actual Work
 Milestone

Project ID:
 L13MRP-20190531-Env
 Layout: L1-3MRP (Env)

West Kowloon Cultural District Authority
L1 Contract for Lyric Theatre Complex & Extended Basement
Three Month Rolling Programme (3MRP) - Status as of 31 May 2019



C. Action and Limit Levels for Construction Phase

Air Quality

The Action and Limit Levels for 1-hour and 24-hour TSP for the monitoring station are presented in following tables:

Table C-1: Action and Limit Levels for 1-hour TSP

| Monitoring Station | Action Level (mg/m ³) | Limit Level (mg/m ³) |
|--------------------|-----------------------------------|----------------------------------|
| AM1 | 273.7 | 500 |
| AM2B | 274.2 | 500 |

Table C-2: Action and Limit Levels for 24-hour TSP

| Monitoring Station | Action Level (µg/m ³) | Limit Level (µg/m ³) |
|--------------------|-----------------------------------|----------------------------------|
| AM1 | 143.6 | 260 |
| AM2B | 151.1 | 260 |

Noise

The Action and Limit Levels for Noise for the monitoring stations are presented in following table:

Table C-3: Action and Limit Levels for Construction Noise

| Time Period & Monitoring Locations | Action Level | Limit Level |
|--|---|-------------|
| NM1A 0700-1900 hours on normal weekdays | When one documented complaint is received from any one of the sensitive receivers | 75 dB(A) |

D. Event and Action Plan for Air Quality, Noise, Landscape and Visual Impact

Air Quality

In case the Action and Limit Levels are not complied during construction stage, the following Event and Action Plan should be followed:

Table D-1: Event and Action Plan for Air Quality

| Event | Action | | | |
|---|---|---|---|--|
| | ET | IEC | WKCD | Contractor |
| Action Level | | | | |
| 1. Exceedance for one sample | <ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Inform IEC and WKCD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily. | <ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method. | <ol style="list-style-type: none"> 1. Notify Contractor | <ol style="list-style-type: none"> 1. Rectify any unacceptable practice; 2. Amend working methods if appropriate. |
| 2. Exceedance for two or more consecutive samples | <ol style="list-style-type: none"> 1. Identify source; 2. Inform IEC and WKCD; 3. Advise the WKCD on the effectiveness of the proposed remedial measures; 4. Repeat measurements to confirm findings; 5. Increase monitoring frequency to daily; 6. Discuss with IEC and Contractor on remedial actions required; 7. If exceedance continues, arrange meeting with IEC and WKCD; 8. If exceedance stops, cease additional monitoring. | <ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ET on the effectiveness of the proposed remedial measures; 5. Monitor the implementation of remedial measures. | <ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Ensure remedial measures properly implemented. | <ol style="list-style-type: none"> 1. Submit proposals for remedial to WKCD within three working days of notification; 2. Implement the agreed proposals; 3. Amend proposal if appropriate. |
| Limit Level | | | | |
| 1. Exceedance for one sample | <ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Inform WKCD, Contractor and EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and WKCD informed of the results. | <ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the WKCD on the effectiveness of the proposed remedial measures; 5. Monitor the implementation of remedial measures. | <ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Ensure remedial measures properly implemented. | <ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within three working days of notification; 3. Implement the agreed proposals; 4. Amend proposal if appropriate. |

Event**Action**

| | | | | |
|---|--|--|---|--|
| 2. Exceedance for two or more consecutive samples | <ol style="list-style-type: none">1. Notify IEC, WKCDA, Contractor and EPD;2. Identify source;3. Repeat measurement to confirm findings;4. Increase monitoring frequency to daily;5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;6. Arrange meeting with IEC and WKCDA to discuss the remedial actions to be taken;7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and WKCDA informed of the results;8. If exceedance stops, cease additional monitoring. | <ol style="list-style-type: none">1. Check monitoring data submitted by ET;2. Check Contractor's working method;3. Discuss amongst WKCDA, ET, and Contractor on the potential remedial actions;4. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the WKCDA accordingly;5. Monitor the implementation of remedial measures. | <ol style="list-style-type: none">1. Confirm receipt of notification of failure in writing;2. Notify Contractor;3. In consolidation with the IEC, agree on the remedial measures to be implemented;4. Ensure remedial measures properly implemented;5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. | <ol style="list-style-type: none">1. Take immediate action to avoid further exceedance;2. Submit proposals for remedial actions to IEC within three working days of notification;3. Implement the agreed proposals;4. Resubmit proposals if problem still not under control;5. Stop the relevant portion of works as determined by the WKCDA until the exceedance is abated. |
|---|--|--|---|--|

Construction Noise

In case the Action and Limit Levels are not complied during construction stage, the following Event and Action Plan should be followed:

Table D-2: Event and Action Plan for Construction Noise

| Event | Action | | | |
|--------------|---|---|--|---|
| | ET | IEC | WKCD | Contractor |
| Action Level | <ol style="list-style-type: none"> 1. Notify WKCD, IEC and Contractor; 2. Carry out investigation; 3. Report the results of investigation to the IEC, WKCD and Contractor; 4. Discuss with the IEC and Contractor on remedial measures required; 5. Increase monitoring frequency to check mitigation effectiveness. | <ol style="list-style-type: none"> 1. Review the investigation results submitted by the ET; 2. Review the proposed remedial measures by the Contractor and advise the WKCD accordingly; 3. Advise the WKCD on the effectiveness of the proposed remedial measures. | <ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Supervise the implementation of remedial measures. | <ol style="list-style-type: none"> 1. Submit noise mitigation proposals to IEC and WKCD; 2. Implement noise mitigation proposals. |
| Limit Level | <ol style="list-style-type: none"> 1. Inform IEC, WKCD, Contractor and EPD; 2. Repeat measurements to confirm findings; 3. Increase monitoring frequency; 4. Identify source and investigate the cause of exceedance; 5. Carry out analysis of Contractor's working procedures; 6. Discuss with the IEC, Contractor and WKCD on remedial measures required; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and WKCD informed of the results; 8. If exceedance stops, cease additional monitoring. | <ol style="list-style-type: none"> 1. Discuss amongst WKCD, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the WKCD accordingly. | <ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Supervise the implementation of remedial measures; 5. If exceedance continues, consider stopping the Contractor to continue working on that portion of work which causes the exceedance until the exceedance is abated. | <ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC and WKCD within 3 working days of notification; 3. Implement the agreed proposals; 4. Submit further proposal if problem still not under control; 5. Stop the relevant portion of works as instructed by the WKCD until the exceedance is abated. |

Landscape and Visual Impact

In case of non-compliance of landscape and visual impacts, procedures in accordance with the Event and Action Plan should be followed:

Table D-3: Event and Action Plan for Landscape and Visual Impact

| Event | Action | | | |
|--------------------------------|--|--|---|--|
| | ET | IEC | WKCD A | Contractor |
| Design Check | <ol style="list-style-type: none"> 1. Design check to make sure the design complies with all the proposed mitigation measures in the EIA report; 2. Prepare and submit report. | <ol style="list-style-type: none"> 1. Check report submitted by ET; 2. Recommend remedial design if necessary. | <ol style="list-style-type: none"> 1. Undertake remedial design if necessary. | - |
| Non-conformity on one occasion | <ol style="list-style-type: none"> 1. Identify source of non-conformity; 2. Report to IEC and WKCD A; 3. Discuss remedial actions with IEC, WKCD A and Contractor; 4. Monitor remedial actions until rectification has been completed. | <ol style="list-style-type: none"> 1. Check and verify source of non-conformity; 2. Discuss remedial actions with ET and Contractor; 3. Advise WKCD A on effectiveness of proposed remedial actions; 4. Check implementation of remedial actions. | <ol style="list-style-type: none"> 1. Notify Contractor; 2. Ensure remedial actions are properly implemented. | <ol style="list-style-type: none"> 1. Amend working method as necessary; 2. Rectify damage and undertake necessary replacement and remedial actions. |
| Repeated conformity | <ol style="list-style-type: none"> 1. Identify source of non-conformity; 2. Report to IEC and WKCD A; 3. Increase monitoring frequency; 4. Discuss remedial actions with IEC, WKCD A and Contractor; 5. Monitor remedial actions until rectification has been completed; 6. If non-conformity rectified, reduce monitoring frequency back to normal. | <ol style="list-style-type: none"> 1. Check and verify source of non-conformity; 2. Check Contractor's working method; 3. Discuss remedial actions with ET and Contractor; 4. Advise WKCD A on effectiveness of proposed remedial actions; 5. Supervise implementation of remedial actions. | <ol style="list-style-type: none"> 1. Notify Contractor; 2. Ensure remedial actions are properly implemented. | <ol style="list-style-type: none"> 1. Amend working method as necessary; 2. Rectify damage and undertake necessary replacement and remedial actions. |

E. Monitoring Schedule

MAY 2019

| Sunday | Monday | Tuesday | Wednesday | Thursday | Friday | Saturday |
|--------|---|--|---|--|---------------------------------------|----------|
| | | | 1 | 2 | 3 AM1, AM2B - 24hrTSP, 1hr TSP x3 | 4 |
| 5 | 6 | 7 | 8 | 9 AM1, AM2B - 24hrTSP, 1hr TSP x3 NM1A - Noise Impact Monitoring | 10 | 11 |
| 12 | 13 | 14 | 15 AM1, AM2B - 24hrTSP, 1hr TSP x3 NM1A - Noise Impact Monitoring | 16 | 17 | 18 |
| 19 | 20 | 21 AM1, AM2B - 24hrTSP, 1hr TSP x3 NM1A - Noise Impact Monitoring | 22 | 23 | 24 | 25 |
| 26 | 27 AM1, AM2B - 24hrTSP, 1hr TSP x3 NM1A - Noise Impact Monitoring | 28 | 29 | 30 | 31 AM1, AM2B - 24hrTSP, 1hr TSP x3 | |
| | | Notes: AM1 - International Commerce Centre (ICC) AM2B - Austin Road West (Opposite to The Harbourside) NM1A - International Commerce Centre (ICC) | | | | |

JUNE 2019

| Sunday | Monday | Tuesday | Wednesday | Thursday | Friday | Saturday |
|--------|---|--|---|--|---------------------------------------|----------|
| | | | | | | 1 |
| 2 | 3 | 4 | 5 | 6 AM1, AM2B - 24hrTSP, 1hr TSP x3 NM1A - Noise Impact Monitoring | 7 | 8 |
| 9 | 10 | 11 | 12 AM1, AM2B - 24hrTSP, 1hr TSP x3 NM1A - Noise Impact Monitoring | 13 | 14 | 15 |
| 16 | 17 | 18 AM1, AM2B - 24hrTSP, 1hr TSP x3 NM1A - Noise Impact Monitoring | 19 | 20 | 21 | 22 |
| 23 | 24 AM1, AM2B - 24hrTSP, 1hr TSP x3 NM1A - Noise Impact Monitoring | 25 | 26 | 27 | 28 AM1, AM2B - 24hrTSP, 1hr TSP x3 | 29 |
| 30 | | Notes: AM1 - International Commerce Centre (ICC) AM2B - Austin Road West (Opposite to The Harbourside) NM1A - International Commerce Centre (ICC) | | | | |

F. Calibration Certifications

High-Volume TSP Sampler
5-Point Calibration Record

Location : AM1(ICC)
 Calibrated by : K.T.Ho
 Date : 04/04/2019

Sampler

Model : TE-5170
 Serial Number : S/N 0767

Calibration Orifice and Standard Calibration Relationship

Serial Number : 2454
 Service Date : 25 February 2019
 Slope (m) : 2.07076
 Intercept (b) : -0.02917
 Correlation Coefficient(r) : 1.00000

Standard Condition

Pstd (hpa) : 1013
 Tstd (K) : 298.18

Calibration Condition

Pa (hpa) : 1010
 Ta(K) : 301

| Resistance Plate | dH [green liquid] (inch water) | Z | X=Qstd (cubic meter/min) | IC (chart) | Y (corrected) |
|------------------|-----------------------------------|-------|-----------------------------|---------------|------------------|
| 1 18 holes | 12.0 | 3.442 | 1.676 | 60 | 59.61 |
| 2 13 holes | 8.2 | 2.845 | 1.388 | 52 | 51.66 |
| 3 10 holes | 6.2 | 2.474 | 1.209 | 42 | 41.73 |
| 4 7 holes | 3.8 | 1.937 | 0.949 | 32 | 31.79 |
| 5 5 holes | 2.2 | 1.474 | 0.726 | 20 | 19.87 |

Notes: $Z = \sqrt{dH(Pa/Pstd)(Tstd/Ta)}$, $X = Z/m - b$, $Y(\text{Corrected Flow}) = IC * \sqrt{Pa/Pstd}(Tstd/Ta)$

Sampler Calibration Relationship

Slope(m): 42.230 Intercept(b): -9.303 Correlation Coefficient(r): 0.9938

Checked by: 
 Magnum Fan

Date: 06/04/2019

High-Volume TSP Sampler
5-Point Calibration Record

Location : AM2B (The Harbourside)
 Calibrated by : K.T.Ho
 Date : 20/03/2019

Sampler

Model : TE-5170
 Serial Number : S/N 8919

Calibration Orifice and Standard Calibration Relationship

Serial Number : 2454
 Service Date : 25 February 2019
 Slope (m) : 2.07076
 Intercept (b) : -0.02917
 Correlation Coefficient(r) : 1.00000

Standard Condition

Pstd (hpa) : 1013
 Tstd (K) : 298.18

Calibration Condition

Pa (hpa) : 1018
 Ta(K) : 296

| Resistance Plate | dH [green liquid] (inch water) | Z | X=Qstd (cubic meter/min) | IC (chart) | Y (corrected) |
|------------------|-----------------------------------|-------|-----------------------------|---------------|------------------|
| 1 18 holes | 12.0 | 3.484 | 1.704 | 58 | 58.34 |
| 2 13 holes | 9.0 | 3.018 | 1.477 | 52 | 52.30 |
| 3 10 holes | 6.2 | 2.505 | 1.227 | 42 | 42.25 |
| 4 7 holes | 4.0 | 2.012 | 0.987 | 34 | 34.20 |
| 5 5 holes | 2.0 | 1.422 | 0.700 | 22 | 22.13 |

Notes: $Z = \sqrt{dH(Pa/Pstd)(Tstd/Ta)}$, $X = Z/m - b$, $Y(\text{Corrected Flow}) = IC * \{\sqrt{Pa/Pstd}(Tstd/Ta)\}$

Sampler Calibration Relationship

Slope(m): 36.311 Intercept(b): -2.421 Correlation Coefficient(r): 0.9977

Checked by: 
 Magnum Fan

Date: 22/03/2019

High-Volume TSP Sampler
5-Point Calibration Record

Location : AM2B (The Harbourside)
 Calibrated by : K.T.Ho
 Date : 20/05/2019

Sampler

Model : TE-5170
 Serial Number : S/N 8919

Calibration Orifice and Standard Calibration Relationship

Serial Number : 2454
 Service Date : 25 February 2019
 Slope (m) : 2.07076
 Intercept (b) : -0.02917
 Correlation Coefficient(r) : 1.00000

Standard Condition

Pstd (hpa) : 1013
 Tstd (K) : 298.18

Calibration Condition

Pa (hpa) : 1008
 Ta(K) : 303

| Resistance Plate | dH [green liquid] (inch water) | Z | X=Qstd (cubic meter/min) | IC (chart) | Y (corrected) |
|------------------|-----------------------------------|-------|-----------------------------|---------------|------------------|
| 1 18 holes | 12.0 | 3.427 | 1.669 | 60 | 59.36 |
| 2 13 holes | 8.2 | 2.833 | 1.382 | 50 | 49.46 |
| 3 10 holes | 6.2 | 2.463 | 1.204 | 42 | 41.55 |
| 4 7 holes | 3.8 | 1.928 | 0.945 | 32 | 31.66 |
| 5 5 holes | 2.2 | 1.467 | 0.723 | 20 | 19.79 |

Notes: $Z = \sqrt{dH(Pa/Pstd)(Tstd/Ta)}$, $X = Z/m - b$, $Y(\text{Corrected Flow}) = IC * \{\sqrt{Pa/Pstd}(Tstd/Ta)\}$

Sampler Calibration Relationship

Slope(m): 41.512 Intercept(b): -8.811 Correlation Coefficient(r): 0.9970

Checked by: 
 Magnum Fan

Date: 28/05/2019



RECALIBRATION

DUE DATE:

February 25, 2020

Certificate of Calibration

Calibration Certification Information

Cal. Date: February 25, 2019 Rootsmeter S/N: 438320 Ta: 294 °K
 Operator: Jim Tisch Pa: 762.0 mm Hg
 Calibration Model #: TE-5025A Calibrator S/N: 2454

| Run | Vol. Init (m3) | Vol. Final (m3) | ΔVol. (m3) | ΔTime (min) | ΔP (mm Hg) | ΔH (in H2O) |
|-----|----------------|-----------------|------------|-------------|------------|-------------|
| 1 | 1 | 2 | 1 | 1.4400 | 3.2 | 2.00 |
| 2 | 3 | 4 | 1 | 1.0200 | 6.4 | 4.00 |
| 3 | 5 | 6 | 1 | 0.9120 | 7.9 | 5.00 |
| 4 | 7 | 8 | 1 | 0.8700 | 8.8 | 5.50 |
| 5 | 9 | 10 | 1 | 0.7180 | 12.8 | 8.00 |

Data Tabulation

| Vstd (m3) | Qstd (x-axis) | $\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)}$ (y-axis) | Va | Qa (x-axis) | $\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)}$ (y-axis) |
|-------------|---------------|--|-----------|-------------|---|
| 1.0120 | 0.7028 | 1.4257 | 0.9958 | 0.6915 | 0.8784 |
| 1.0077 | 0.9880 | 2.0162 | 0.9916 | 0.9722 | 1.2423 |
| 1.0057 | 1.1028 | 2.2542 | 0.9896 | 1.0851 | 1.3889 |
| 1.0045 | 1.1546 | 2.3642 | 0.9885 | 1.1362 | 1.4567 |
| 0.9992 | 1.3916 | 2.8513 | 0.9832 | 1.3694 | 1.7569 |
| QSTD | m= | 2.07076 | QA | m= | 1.29667 |
| | b= | -0.02917 | | b= | -0.01797 |
| | r= | 1.00000 | | r= | 1.00000 |

Calculations

| | |
|---|--|
| Vstd= $\Delta Vol((Pa-\Delta P)/Pstd)(Tstd/Ta)$ | Va= $\Delta Vol((Pa-\Delta P)/Pa)$ |
| Qstd= $Vstd/\Delta Time$ | Qa= $Va/\Delta Time$ |
| For subsequent flow rate calculations: | |
| Qstd= $1/m \left(\left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)} \right) - b \right)$ | Qa= $1/m \left(\left(\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)} \right) - b \right)$ |

Standard Conditions

| | |
|-------|---------------------------------------|
| Tstd: | 298.15 °K |
| Pstd: | 760 mm Hg |
| Key | |
| ΔH: | calibrator manometer reading (in H2O) |
| ΔP: | rootsmeter manometer reading (mm Hg) |
| Ta: | actual absolute temperature (°K) |
| Pa: | actual barometric pressure (mm Hg) |
| b: | intercept |
| m: | slope |

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30



ALS Laboratory Group

ANALYTICAL CHEMISTRY & TESTING SERVICES

SUB-CONTRACTING REPORT

| | | | |
|---------|--|----------------|--------------------|
| CONTACT | : MR K.W. FAN | WORK ORDER | : HK1864495 |
| CLIENT | : ENVIROTECH SERVICES CO. | | |
| ADDRESS | : RM113, 1/F, MY LOFT, 9 HOI WING ROAD, TUEN MUN, N.T. HONG KONG | SUB-BATCH | : 1 |
| | | DATE RECEIVED | : 11-DEC-2018 |
| | | DATE OF ISSUE | : 28-DEC-2018 |
| PROJECT | : ---- | NO. OF SAMPLES | : 1 |
| | | CLIENT ORDER | : ---- |

General Comments

- Sample(s) were received in ambient condition.
- Sample(s) analysed and reported on as received basis.
- Calibration was subcontracted to and analysed by Action United Enviro Services.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Richard Fung

General Manager

This is the Final Report and supersedes any preliminary report with this batch number.

Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ALS Technichem (HK) Pty Ltd
Part of the ALS Laboratory Group

11/F, Chung Shun Knitting Centre 1 - 3 Wing Yip Street Kwai Chung N.T. Hong Kong
Tel. +852 2610 1044 Fax +852 2610 2021 www.alsglobal.com

WORK ORDER : HK1864495
SUB-BATCH : 1
CLIENT : ENVIROTECH SERVICES CO.
PROJECT : ---



| ALS Lab ID | Client's Sample ID | Sample Type | Sample Date | External Lab Report No. |
|---------------|--------------------|-------------|-------------|-------------------------|
| HK1864495-001 | S/N: 235780 | Equipments | 11-Dec-2018 | S/N: 235780 |

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor
 Manufacturer: Sibata LD-3B
 Serial No. 235780
 Equipment Ref: Nil
 Job Order HK1864495

Standard Equipment:

Standard Equipment: Higher Volume Sampler
 Location & Location ID: AUES office (calibration room)
 Equipment Ref: HVS 018
 Last Calibration Date: 21 September 2018


Equipment Verification Results:

Testing Date: 17&18 December 2018

| Hour | Time | Mean Temp °C | Mean Pressure (hPa) | Concentration in mg/m ³ (Standard Equipment) | Total Count (Calibrated Equipment) | Count/Minute (Total Count/min) |
|----------|---------------|--------------|---------------------|---|------------------------------------|--------------------------------|
| 2hr03min | 12:20 ~ 14:23 | 18.0 | 1022.2 | 0.038 | 2557 | 20.9 |
| 2hr14min | 09:11 ~ 11:25 | 18.1 | 1022.2 | 0.029 | 2891 | 21.6 |
| 2hr14min | 11:33 ~ 13:47 | 18.1 | 1022.2 | 0.047 | 3379 | 25.3 |

Linear Regression of Y or X

Slope (K-factor): 0.0017
 Correlation Coefficient 0.9678
 Date of Issue 28 December 2018

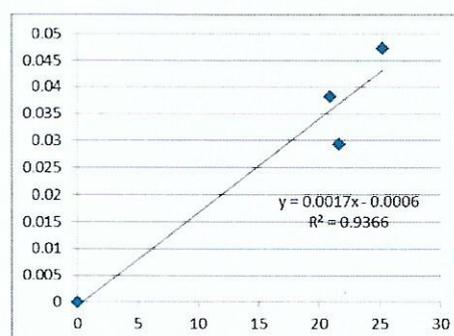

Remarks:

- Strong** Correlation ($R > 0.8$)
 - Factor 0.0017 should be applied for TSP monitoring
- *if $R < 0.5$, repair or re-verification is required for the equipment

Operator : Fai So Signature : *Fai So* Date : 28 December 2018

QC Reviewer : Ben Tam Signature : *Ben Tam* Date : 28 December 2018

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

| | | |
|---------------|---|----------------------------------|
| Location : | Gold King Industrial Building, Kwai Chung | Date of Calibration: 21-Sep-18 |
| Location ID : | Calibration Room | Next Calibration Date: 21-Dec-18 |

CONDITIONS

| | | | |
|--------------------------|--------|----------------------------|-------|
| Sea Level Pressure (hPa) | 1011.6 | Corrected Pressure (mm Hg) | 758.7 |
| Temperature (°C) | 29.2 | Temperature (K) | 302 |

CALIBRATION ORIFICE

| | | | |
|--------------------|-----------|-------------------|-----------|
| Make-> | TISCH | Qstd Slope -> | 2.02017 |
| Model-> | 5025A | Qstd Intercept -> | -0.03691 |
| Calibration Date-> | 13-Feb-18 | Expiry Date-> | 13-Feb-19 |

CALIBRATION

| Plate No. | H2O (L) (in) | H2O (R) (in) | H2O (in) | Qstd (m3/min) | I (chart) | IC corrected | LINEAR REGRESSION |
|-----------|--------------|--------------|----------|---------------|-----------|--------------|---|
| 18 | 5.4 | 5.4 | 10.8 | 1.632 | 56 | 55.56 | Slope = 37.2548 Intercept = -5.5606 Corr. coeff. = 0.9970 |
| 13 | 4.3 | 4.3 | 8.6 | 1.459 | 48 | 47.62 | |
| 10 | 3.3 | 3.3 | 6.6 | 1.280 | 43 | 42.66 | |
| 8 | 2.1 | 2.1 | 4.2 | 1.025 | 34 | 33.73 | |
| 5 | 1.3 | 1.3 | 2.6 | 0.810 | 24 | 23.81 | |

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H20(Pa/Pstd)(Tstd/Ta))-b]$$


$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate
 IC = corrected chart responses
 I = actual chart response
 m = calibrator Qstd slope
 b = calibrator Qstd intercept
 Ta = actual temperature during calibration (deg K)
 Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

$$1/m((I)[\text{Sqrt}(298/Tav)(Pav/760)]-b)$$

m = sampler slope
 b = sampler intercept
 I = chart response
 Tav = daily average temperature
 Pav = daily average pressure

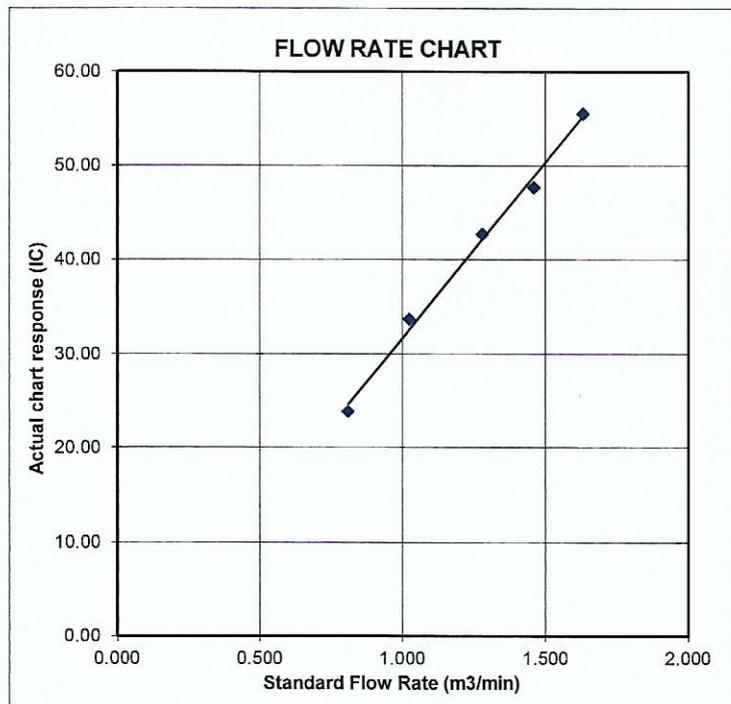

Certificate of Calibration

| Calibration Certification Information | | | |
|---------------------------------------|-----------------------------|-----------|-------|
| Cal. Date: February 13, 2018 | Rootsmeter S/N: 438320 | Ta: 293 | °K |
| Operator: Jim Tisch | | Pa: 763.3 | mm Hg |
| Calibration Model #: TE-5025A | Calibrator S/N: 1612 | | |

| Run | Vol. Init (m3) | Vol. Final (m3) | ΔVol. (m3) | ΔTime (min) | ΔP (mm Hg) | ΔH (in H2O) |
|-----|----------------|-----------------|------------|-------------|------------|-------------|
| 1 | 1 | 2 | 1 | 1.3970 | 3.2 | 2.00 |
| 2 | 3 | 4 | 1 | 1.0000 | 6.3 | 4.00 |
| 3 | 5 | 6 | 1 | 0.8900 | 7.9 | 5.00 |
| 4 | 7 | 8 | 1 | 0.8440 | 8.7 | 5.50 |
| 5 | 9 | 10 | 1 | 0.7010 | 12.6 | 8.00 |

| Data Tabulation | | | | | |
|-----------------|---------------|--|-----------|-------------|------------------------------------|
| Vstd (m3) | Qstd (x-axis) | $\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)}$ (y-axis) | Va | Qa (x-axis) | $\sqrt{\Delta H (Ta/Pa)}$ (y-axis) |
| 1.0172 | 0.7281 | 1.4293 | 0.9958 | 0.7128 | 0.8762 |
| 1.0130 | 1.0130 | 2.0213 | 0.9917 | 0.9917 | 1.2392 |
| 1.0109 | 1.1358 | 2.2599 | 0.9896 | 1.1120 | 1.3854 |
| 1.0098 | 1.1964 | 2.3702 | 0.9886 | 1.1713 | 1.4530 |
| 1.0046 | 1.4331 | 2.8586 | 0.9835 | 1.4030 | 1.7524 |
| QSTD | m= | 2.02017 | QA | m= | 1.26500 |
| | b= | -0.03691 | | b= | -0.02263 |
| | r= | 0.99988 | | r= | 0.99988 |

| Calculations | | | |
|--|---|-----|---|
| Vstd= | $\Delta Vol((Pa-\Delta P)/Pstd)(Tstd/Ta)$ | Va= | $\Delta Vol((Pa-\Delta P)/Pa)$ |
| Qstd= | Vstd/ΔTime | Qa= | Va/ΔTime |
| For subsequent flow rate calculations: | | | |
| Qstd= | $1/m \left(\left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)} \right) - b \right)$ | Qa= | $1/m \left(\left(\sqrt{\Delta H (Ta/Pa)} \right) - b \right)$ |

| Standard Conditions | |
|---|-----------|
| Tstd: | 298.15 °K |
| Pstd: | 760 mm Hg |
| Key | |
| ΔH: calibrator manometer reading (in H2O) | |
| ΔP: rootsmeter manometer reading (mm Hg) | |
| Ta: actual absolute temperature (°K) | |
| Pa: actual barometric pressure (mm Hg) | |
| b: intercept | |
| m: slope | |

| RECALIBRATION |
|--|
| US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30 |

ALS Technichem (HK) Pty Ltd



ALS Laboratory Group

ANALYTICAL CHEMISTRY & TESTING SERVICES

SUB-CONTRACTING REPORT

| | | | |
|---------|--|----------------|--------------------|
| CONTACT | : MR K.W. FAN | WORK ORDER | : HK1864496 |
| CLIENT | : ENVIROTECH SERVICES CO. | | |
| ADDRESS | : RM113, 1/F, MY LOFT, 9 HOI WING ROAD, TUEN MUN, N.T. HONG KONG | SUB-BATCH | : 1 |
| | | DATE RECEIVED | : 11-DEC-2018 |
| | | DATE OF ISSUE | : 28-DEC-2018 |
| PROJECT | : ---- | NO. OF SAMPLES | : 1 |
| | | CLIENT ORDER | : ---- |

General Comments

- Sample(s) were received in ambient condition.
- Sample(s) analysed and reported on as received basis.
- Calibration was subcontracted to and analysed by Action United Enviro Services.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Richard Fung

General Manager

This is the Final Report and supersedes any preliminary report with this batch number.

Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ALS Technichem (HK) Pty Ltd
Part of the **ALS Laboratory Group**

11/F, Chung Shun Knitting Centre 1 - 3 Wing Yip Street Kwai Chung N.T. Hong Kong
Tel. +852 2610 1044 Fax. +852 2610 2021 www.alsglobal.com

WORK ORDER : HK1864496
SUB-BATCH : 1
CLIENT : ENVIROTECH SERVICES CO.
PROJECT : ----



| ALS Lab ID | Client's Sample ID | Sample Type | Sample Date | External Lab Report No. |
|---------------|--------------------|-------------|-------------|-------------------------|
| HK1864496-001 | S/N: 627784 | Equipments | 11-Dec-2018 | S/N: 627784 |

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor
 Manufacturer: Sibata LD-3B
 Serial No. 6Z7784
 Equipment Ref: Nil
 Job Order HK1864496

Standard Equipment:

Standard Equipment: Higher Volume Sampler
 Location & Location ID: AUES office (calibration room)
 Equipment Ref: HVS 018
 Last Calibration Date: 21 September 2018


Equipment Verification Results:

Testing Date: 17&18 December 2018

| Hour | Time | Mean Temp °C | Mean Pressure (hPa) | Concentration in mg/m ³ (Standard Equipment) | Total Count (Calibrated Equipment) | Count/Minute (Total Count/min) |
|----------|---------------|--------------|---------------------|---|------------------------------------|--------------------------------|
| 2hr03min | 12:20 ~ 14:23 | 18.0 | 1022.2 | 0.038 | 2533 | 20.7 |
| 2hr14min | 09:11 ~ 11:25 | 18.1 | 1022.2 | 0.029 | 2601 | 19.4 |
| 2hr14min | 11:33 ~ 13:47 | 18.1 | 1022.2 | 0.047 | 3232 | 24.2 |

Linear Regression of Y or X

Slope (K-factor): 0.0018
 Correlation Coefficient 0.9816
 Date of Issue 28 December 2018

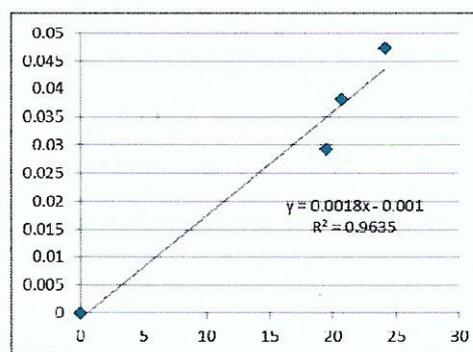

Remarks:

- Strong** Correlation ($R > 0.8$)
 - Factor 0.0018 should be applied for TSP monitoring
- *If $R < 0.5$, repair or re-verification is required for the equipment

Operator: Fai So Signature: *Fai So* Date: 28 December 2018

QC Reviewer: Ben Tam Signature: *Ben Tam* Date: 28 December 2018

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Gold King Industrial Building, Kwai Chung Date of Calibration: 21-Sep-18
 Location ID : Calibration Room Next Calibration Date: 21-Dec-18

CONDITIONS

| | | | |
|--------------------------|--------|----------------------------|-------|
| Sea Level Pressure (hPa) | 1011.6 | Corrected Pressure (mm Hg) | 758.7 |
| Temperature (°C) | 29.2 | Temperature (K) | 302 |

CALIBRATION ORIFICE

| | | | |
|--------------------|-----------|-------------------|-----------|
| Make-> | TISCH | Qstd Slope -> | 2.02017 |
| Model-> | 5025A | Qstd Intercept -> | -0.03691 |
| Calibration Date-> | 13-Feb-18 | Expiry Date-> | 13-Feb-19 |

CALIBRATION

| Plate No. | H2O (L) (in) | H2O (R) (in) | H2O (in) | Qstd (m3/min) | I (chart) | IC corrected | LINEAR REGRESSION Slope = 37.2548 Intercept = -5.5606 Corr. coeff. = 0.9970 |
|-----------|--------------|--------------|----------|---------------|-----------|--------------|--|
| 18 | 5.4 | 5.4 | 10.8 | 1.632 | 56 | 55.56 | |
| 13 | 4.3 | 4.3 | 8.6 | 1.459 | 48 | 47.62 | |
| 10 | 3.3 | 3.3 | 6.6 | 1.280 | 43 | 42.66 | |
| 8 | 2.1 | 2.1 | 4.2 | 1.025 | 34 | 33.73 | |
| 5 | 1.3 | 1.3 | 2.6 | 0.810 | 24 | 23.81 | |

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$


$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate
 IC = corrected chart responses
 I = actual chart response
 m = calibrator Qstd slope
 b = calibrator Qstd intercept
 Ta = actual temperature during calibration (deg K)
 Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

$$1/m((I)[\text{Sqrt}(298/Tav)(Pav/760)]-b)$$

m = sampler slope
 b = sampler intercept
 I = chart response
 Tav = daily average temperature
 Pav = daily average pressure

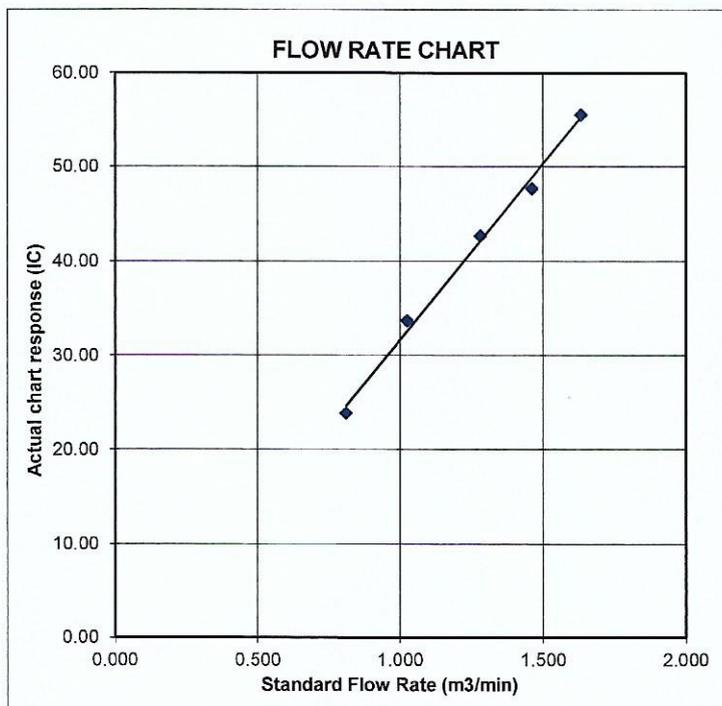

Certificate of Calibration

| Calibration Certification Information | | | |
|---------------------------------------|-----------------------------|-----------|-------|
| Cal. Date: February 13, 2018 | Rootsmeter S/N: 438320 | Ta: 293 | °K |
| Operator: Jim Tisch | | Pa: 763.3 | mm Hg |
| Calibration Model #: TE-5025A | Calibrator S/N: 1612 | | |

| Run | Vol. Init (m3) | Vol. Final (m3) | ΔVol. (m3) | ΔTime (min) | ΔP (mm Hg) | ΔH (in H2O) |
|-----|----------------|-----------------|------------|-------------|------------|-------------|
| 1 | 1 | 2 | 1 | 1.3970 | 3.2 | 2.00 |
| 2 | 3 | 4 | 1 | 1.0000 | 6.3 | 4.00 |
| 3 | 5 | 6 | 1 | 0.8900 | 7.9 | 5.00 |
| 4 | 7 | 8 | 1 | 0.8440 | 8.7 | 5.50 |
| 5 | 9 | 10 | 1 | 0.7010 | 12.6 | 8.00 |

| Data Tabulation | | | | | |
|-----------------|---------------|--|-----------|-------------|------------------------------------|
| Vstd (m3) | Qstd (x-axis) | $\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)}$ (y-axis) | Va | Qa (x-axis) | $\sqrt{\Delta H (Ta/Pa)}$ (y-axis) |
| 1.0172 | 0.7281 | 1.4293 | 0.9958 | 0.7128 | 0.8762 |
| 1.0130 | 1.0130 | 2.0213 | 0.9917 | 0.9917 | 1.2392 |
| 1.0109 | 1.1358 | 2.2599 | 0.9896 | 1.1120 | 1.3854 |
| 1.0098 | 1.1964 | 2.3702 | 0.9886 | 1.1713 | 1.4530 |
| 1.0046 | 1.4331 | 2.8586 | 0.9835 | 1.4030 | 1.7524 |
| QSTD | m= | 2.02017 | QA | m= | 1.26500 |
| | b= | -0.03691 | | b= | -0.02263 |
| | r= | 0.99988 | | r= | 0.99988 |

| Calculations | | | |
|--|---|-----|---|
| Vstd= | $\Delta Vol \left(\frac{Pa - \Delta P}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)$ | Va= | $\Delta Vol \left(\frac{Pa - \Delta P}{Pa} \right)$ |
| Qstd= | Vstd/ΔTime | Qa= | Va/ΔTime |
| For subsequent flow rate calculations: | | | |
| Qstd= | $1/m \left(\left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)} \right) - b \right)$ | Qa= | $1/m \left(\left(\sqrt{\Delta H (Ta/Pa)} \right) - b \right)$ |

| Standard Conditions | |
|---------------------|---------------------------------------|
| Tstd: | 298.15 °K |
| Pstd: | 760 mm Hg |
| Key | |
| ΔH: | calibrator manometer reading (in H2O) |
| ΔP: | rootsmeter manometer reading (mm Hg) |
| Ta: | actual absolute temperature (°K) |
| Pa: | actual barometric pressure (mm Hg) |
| b: | intercept |
| m: | slope |

| RECALIBRATION |
|--|
| US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30 |



Certificate of Calibration

校正證書

Certificate No. : C183087
證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC18-1089)

Date of Receipt / 收件日期 : 25 May 2018

Description / 儀器名稱 : Sound Level Meter

Manufacturer / 製造商 : Rion

Model No. / 型號 : NL-52

Serial No. / 編號 : 00175561

Supplied By / 委託者 : Envirotech Services Co.

Room 113, 1/F, My Loft, 9 Hoi Wing Road, Tuen Mun,
New Territories, Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 : $(23 \pm 2)^{\circ}\text{C}$

Relative Humidity / 相對濕度 : $(50 \pm 25)\%$

Line Voltage / 電壓 : ---

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 10 June 2018

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.


The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).


The test equipment used for calibration are traceable to National Standards via :

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By
測試

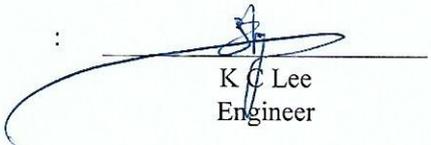
K C Lee
Engineer

Certified By
核證

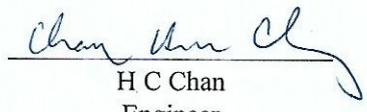
H C Chan
Engineer

Date of Issue
簽發日期

14 June 2018

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Certificate of Calibration

校正證書

Certificate No. : C183087
證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- Self-calibration was performed before the test.
- The results presented are the mean of 3 measurements at each calibration point.

4. Test equipment :

| Equipment ID | Description | Certificate No. |
|--------------|-------------------------------------|-----------------|
| CL280 | 40 MHz Arbitrary Waveform Generator | C180024 |
| CL281 | Multifunction Acoustic Calibrator | PA160023 |

5. Test procedure : MA101N.

6. Results :

6.1 Sound Pressure Level

6.1.1 Reference Sound Pressure Level

| UUT Setting | | | | Applied Value | | UUT Reading (dB) | IEC 61672 Class 1 Spec. (dB) |
|-------------|----------------|---------------------|----------------|---------------|-------------|------------------|------------------------------|
| Range (dB) | Function | Frequency Weighting | Time Weighting | Level (dB) | Freq. (kHz) | | |
| 30 - 130 | L _A | A | Fast | 94.00 | 1 | 94.0 | ± 1.1 |

6.1.2 Linearity

| UUT Setting | | | | Applied Value | | UUT Reading (dB) |
|-------------|----------------|---------------------|----------------|---------------|-------------|------------------|
| Range (dB) | Function | Frequency Weighting | Time Weighting | Level (dB) | Freq. (kHz) | |
| 30 - 130 | L _A | A | Fast | 94.00 | 1 | 94.0 (Ref.) |
| | | | | 104.00 | | 104.0 |
| | | | | 114.00 | | 114.0 |

IEC 61672 Class 1 Spec. : ± 0.6 dB per 10 dB step and ± 1.1 dB for overall different.

6.2 Time Weighting

| UUT Setting | | | | Applied Value | | UUT Reading (dB) | IEC 61672 Class 1 Spec. (dB) |
|-------------|----------------|---------------------|----------------|---------------|-------------|------------------|------------------------------|
| Range (dB) | Function | Frequency Weighting | Time Weighting | Level (dB) | Freq. (kHz) | | |
| 30 - 130 | L _A | A | Fast | 94.00 | 1 | 94.0 | Ref. |
| | | | Slow | | | | ± 0.3 |

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室所書面批准。

Certificate of Calibration

校正證書

Certificate No. : C183087
證書編號

6.3 Frequency Weighting

6.3.1 A-Weighting

| UUT Setting | | | | Applied Value | | UUT Reading (dB) | IEC 61672 Class 1 Spec. (dB) |
|-------------|----------------|---------------------|----------------|---------------|----------|------------------|------------------------------|
| Range (dB) | Function | Frequency Weighting | Time Weighting | Level (dB) | Freq. | | |
| 30 - 130 | L _A | A | Fast | 94.00 | 63 Hz | 67.7 | -26.2 ± 1.5 |
| | | | | | 125 Hz | 77.8 | -16.1 ± 1.5 |
| | | | | | 250 Hz | 85.3 | -8.6 ± 1.4 |
| | | | | | 500 Hz | 90.8 | -3.2 ± 1.4 |
| | | | | | 1 kHz | 94.0 | Ref. |
| | | | | | 2 kHz | 95.2 | +1.2 ± 1.6 |
| | | | | | 4 kHz | 95.0 | +1.0 ± 1.6 |
| | | | | | 8 kHz | 93.0 | -1.1 (+2.1 ; -3.1) |
| | | | | | 12.5 kHz | 89.6 | -4.3 (+3.0 ; -6.0) |

6.3.2 C-Weighting

| UUT Setting | | | | Applied Value | | UUT Reading (dB) | IEC 61672 Class 1 Spec. (dB) |
|-------------|----------------|---------------------|----------------|---------------|----------|------------------|------------------------------|
| Range (dB) | Function | Frequency Weighting | Time Weighting | Level (dB) | Freq. | | |
| 30 - 130 | L _C | C | Fast | 94.00 | 63 Hz | 93.2 | -0.8 ± 1.5 |
| | | | | | 125 Hz | 93.8 | -0.2 ± 1.5 |
| | | | | | 250 Hz | 94.0 | 0.0 ± 1.4 |
| | | | | | 500 Hz | 94.0 | 0.0 ± 1.4 |
| | | | | | 1 kHz | 94.0 | Ref. |
| | | | | | 2 kHz | 93.8 | -0.2 ± 1.6 |
| | | | | | 4 kHz | 93.2 | -0.8 ± 1.6 |
| | | | | | 8 kHz | 91.1 | -3.0 (+2.1 ; -3.1) |
| | | | | | 12.5 kHz | 87.6 | -6.2 (+3.0 ; -6.0) |

Remarks : - UUT Microphone Model No. : UC-59 & S/N : 10990

- Mfr's Spec. : IEC 61672 Class 1

- Uncertainties of Applied Value :

| | | |
|--------|------------------|--------------------------|
| 94 dB | : 63 Hz - 125 Hz | : ± 0.35 dB |
| | 250 Hz - 500 Hz | : ± 0.30 dB |
| | 1 kHz | : ± 0.20 dB |
| | 2 kHz - 4 kHz | : ± 0.35 dB |
| | 8 kHz | : ± 0.45 dB |
| | 12.5 kHz | : ± 0.70 dB |
| 104 dB | : 1 kHz | : ± 0.10 dB (Ref. 94 dB) |
| 114 dB | : 1 kHz | : ± 0.10 dB (Ref. 94 dB) |

- The uncertainties are for a confidence probability of not less than 95 %.

Note :

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。



輝創工程有限公司

Sun Creation Engineering Limited

Calibration & Testing Laboratory

Certificate of Calibration

校正證書

Certificate No. : C185607

證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.
- Test equipment :

| Equipment ID | Description | Certificate No. |
|--------------|-----------------------------------|-----------------|
| CL130 | Universal Counter | C183775 |
| CL281 | Multifunction Acoustic Calibrator | CDK1806821 |
| TST150A | Measuring Amplifier | C181288 |

- Test procedure : MA100N.

- Results :

5.1 Sound Level Accuracy

| UUT Nominal Value | Measured Value (dB) | Mfr's Spec. (dB) | Uncertainty of Measured Value (dB) |
|----------------------|------------------------|---------------------|---------------------------------------|
| 94 dB, 1 kHz | 94.0 | ± 0.2 | ± 0.2 |
| 114 dB, 1 kHz | 113.9 | | |

5.2 Frequency Accuracy

| UUT Nominal Value (kHz) | Measured Value (kHz) | Mfr's Spec. | Uncertainty of Measured Value (Hz) |
|----------------------------|-------------------------|----------------|---------------------------------------|
| 1 | 1.000 | 1 kHz ± 1 % | ± 1 |

Remark : The uncertainties are for a confidence probability of not less than 95 %.

Note :

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

Sun Creation Engineering Limited - Calibration & Testing Laboratory

c/o 4/F, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 - 校正及檢測實驗室

c/o 香港新界屯門興安里一號四樓

Tel/電話: (852) 2927 2606

Fax/傳真: (852) 2744 8986

E-mail/電郵: callab@suncreation.com

Website/網址: www.suncreation.com


Page 2 of 2

G. Graphical Plots of the Monitoring Results

Air Quality Monitoring Result at Station AM1 (1-hour TSP)

| Date | Weather Condition | Time | Conc. ($\mu\text{g}/\text{m}^3$) | | | Action Level ($\mu\text{g}/\text{m}^3$) | Limit Level ($\mu\text{g}/\text{m}^3$) |
|-----------|-------------------|--------------|------------------------------------|----------------------|----------------------|---|--|
| | | | 1 st Hour | 2 nd Hour | 3 rd Hour | | |
| 03-May-19 | Cloudy | 8:02 - 11:02 | 72 | 80 | 89 | 273.7 | 500 |
| 09-May-19 | Cloudy | 8:07 - 11:07 | 56 | 54 | 62 | 273.7 | 500 |
| 15-May-19 | Fine | 8:00 - 11:00 | 45 | 46 | 49 | 273.7 | 500 |
| 21-May-19 | Cloudy | 8:04 - 11:04 | 72 | 80 | 88 | 273.7 | 500 |
| 27-May-19 | Cloudy | 8:07 - 11:07 | 49 | 51 | 56 | 273.7 | 500 |
| 31-May-19 | Cloudy | 8:08 - 11:08 | 41 | 47 | 50 | 273.7 | 500 |


Graphical Presentation of Air Quality Monitoring Result at Station AM1 (1-hour TSP)

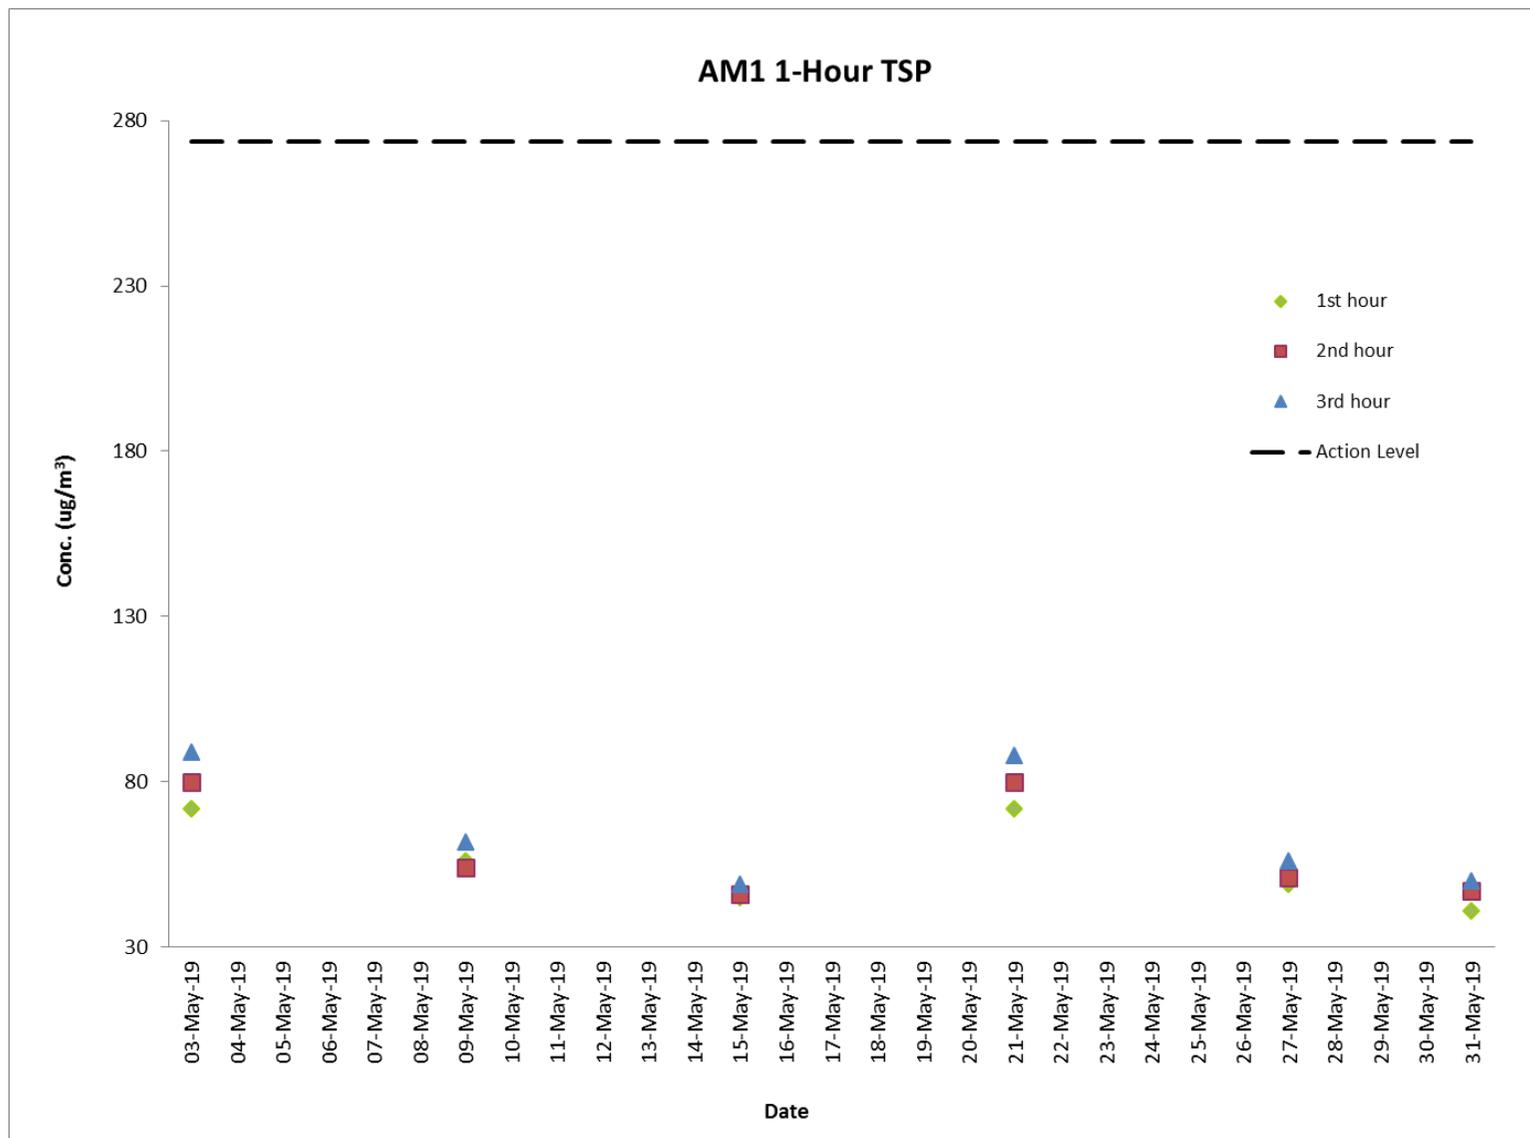

Air Quality Monitoring Result at Station AM2B (1-hour TSP)

| Date | Weather Condition | Time | Conc. ($\mu\text{g}/\text{m}^3$) | | | Action Level ($\mu\text{g}/\text{m}^3$) | Limit Level ($\mu\text{g}/\text{m}^3$) |
|-----------|-------------------|--------------|------------------------------------|----------------------|----------------------|---|--|
| | | | 1 st Hour | 2 nd Hour | 3 rd Hour | | |
| 03-May-19 | Cloudy | 8:17 - 11:17 | 75 | 83 | 91 | 274.2 | 500 |
| 09-May-19 | Cloudy | 8:22 - 11:22 | 61 | 59 | 55 | 274.2 | 500 |
| 15-May-19 | Fine | 8:16 - 11:16 | 71 | 65 | 69 | 274.2 | 500 |
| 21-May-19 | Cloudy | 8:18 - 11:18 | 75 | 83 | 92 | 274.2 | 500 |
| 27-May-19 | Cloudy | 8:22 - 11:22 | 51 | 60 | 62 | 274.2 | 500 |
| 31-May-19 | Cloudy | 8:25 - 11:25 | 59 | 64 | 60 | 274.2 | 500 |


Graphical Presentation of Air Quality Monitoring Result at Station AM2B (1-hour TSP)

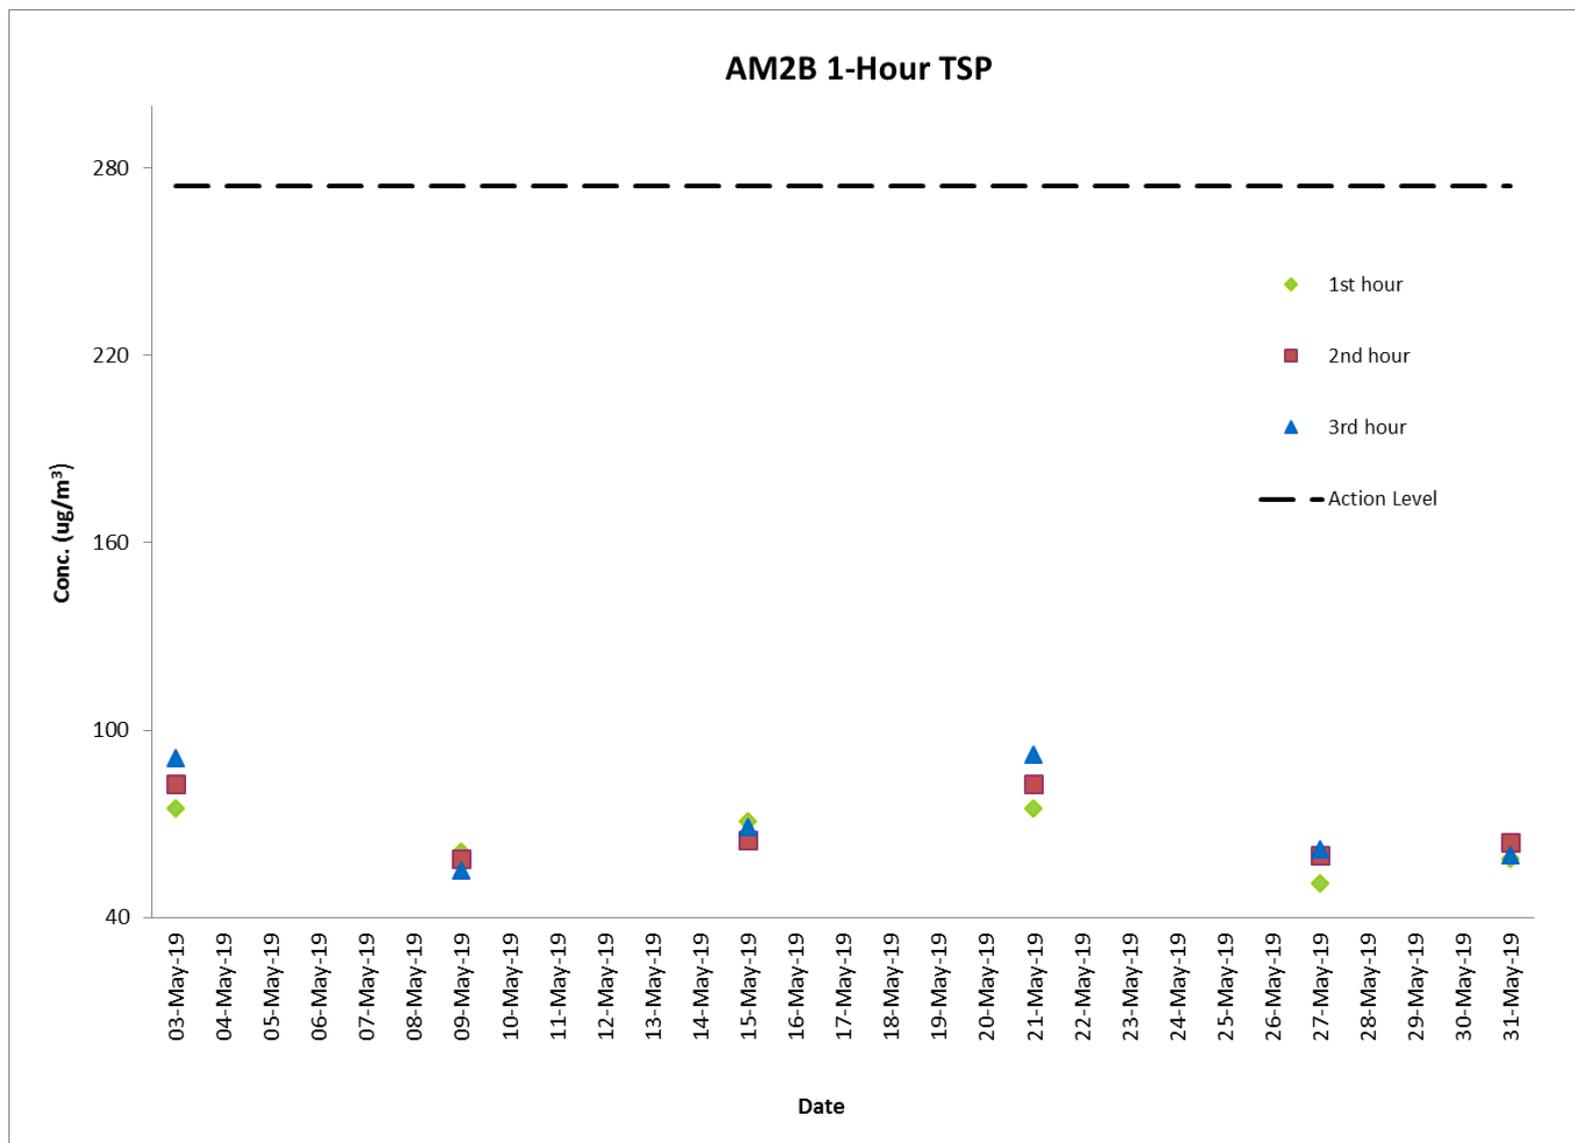

Air Quality Monitoring Result at Station AM1 (24-hour TSP)

| Start | | Finish | | Filter Weight (g) | | Elapsed Time Reading | | Sampling Time (hrs) | Flow Rate (m ³ /min) | | | Conc. (µg/m ³) | Weather Condition | Action Level | Limit Level |
|-----------|------|-----------|------|-------------------|--------|----------------------|----------|---------------------|---------------------------------|-------|---------|----------------------------|-------------------|--------------|-------------|
| Date | Time | Date | Time | Initial | Final | Initial | Final | | Initial | Final | Average | | | | |
| 03-May-19 | 8:00 | 04-May-19 | 8:00 | 2.6797 | 2.7474 | 24168.38 | 24192.38 | 24 | 1.21 | 1.21 | 1.21 | 39 | Cloudy | 143.6 | 260 |
| 09-May-19 | 8:05 | 10-May-19 | 8:05 | 2.7163 | 2.7870 | 24192.38 | 24216.38 | 24 | 1.21 | 1.21 | 1.21 | 41 | Cloudy | 143.6 | 260 |
| 15-May-19 | 7:58 | 16-May-19 | 7:58 | 2.6885 | 2.7935 | 24216.38 | 24240.38 | 24 | 1.21 | 1.21 | 1.21 | 60 | Fine | 143.6 | 260 |
| 21-May-19 | 8:02 | 22-May-19 | 8:02 | 2.7013 | 2.761 | 24240.38 | 24264.38 | 24 | 1.21 | 1.21 | 1.21 | 34 | Cloudy | 143.6 | 260 |
| 27-May-19 | 8:05 | 28-May-19 | 8:05 | 2.7099 | 2.7862 | 24264.38 | 24288.38 | 24 | 1.21 | 1.21 | 1.21 | 44 | Cloudy | 143.6 | 260 |
| 31-May-19 | 8:10 | 01-Jun-19 | 8:10 | 2.6861 | 2.7985 | 24288.38 | 24312.38 | 24 | 1.21 | 1.21 | 1.21 | 65 | Rainy | 143.6 | 260 |


Graphical Presentation of Air Quality Monitoring Result at Station AM1 (24-hour TSP)

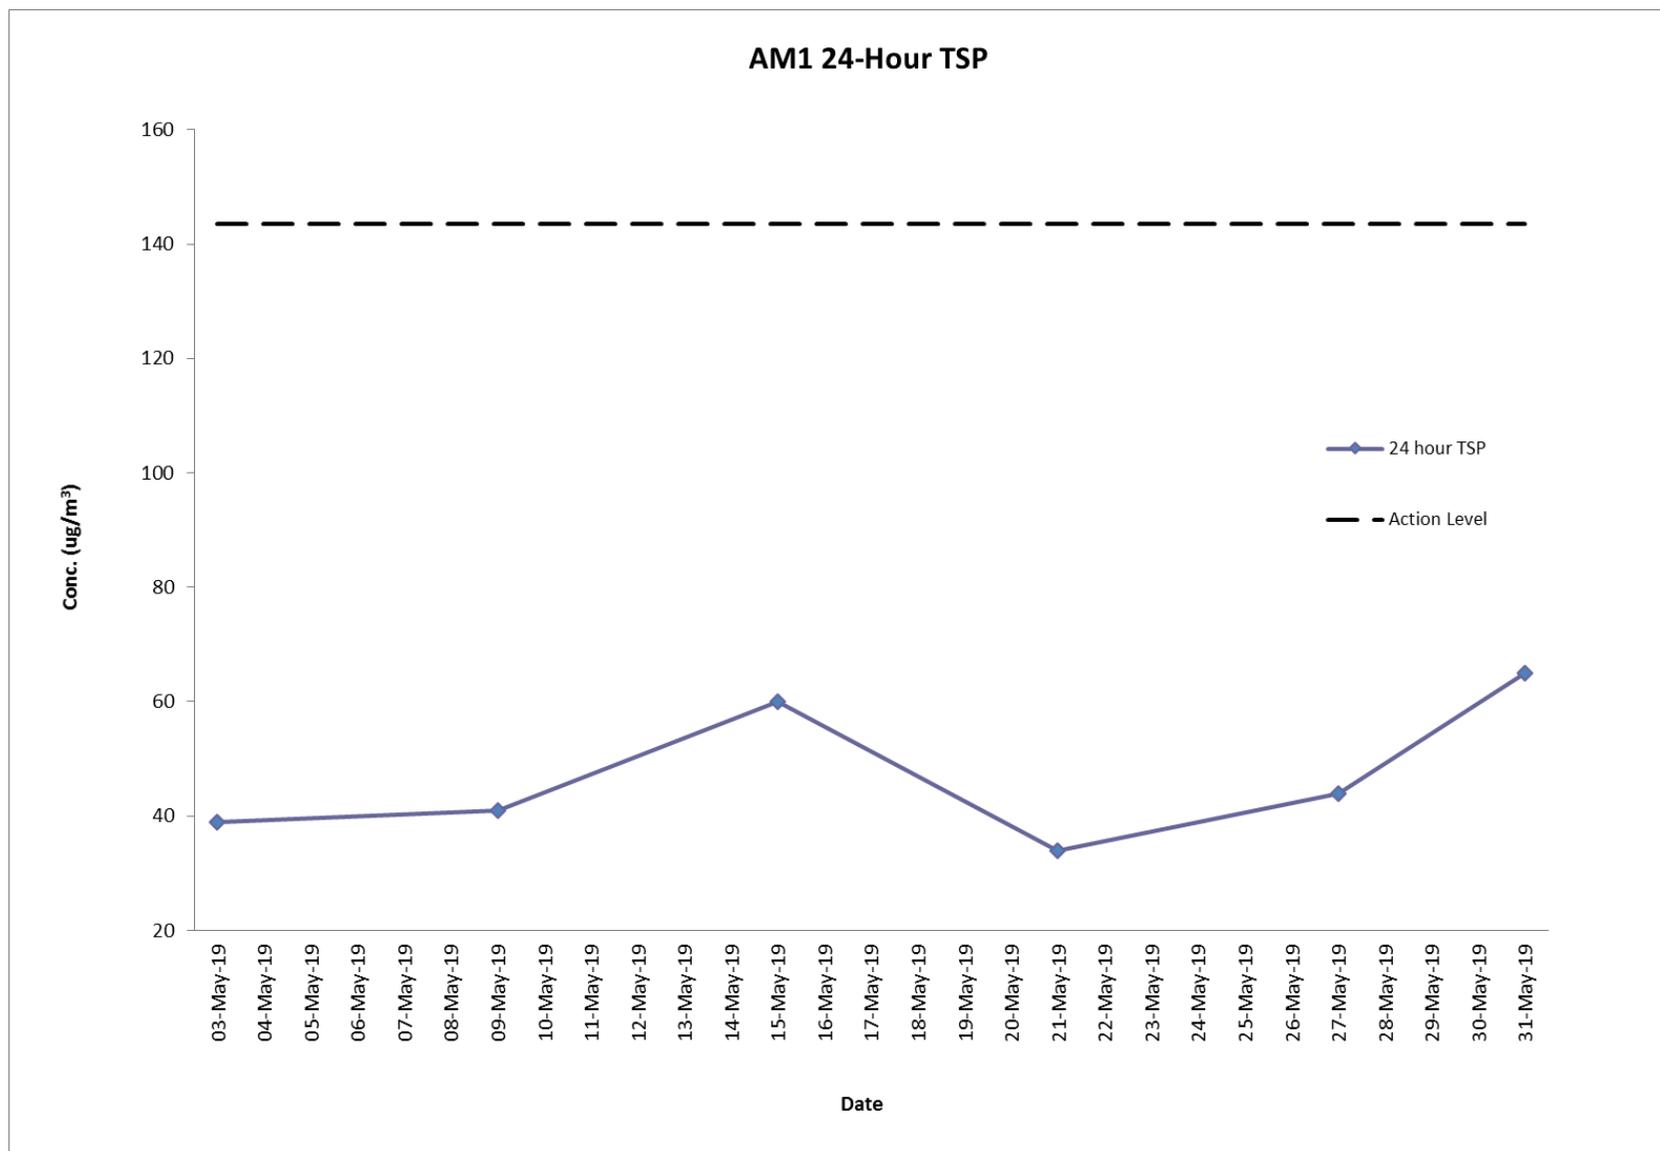

Air Quality Monitoring Result at Station AM2B (24-hour TSP)

| Start | | Finish | | Filter Weight (g) | | Elapsed Time Reading | | Sampling Time (hrs) | Flow Rate (m ³ /min) | | | Conc. (µg/m ³) | Weather Condition | Action Level | Limit Level |
|-----------|-------|-----------|-------|-------------------|--------|----------------------|----------|---------------------|---------------------------------|-------|---------|----------------------------|-------------------|--------------|-------------|
| Date | Time | Date | Time | Initial | Final | Initial | Final | | Initial | Final | Average | | | | |
| 03-May-19 | 08:15 | 04-May-19 | 08:15 | 2.6703 | 2.8293 | 19823.05 | 19847.05 | 24 | 1.22 | 1.22 | 1.22 | 91 | Cloudy | 151.1 | 260 |
| 09-May-19 | 08:20 | 10-May-19 | 08:20 | 2.7025 | 2.7918 | 19847.05 | 19871.05 | 24 | 1.22 | 1.22 | 1.22 | 51 | Cloudy | 151.1 | 260 |
| 15-May-19 | 08:14 | 16-May-19 | 08:14 | 2.7082 | 2.8484 | 19871.05 | 19895.05 | 24 | 1.22 | 1.22 | 1.22 | 80 | Fine | 151.1 | 260 |
| 21-May-19 | 08:16 | 22-May-19 | 08:16 | 2.7092 | 2.7823 | 19895.05 | 19919.05 | 24 | 1.22 | 1.22 | 1.22 | 42 | Cloudy | 151.1 | 260 |
| 27-May-19 | 08:20 | 28-May-19 | 08:20 | 2.7247 | 2.8177 | 19919.05 | 19943.05 | 24 | 1.22 | 1.22 | 1.22 | 53 | Cloudy | 151.1 | 260 |
| 31-May-19 | 08:23 | 01-Jun-19 | 08:23 | 2.6772 | 2.8113 | 19943.05 | 19967.05 | 24 | 1.22 | 1.22 | 1.22 | 76 | Rainy | 151.1 | 260 |

Graphical Presentation of Air Quality Monitoring Result at Station AM2B (24-hour TSP)

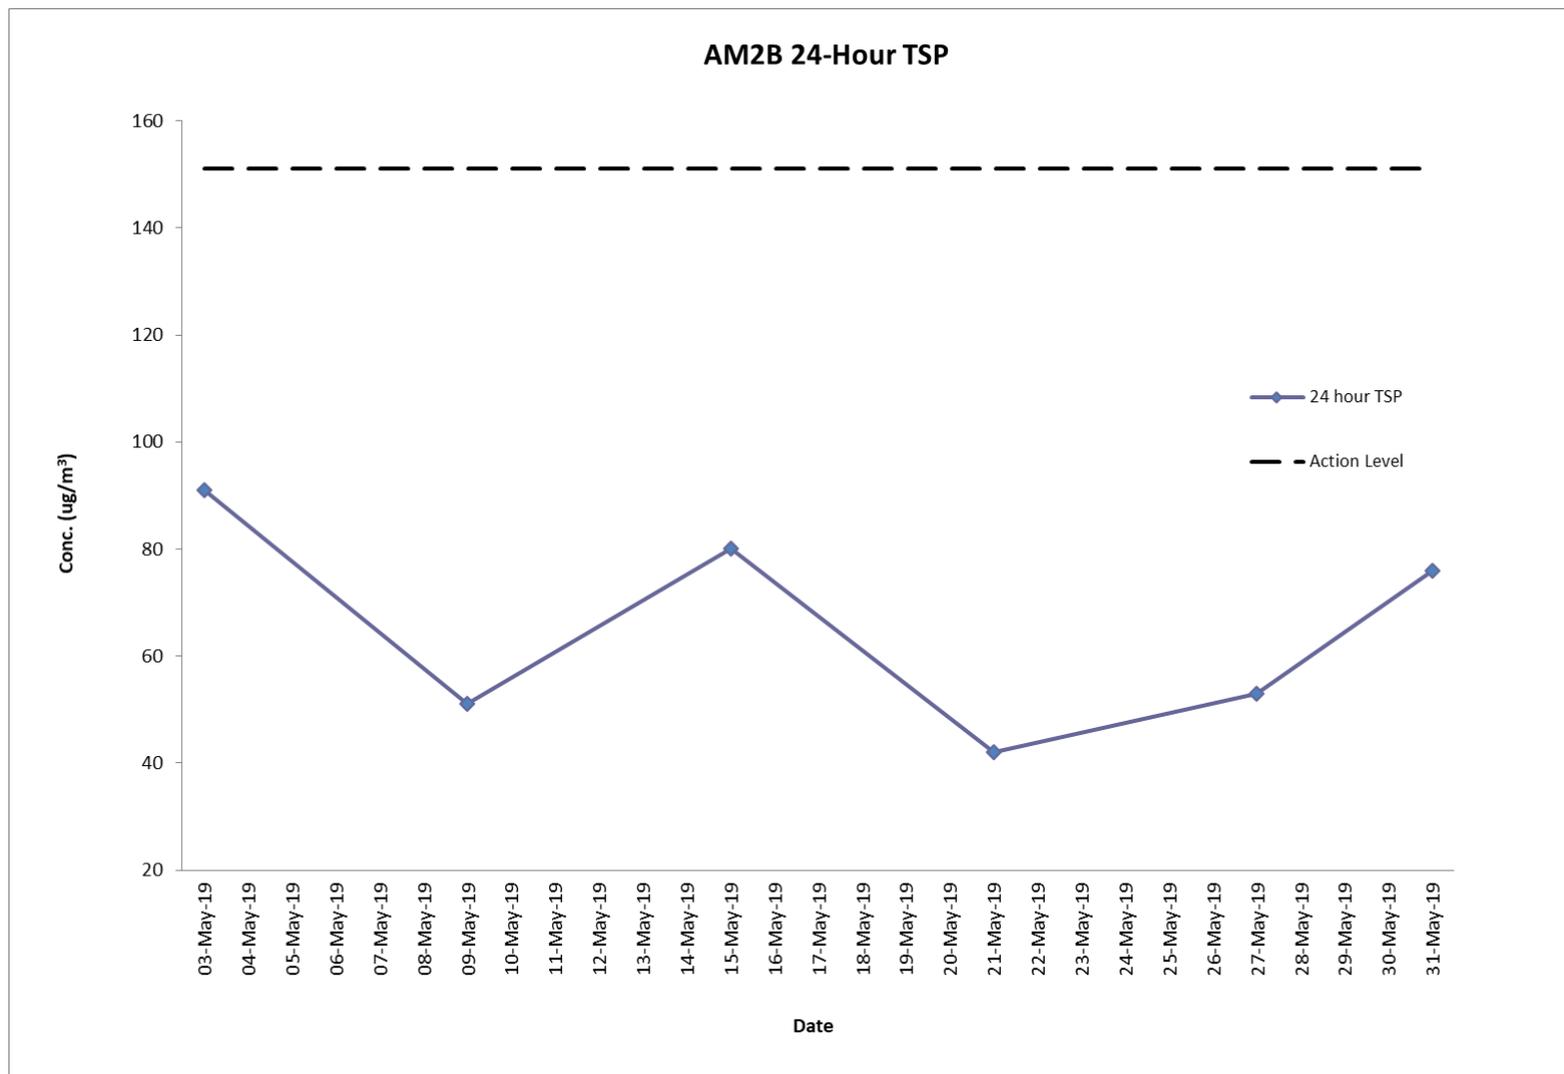

Noise Monitoring Result at Station NM1A

| Date | Time | Measured L ₁₀ , dB(A) | Measured L ₉₀ , dB(A) | L _{eq} (30 min.)*, dB(A) |
|-----------|-------|----------------------------------|----------------------------------|-----------------------------------|
| 09-May-19 | 10:31 | 66.5 | 62.3 | 69 |
| 09-May-19 | 10:36 | 68.6 | 64.1 | |
| 09-May-19 | 10:41 | 67.4 | 63.2 | |
| 09-May-19 | 10:46 | 66.3 | 62.7 | |
| 09-May-19 | 10:51 | 67.1 | 63.4 | |
| 09-May-19 | 10:56 | 68.7 | 64.1 | |
| 15-May-19 | 10:21 | 68.4 | 64.1 | 69 |
| 15-May-19 | 10:26 | 67.3 | 63.0 | |
| 15-May-19 | 10:31 | 66.5 | 62.7 | |
| 15-May-19 | 10:36 | 68.8 | 64.9 | |
| 15-May-19 | 10:41 | 67.6 | 63.1 | |
| 15-May-19 | 10:46 | 67.7 | 63.4 | |
| 21-May-19 | 10:23 | 67.9 | 63.1 | 69 |
| 21-May-19 | 10:28 | 68.4 | 64.0 | |
| 21-May-19 | 10:33 | 69.3 | 65.7 | |
| 21-May-19 | 10:38 | 68.6 | 64.8 | |
| 21-May-19 | 10:43 | 67.5 | 63.1 | |
| 21-May-19 | 10:48 | 67.6 | 63.4 | |
| 27-May-19 | 10:28 | 66.4 | 62.1 | 69 |
| 27-May-19 | 10:33 | 68.3 | 64.0 | |
| 27-May-19 | 10:38 | 67.6 | 63.4 | |
| 27-May-19 | 10:43 | 66.3 | 62.1 | |
| 27-May-19 | 10:48 | 67.0 | 63.7 | |
| 27-May-19 | 10:53 | 68.7 | 64.2 | |


Remarks:

* +3dB (A) correction was applied to free-field measurement.



The station set-up of a free-field measurement at Station NM1A


Graphical Presentation Noise Monitoring Result at Station NM1A

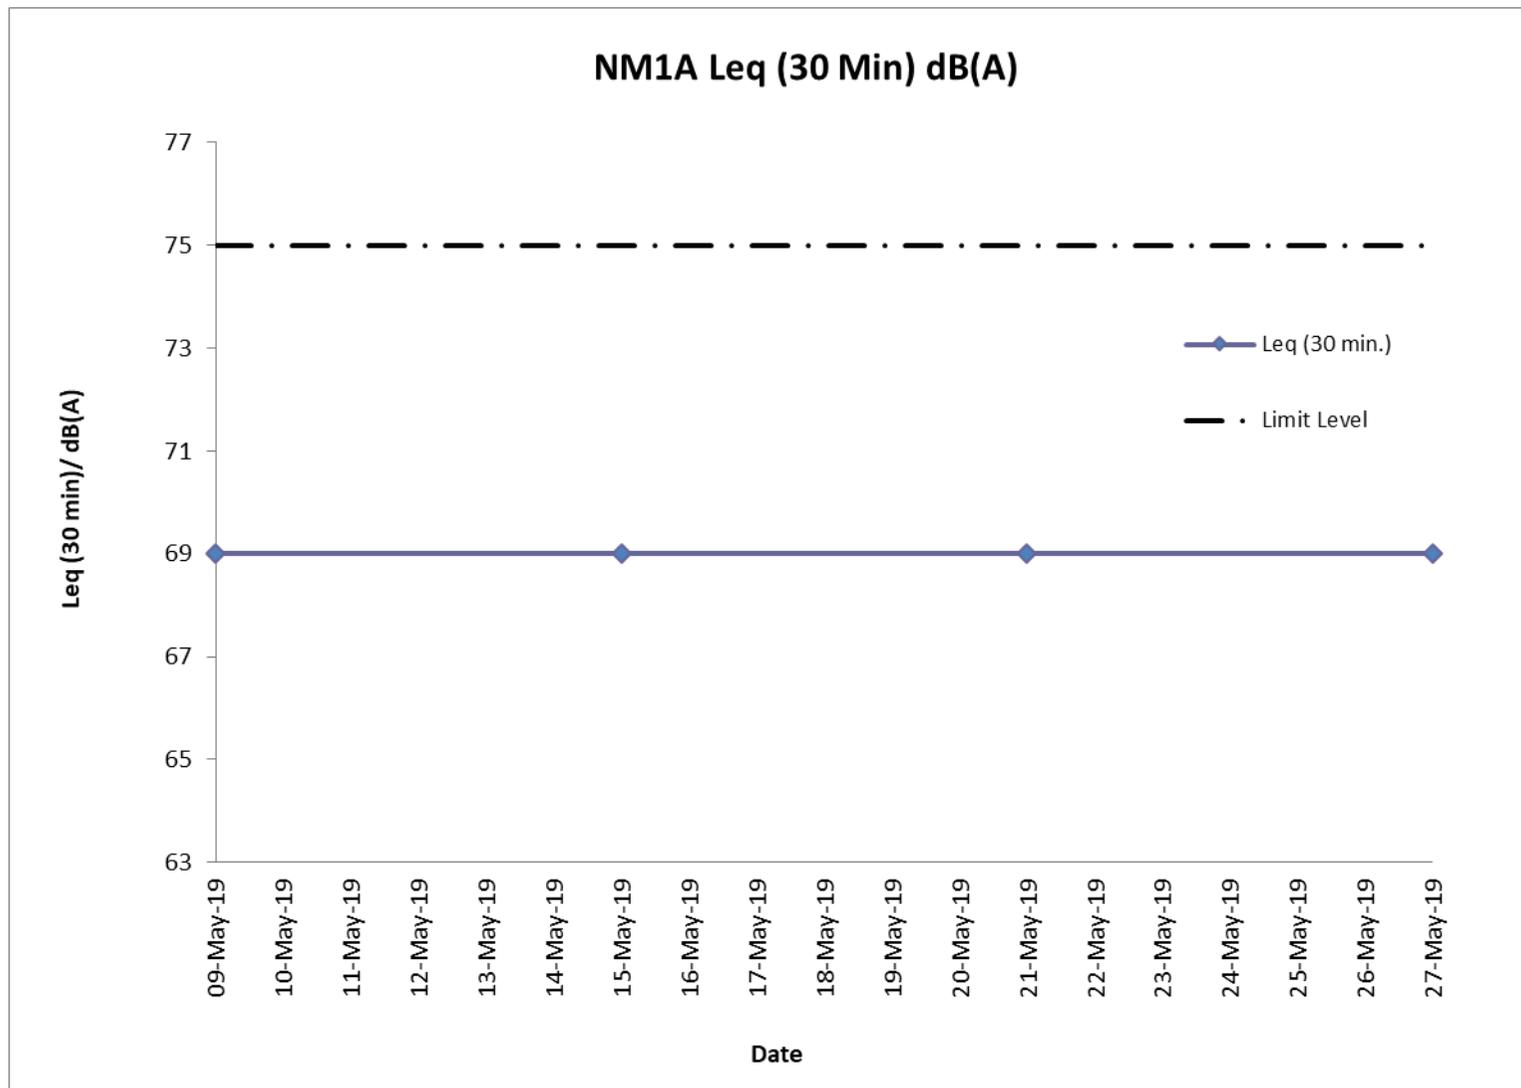

H. Meteorological Data Extracted from Hong Kong Observatory


Extract of Meteorological Observations for King's Park Automatic Weather Station, May 2019

Temperature/Humidity:

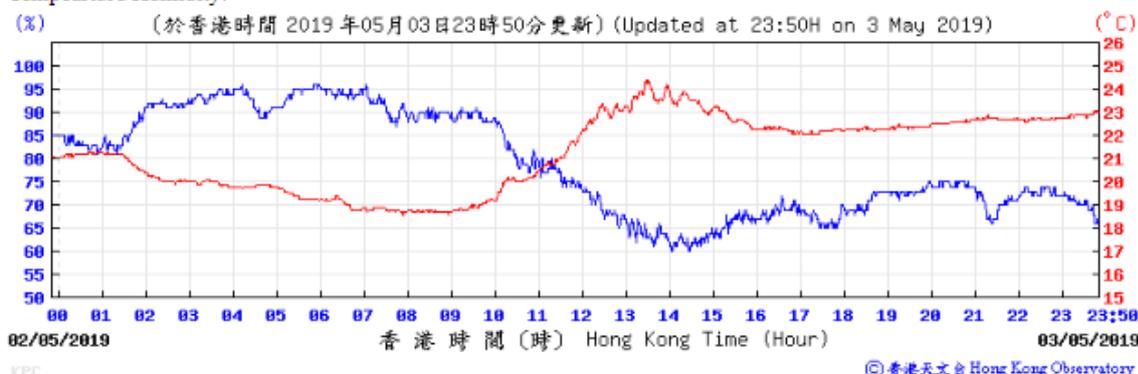


KPC

Pressure:

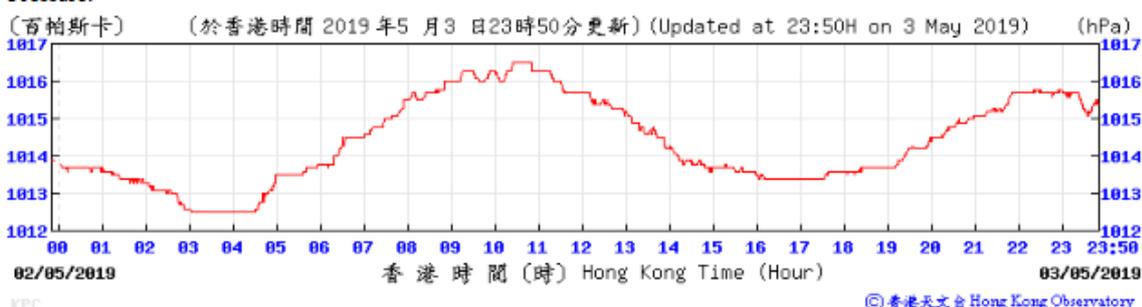


KPC

Wind Direction:

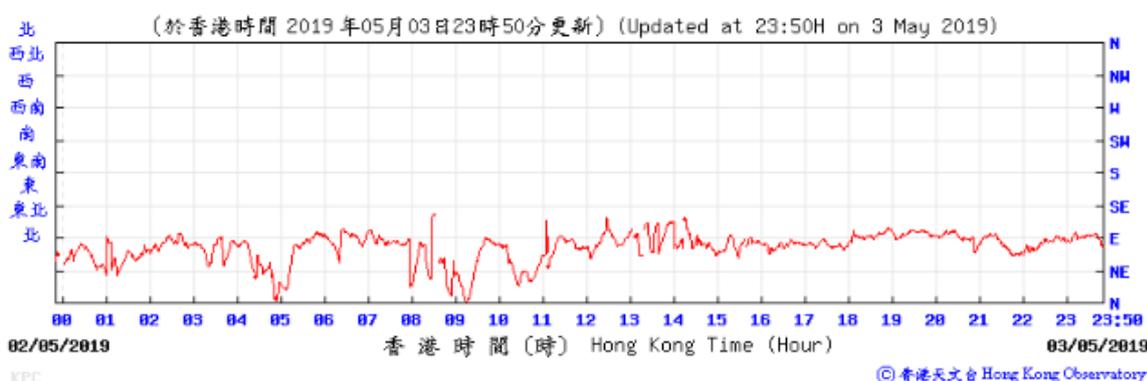


KPC

Wind Speed:

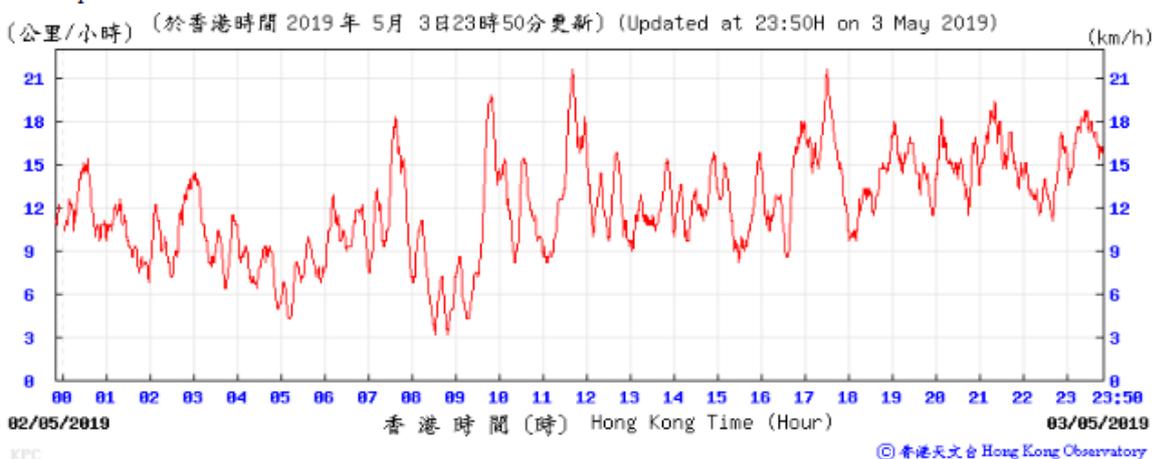


KPC


Temperature/Humidity:

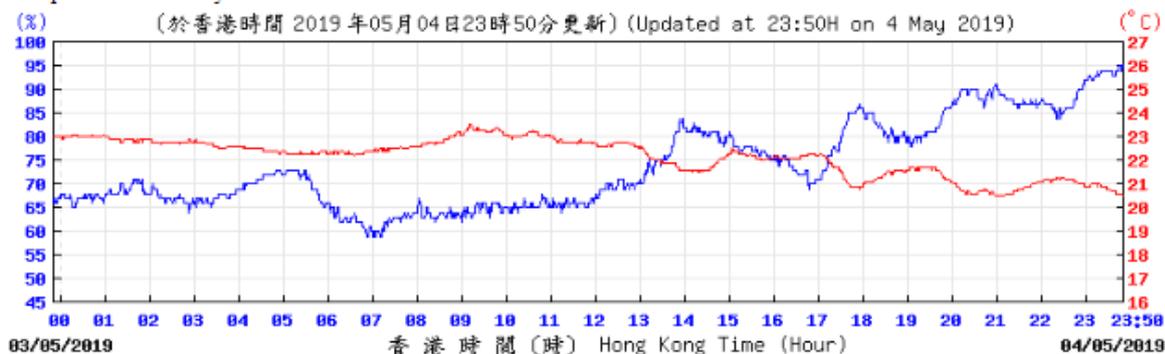


Pressure:

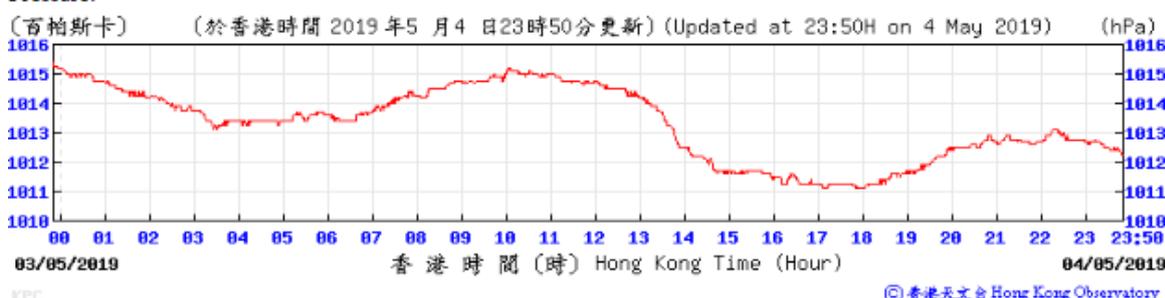


Wind Direction:

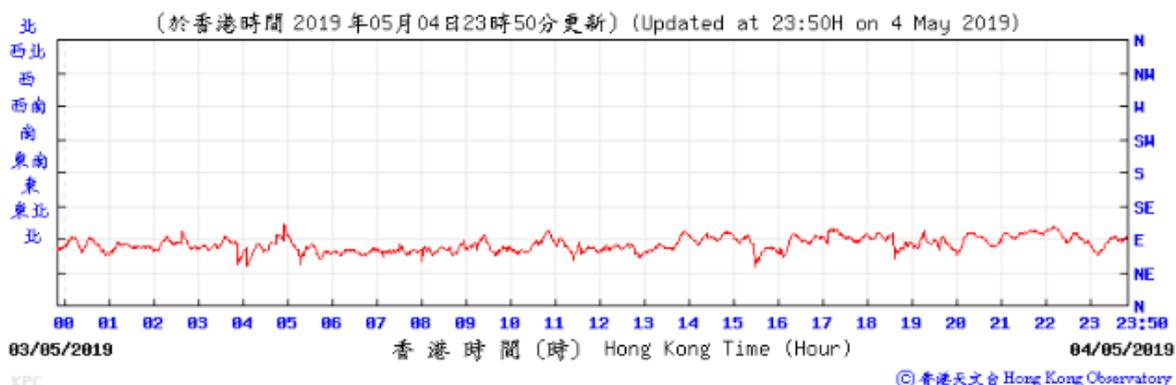

Wind Speed:

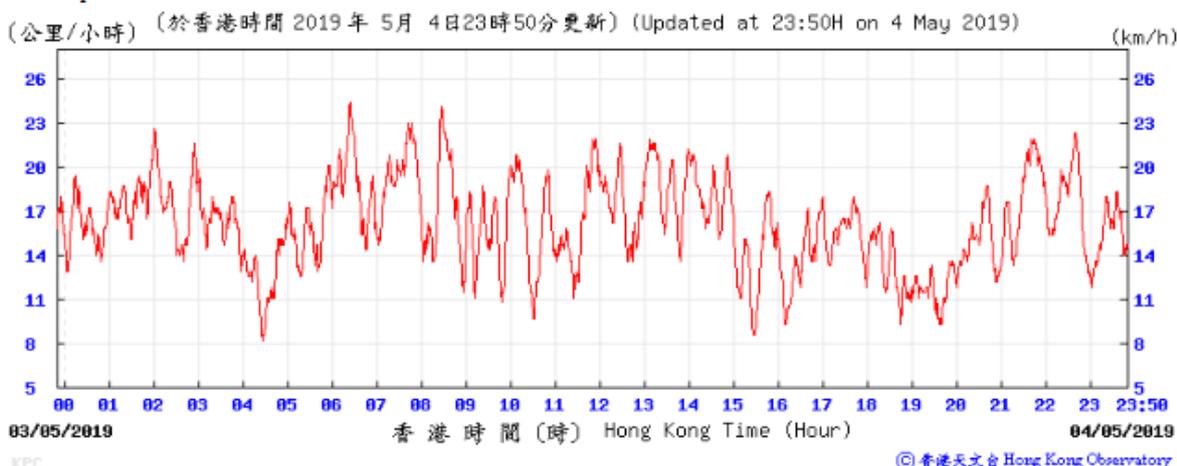


Temperature/Humidity:

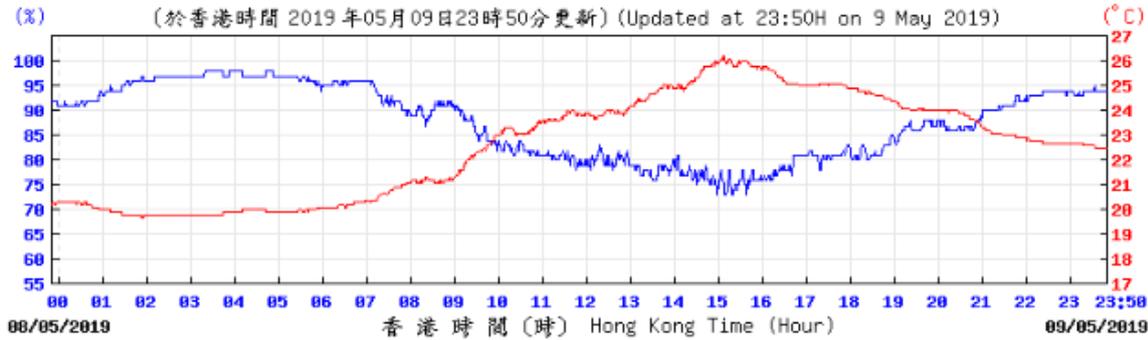


KPC © 香港天文台 Hong Kong Observatory

Pressure:

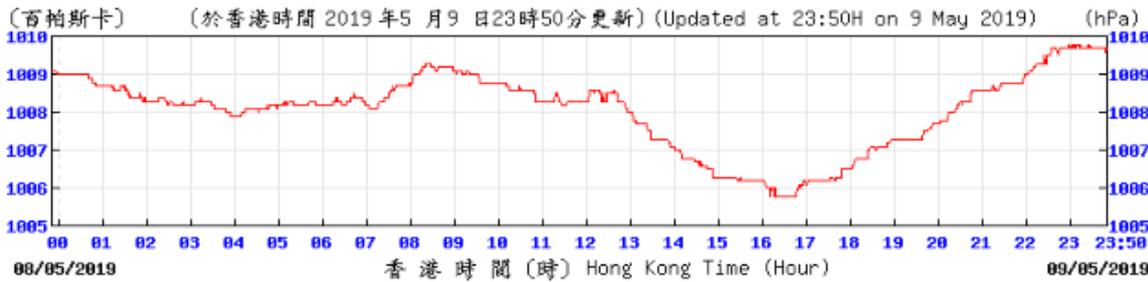


KPC © 香港天文台 Hong Kong Observatory

Wind Direction:

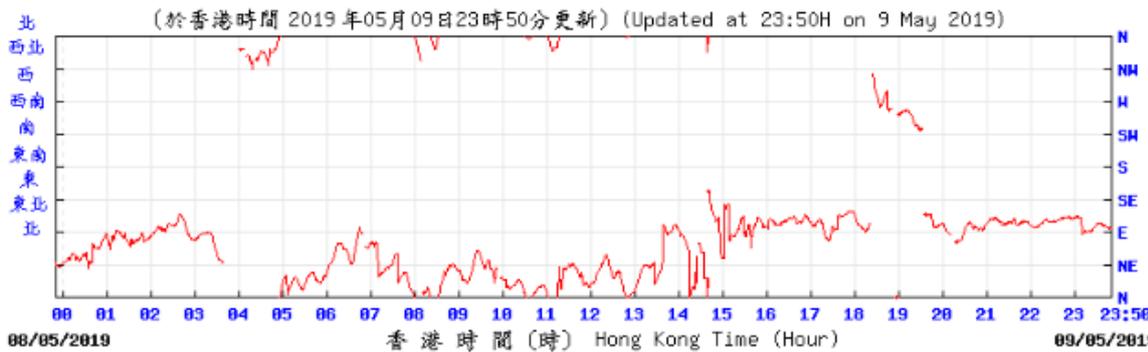


KPC © 香港天文台 Hong Kong Observatory

Wind Speed:

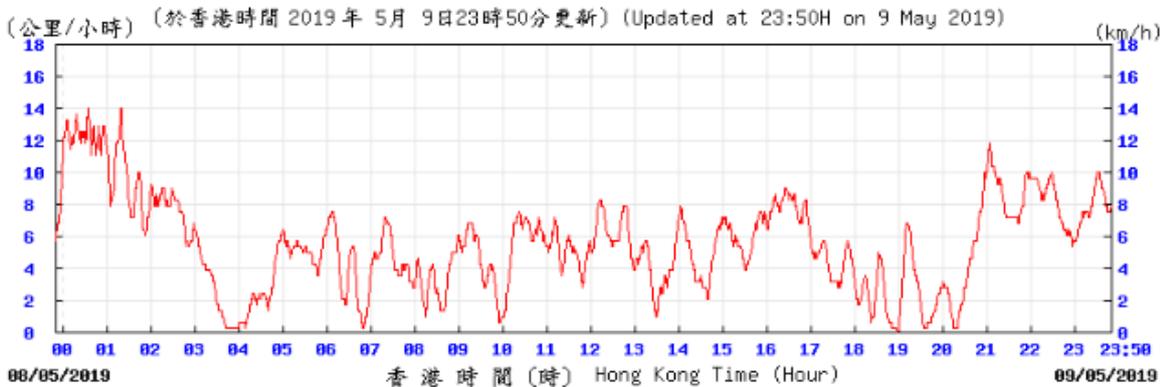


KPC © 香港天文台 Hong Kong Observatory


Temperature/Humidity:

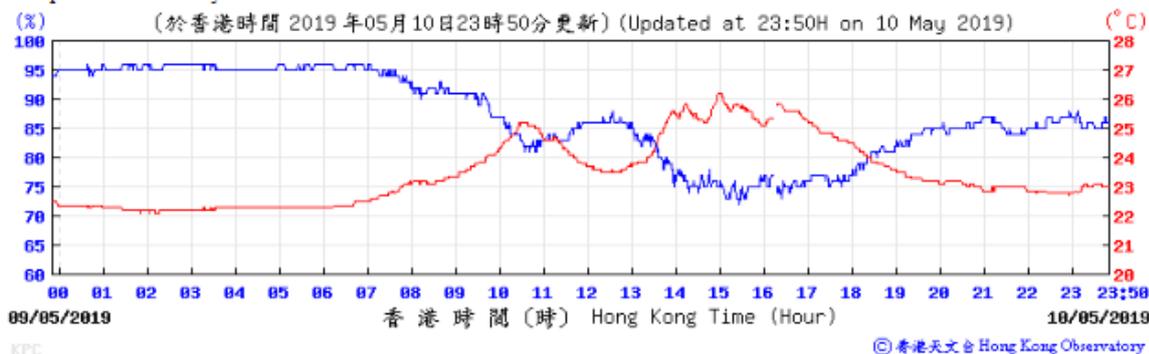


Pressure:

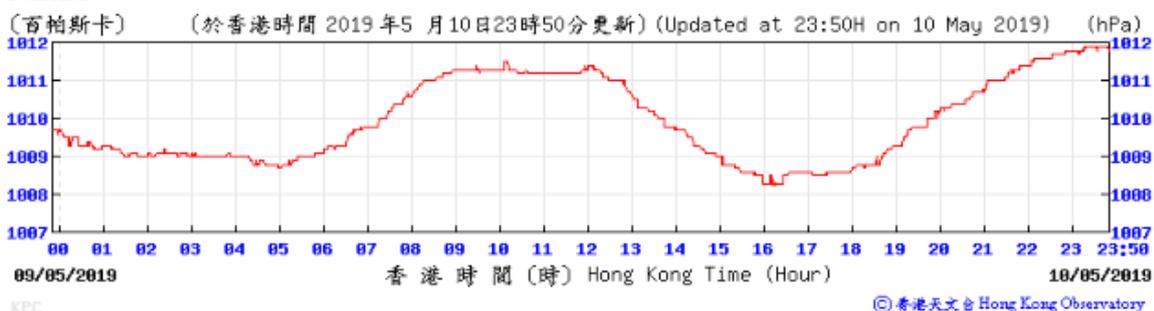


Wind Direction:

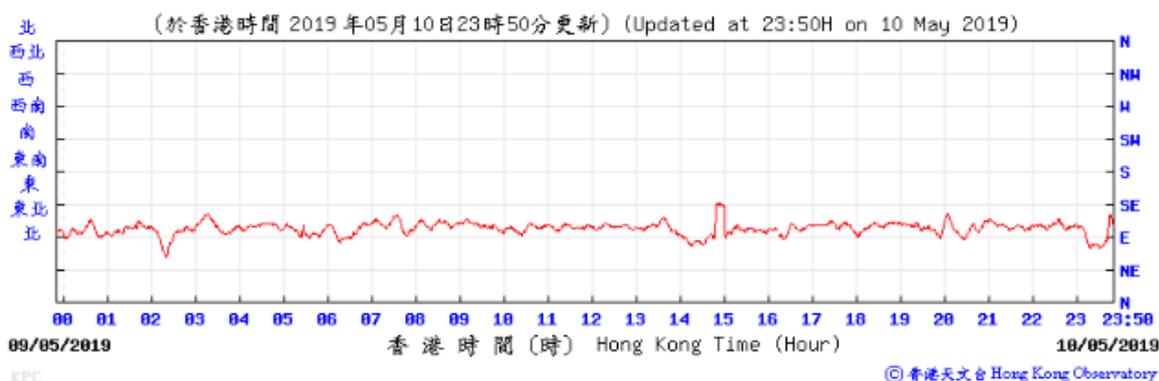

Wind Speed:

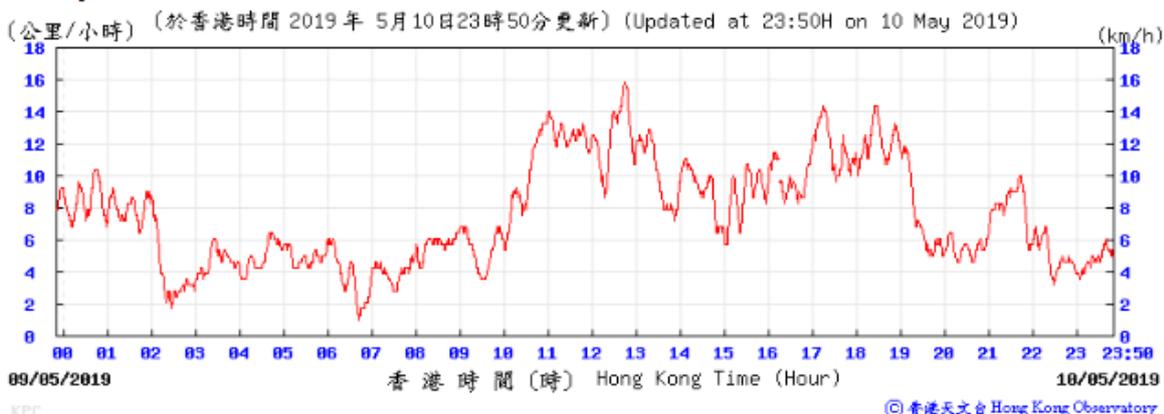


Temperature/Humidity:

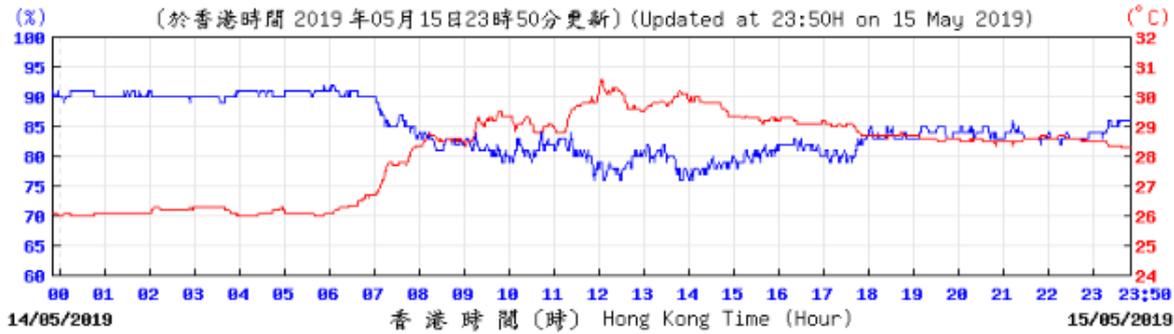


© 香港天文台 Hong Kong Observatory

Pressure:

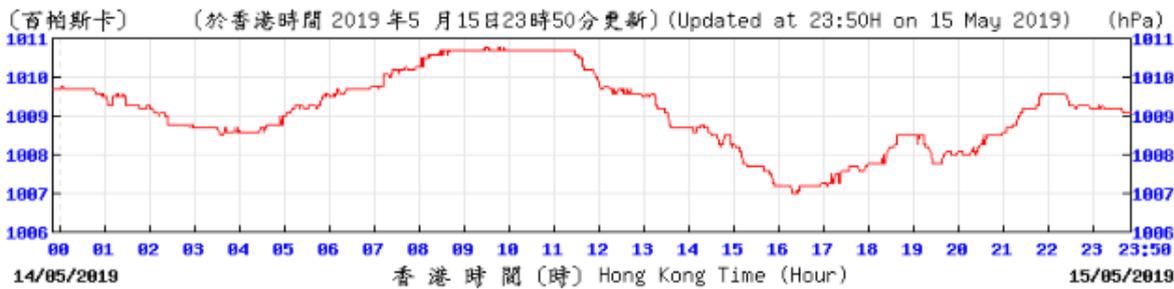


© 香港天文台 Hong Kong Observatory

Wind Direction:

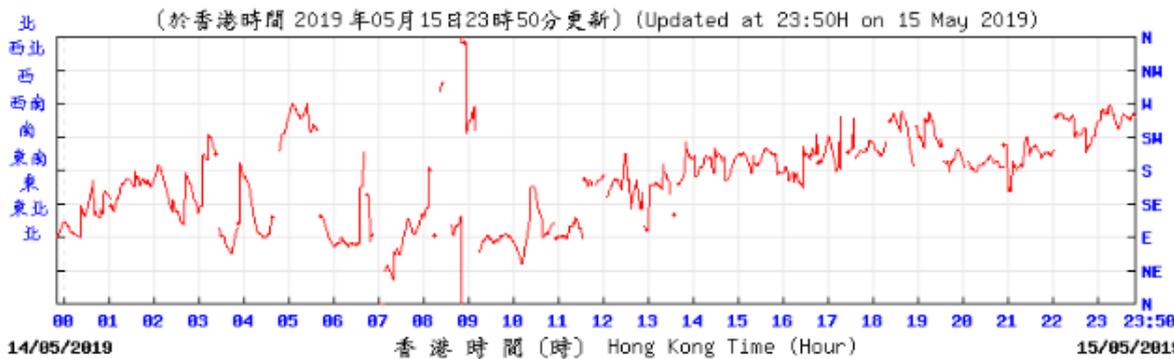


© 香港天文台 Hong Kong Observatory

Wind Speed:

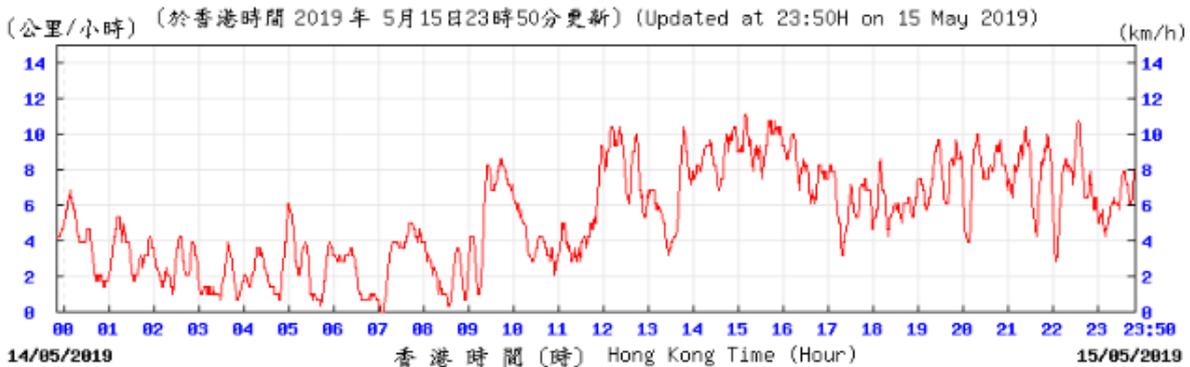


© 香港天文台 Hong Kong Observatory

Temperature/Humidity:

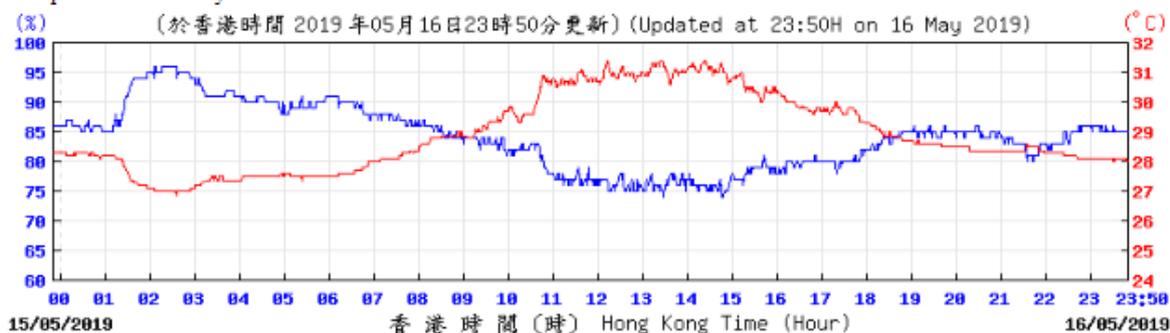


© 香港天文台 Hong Kong Observatory

Pressure:

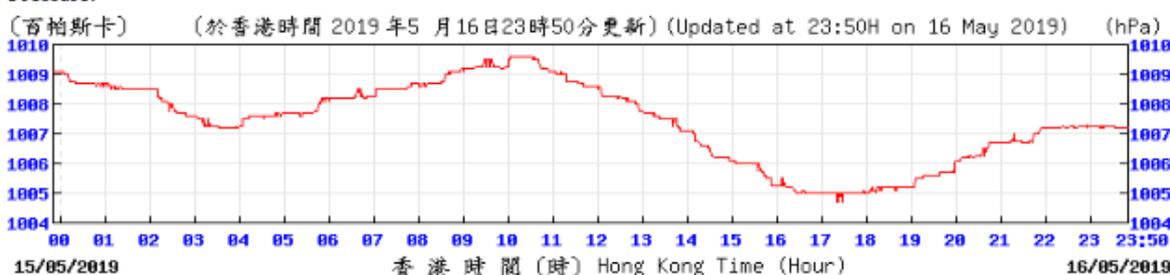


© 香港天文台 Hong Kong Observatory

Wind Direction:

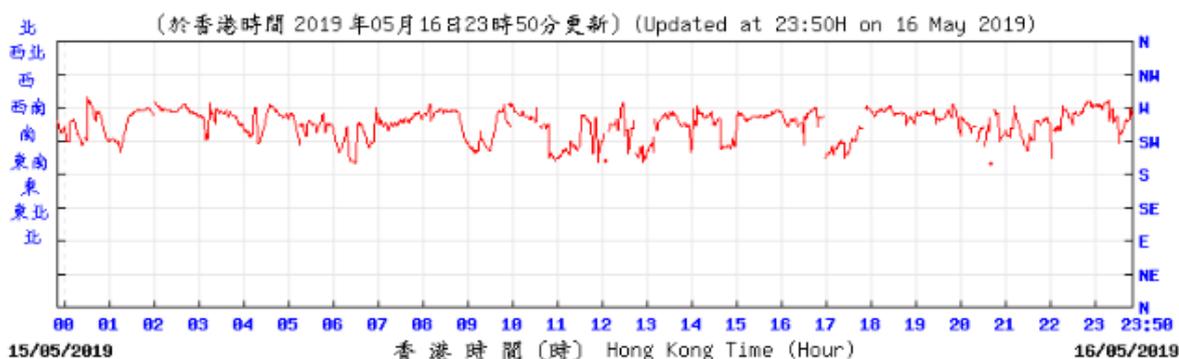

© 香港天文台 Hong Kong Observatory


Wind Speed:

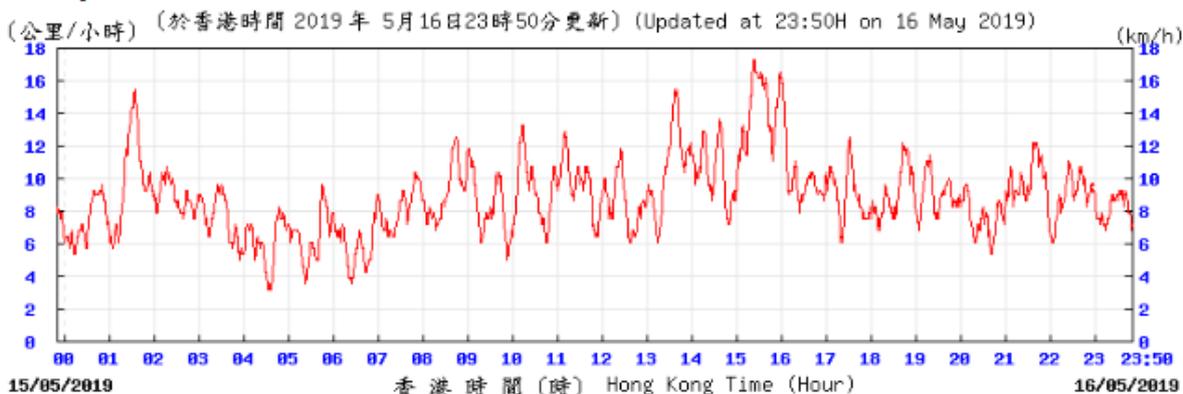

KPC

© 香港天文台 Hong Kong Observatory


Temperature/Humidity:

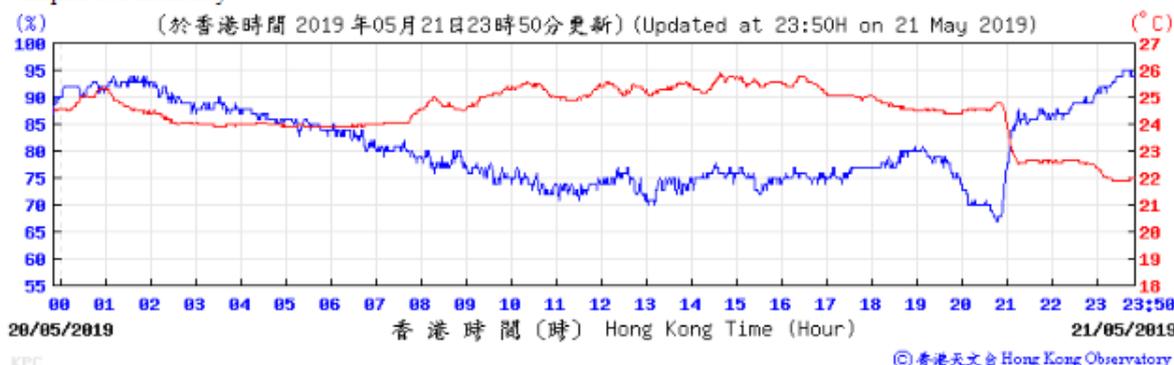


Pressure:




Wind Direction:

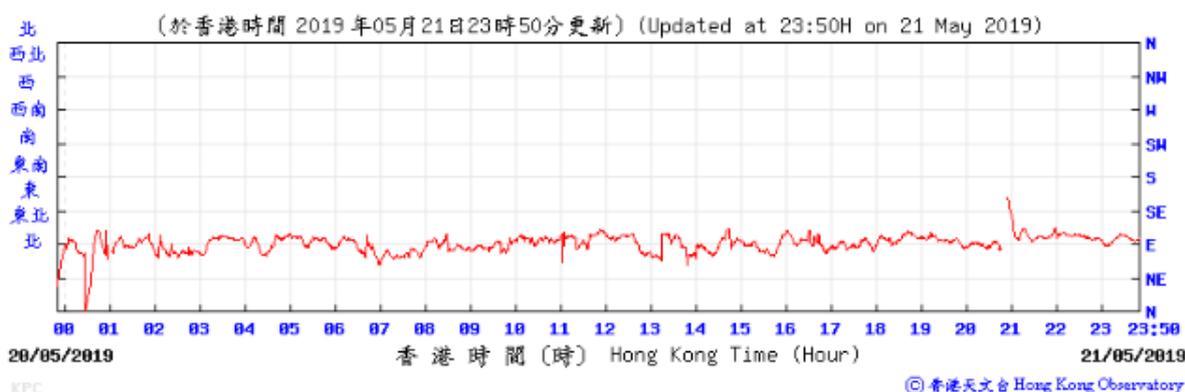


Wind Speed:

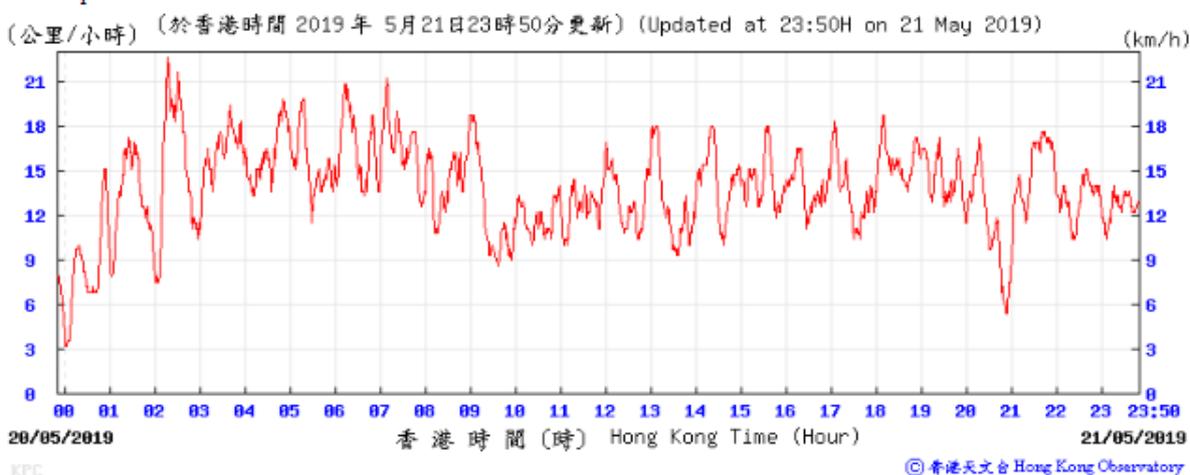


Temperature/Humidity:

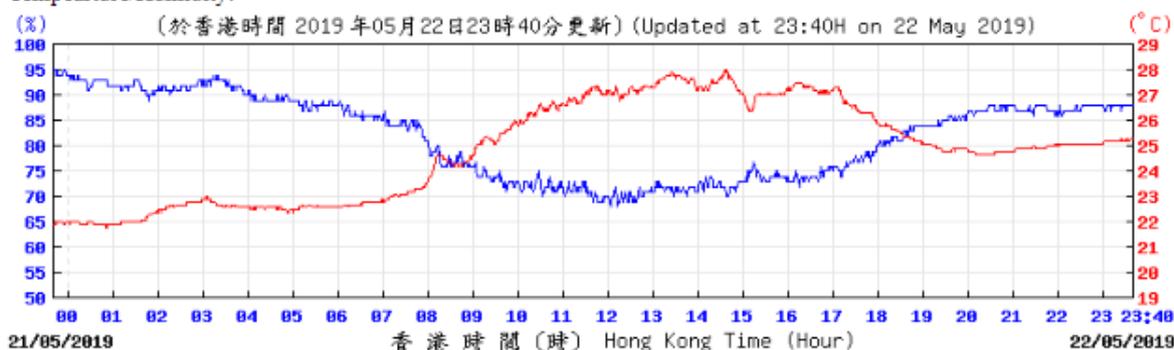


Pressure:

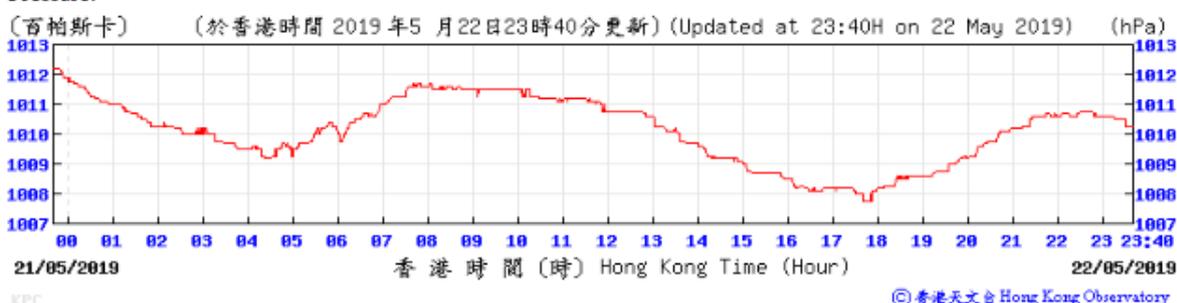


Wind Direction:

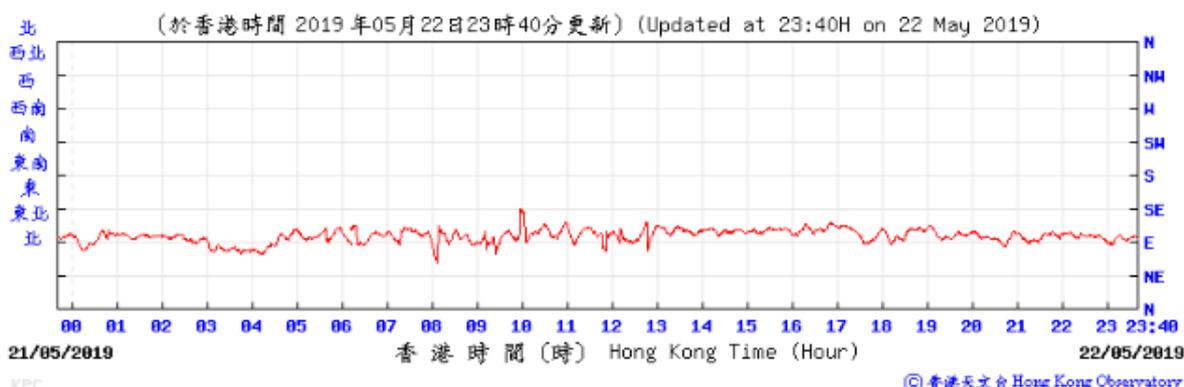

Wind Speed:

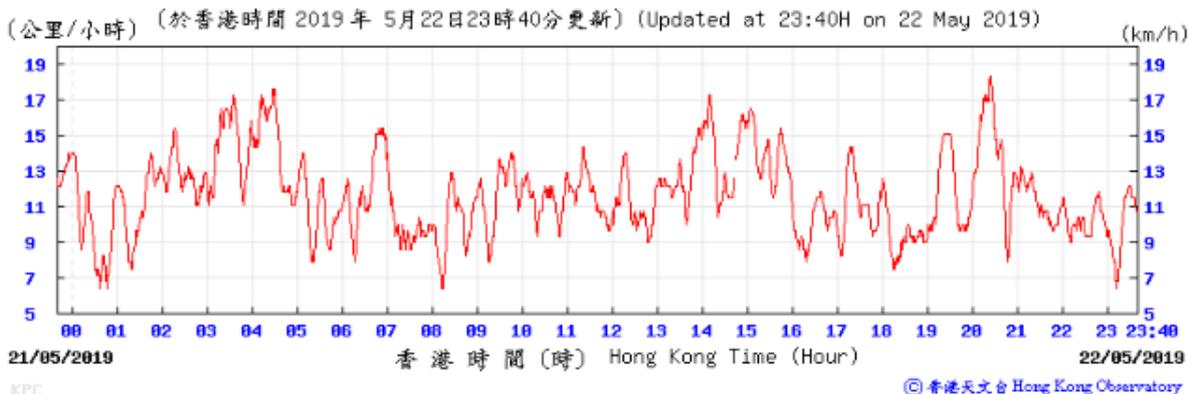


Temperature Humidity:

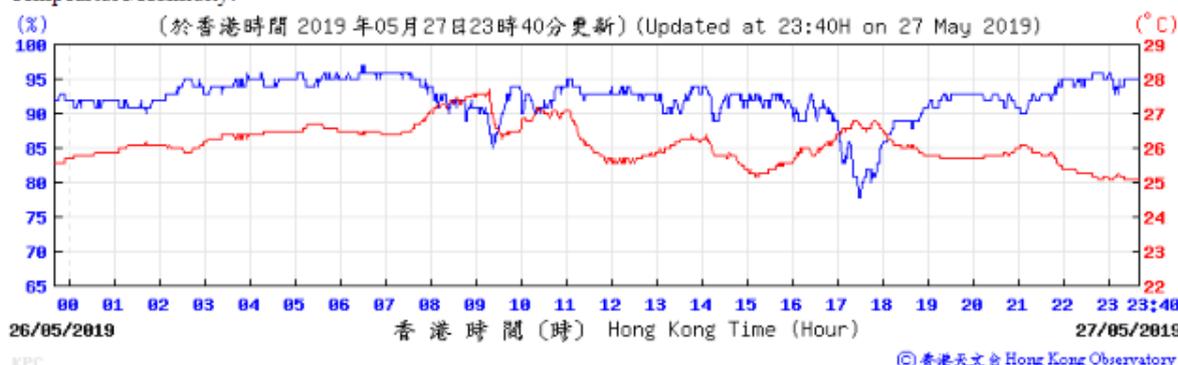


Pressure:




Wind Direction:

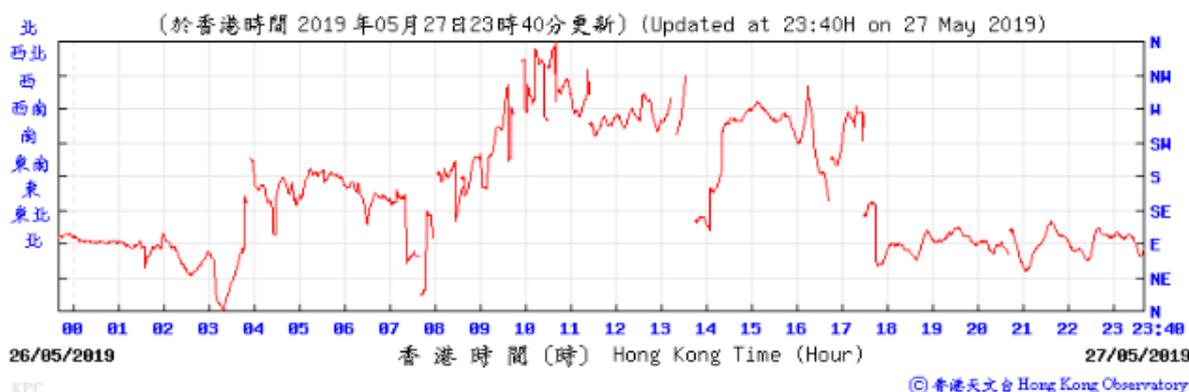

Wind Speed:

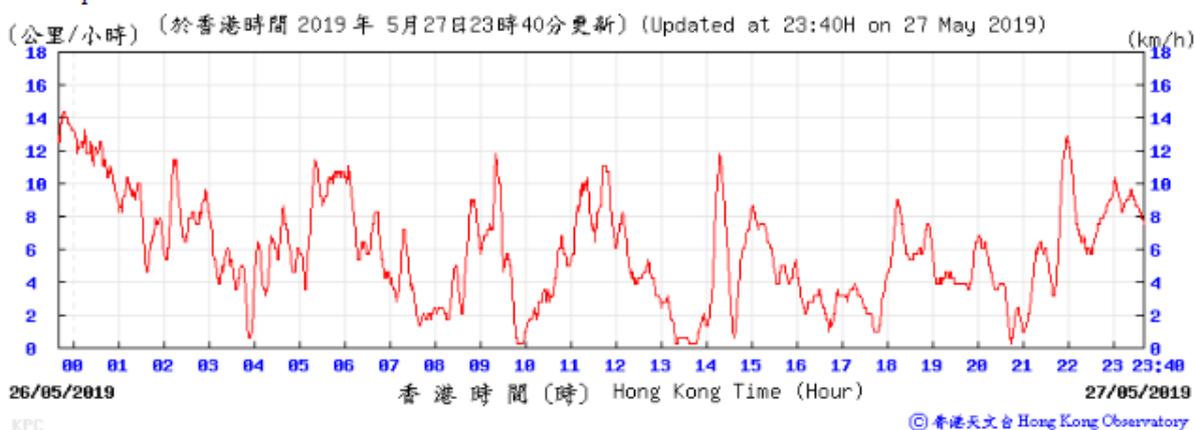


Temperature/Humidity:

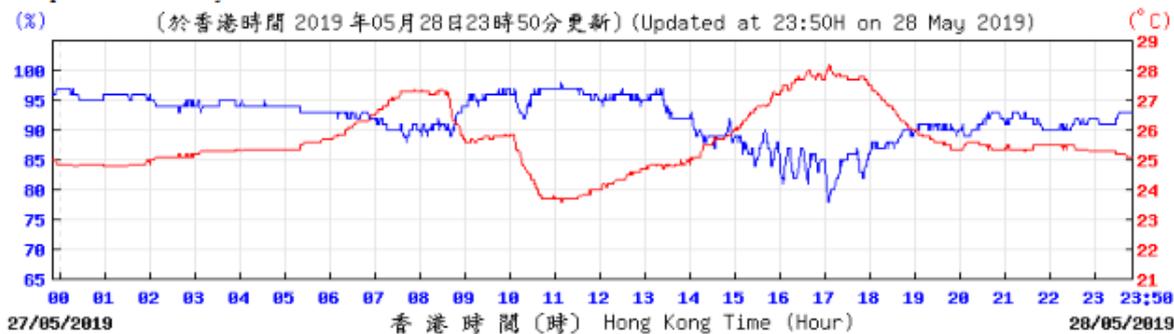

© 香港天文台 Hong Kong Observatory

Pressure:

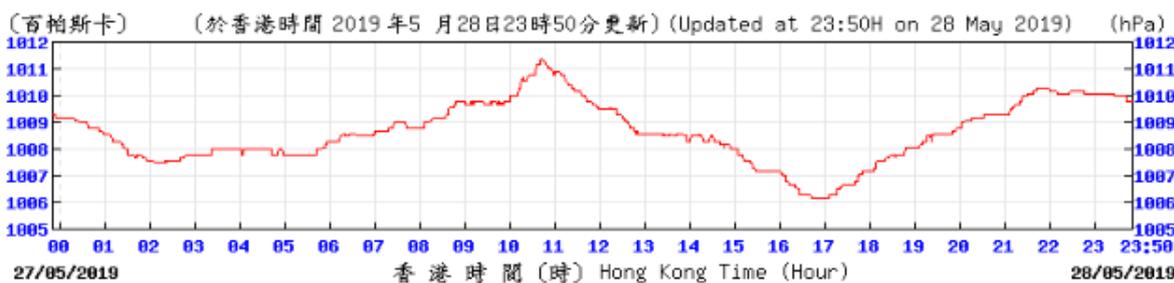


© 香港天文台 Hong Kong Observatory

Wind Direction:




© 香港天文台 Hong Kong Observatory

Wind Speed:

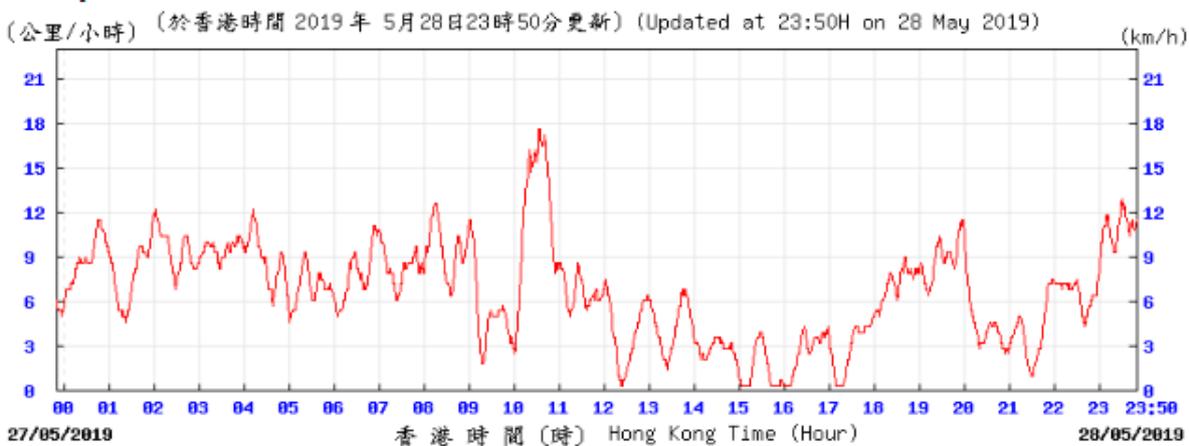


© 香港天文台 Hong Kong Observatory


Temperature/Humidity:

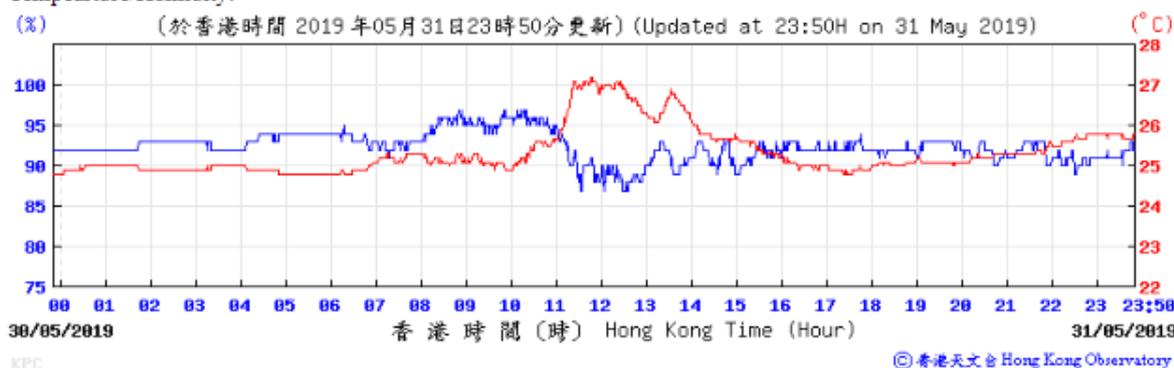


Pressure:

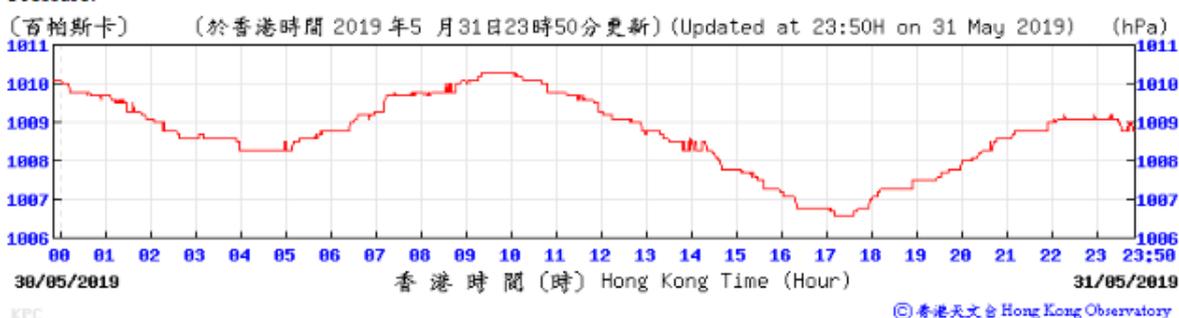


Wind Direction:

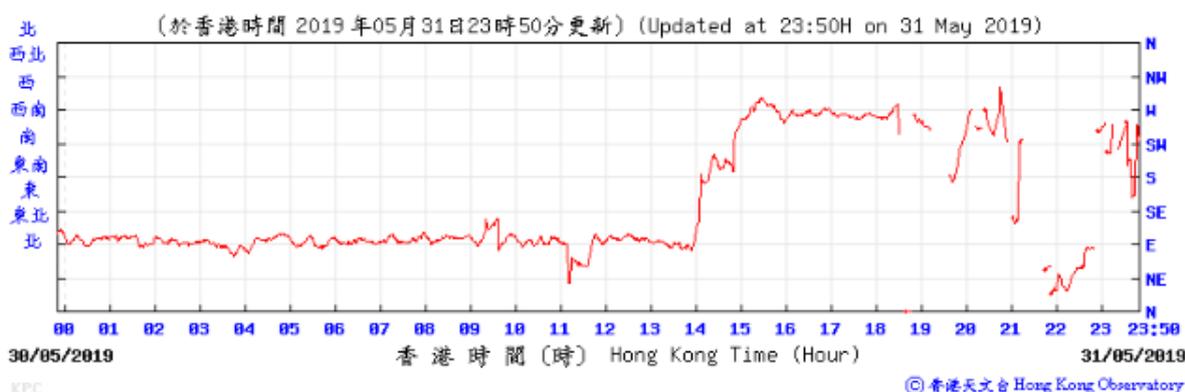


Wind Speed:

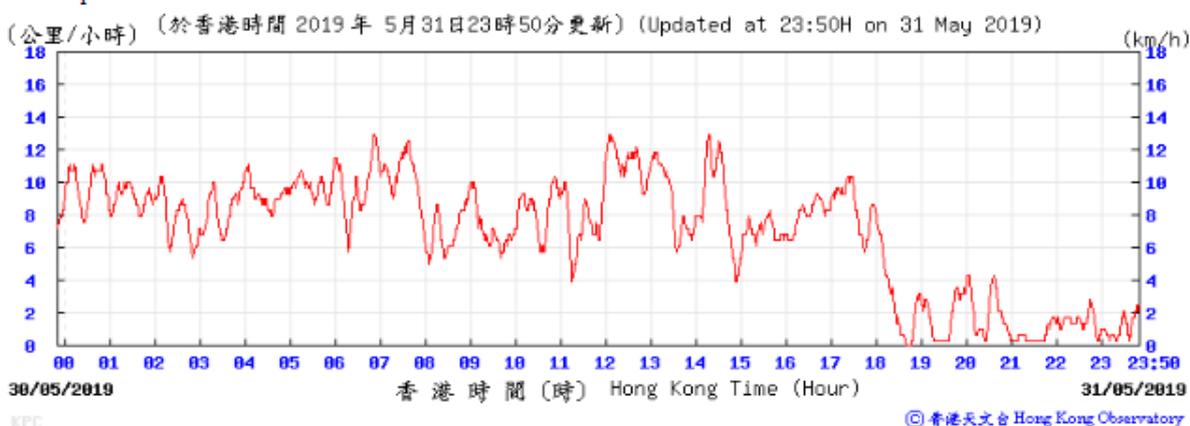


Temperature/Humidity:

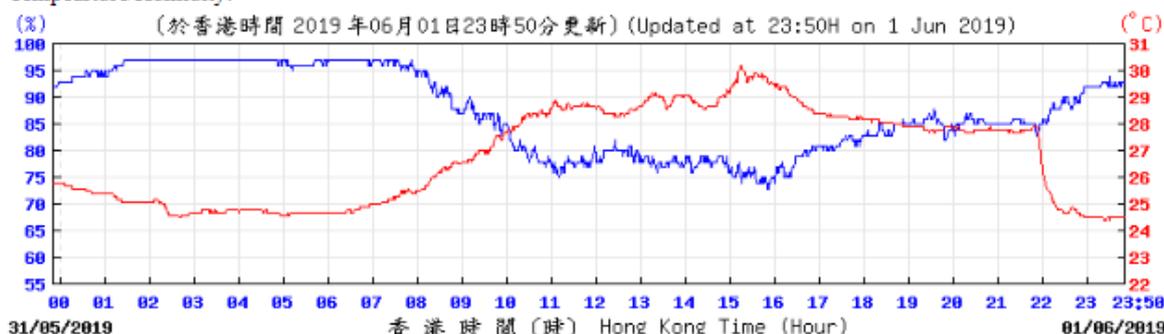


Pressure:

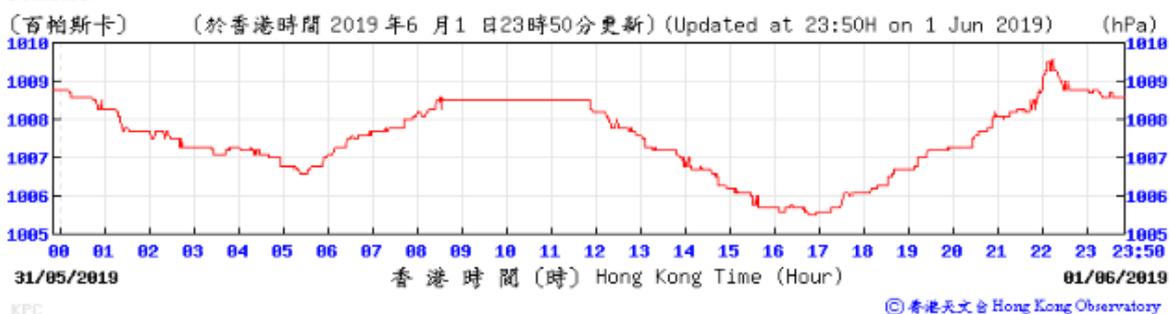

Wind Direction:

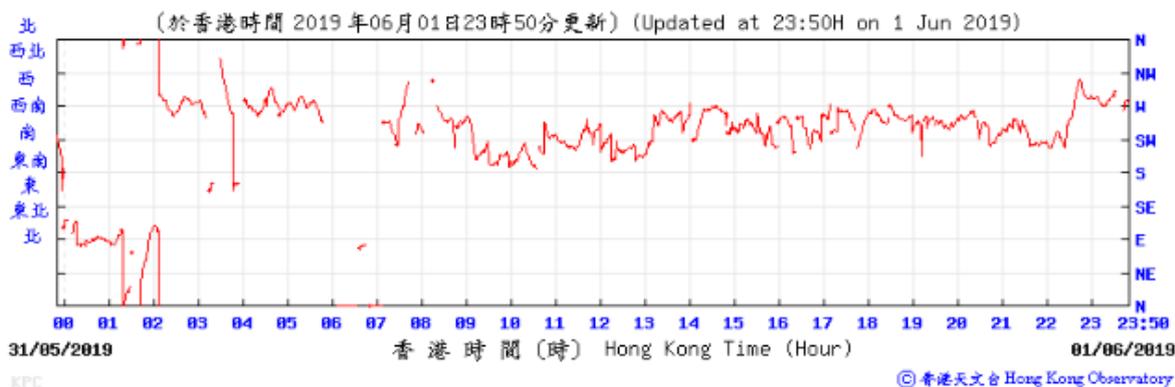

Wind Speed:

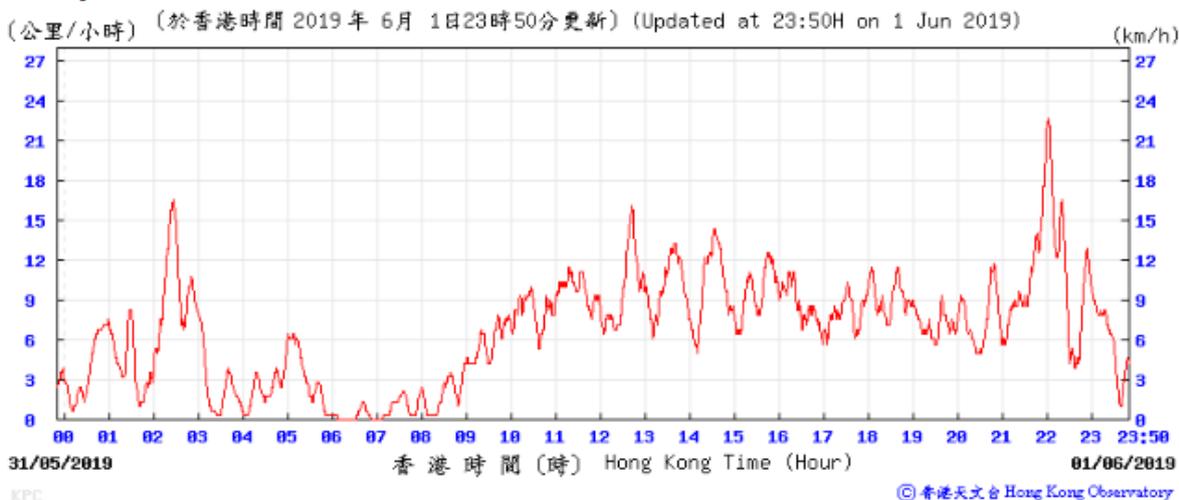

I. Waste Flow table

M+ Museum

Table I-1: Monthly Waste Flow Table for M+ Museum

| Month | Actual Quantities of Inert C&D Materials Generated Monthly | | | | | | | Actual Quantities of C&D Wastes Generated Monthly | | | | | |
|------------------|--|--------------------------------------|------------------------|--------------------------|-------------------------|------------------------------|---------------|---|----------------------------|-------------|--------------|----------------|-----------------------------|
| | Total Quantity Generated | Hard Rocks and Large Broken Concrete | Reused in the Contract | Reused in other Projects | Disposed as Public Fill | Disposed to Sorting Facility | Imported Fill | Metals | Paper/ Cardboard Packaging | Plastics | Wood/ Timber | Chemical Waste | Others, e.g. General Refuse |
| | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) |
| 2015 | | | | | | | | | | | | | |
| Nov | 46607.4 | 0.0 | 0.0 | 8240.0 | 38367.4 | 0.0 | 0.0 | 76.2 | 0.0 | 0.0 | 0.0 | 0.0 | 67.6 |
| Dec | 29652.9 | 0.0 | 0.0 | 29621.4 | 31.5 | 0.0 | 0.0 | 26.3 | 0.0 | 0.0 | 0.0 | 1.0 | 66.0 |
| Sub-total (2015) | 76260.3 | 0.0 | 0.0 | 37861.4 | 38398.9 | 0.0 | 0.0 | 102.5 | 0.0 | 0.0 | 0.0 | 1.0 | 133.6 |
| 2016 | | | | | | | | | | | | | |
| Jan | 21077.4 | 0.0 | 6352.0 | 14576.0 | 149.4 | 0.0 | 0.0 | 18.8 | 0.0 | 0.0 | 0.0 | 0.0 | 23.2 |
| Feb | 7626.2 | 0.0 | 3424.0 | 4048.0 | 154.2 | 0.0 | 0.0 | 59.8 | 0.0 | 0.0 | 0.0 | 0.0 | 20.5 |
| Mar | 10442.5 | 0.0 | 1600.0 | 7888.0 | 954.5 | 0.0 | 0.0 | 29.7 | 0.0 | 0.0 | 0.0 | 0.0 | 46.3 |
| Apr | 30413.2 | 0.0 | 6352.0 | 23408.0 | 653.2 | 0.0 | 0.0 | 25.8 | 0.1 | 0.0 | 27.8 | 0.0 | 34.5 |
| May | 24083.5 | 0.0 | 112.0 | 23216.0 | 755.5 | 0.0 | 0.0 | 61.5 | 0.4 | 0.0 | 33.6 | 0.0 | 62.3 |
| Jun | 7880.1 | 0.0 | 4736.0 | 2384.0 | 760.1 | 0.0 | 0.0 | 106.6 | 0.1 | 0.0 | 14.6 | 0.0 | 52.8 |
| Jul | 5893.1 | 0.0 | 2656.0 | 2240.0 | 997.1 | 0.0 | 0.0 | 77.6 | 0.0 | 0.0 | 33.6 | 0.0 | 83.1 |
| Aug | 13709.6 | 0.0 | 0.0 | 12432.0 | 1277.6 | 0.0 | 0.0 | 111.3 | 0.2 | 0.0 | 38.5 | 0.0 | 104.9 |
| Sep | 6702.0 | 0.0 | 0.0 | 5648.0 | 1000.1 | 53.9 | 0.0 | 104.2 | 0.0 | 0.0 | 45.5 | 0.2 | 107.9 |
| Oct | 2103.6 | 0.0 | 0.0 | 496.0 | 1595.4 | 12.2 | 0.0 | 83.0 | 0.4 | 0.0 | 73.5 | 0.0 | 108.2 |
| Nov | 3302.7 | 0.0 | 0.0 | 2384.0 | 855.5 | 63.2 | 0.0 | 88.4 | 0.6 | 0.0 | 63.0 | 0.0 | 129.1 |
| Dec | 899.8 | 0.0 | 0.0 | 736.0 | 126.8 | 37.0 | 0.0 | 48.3 | 0.6 | 0.0 | 70.0 | 0.0 | 89.0 |
| Sub-total (2016) | 134133.5 | 0.0 | 25232.0 | 99456.0 | 9279.3 | 166.3 | 0.0 | 814.9 | 2.3 | 0.0 | 400.1 | 0.2 | 861.8 |
| 2017 | | | | | | | | | | | | | |
| Jan | 675.2 | 0.0 | 0.0 | 432.0 | 237.9 | 5.3 | 0.0 | 79.5 | 1.0 | 0.0 | 70.0 | 0.0 | 79.7 |
| Feb | 927.7 | 0.0 | 0.0 | 768.0 | 125.6 | 34.0 | 0.0 | 70.5 | 0.6 | 0.0 | 84.0 | 0.0 | 81.4 |
| Mar | 1856.7 | 0.0 | 0.0 | 1280.0 | 466.9 | 109.8 | 0.0 | 62.8 | 0.4 | 0.0 | 98.0 | 0.0 | 148.5 |
| Apr | 642.4 | 0.0 | 0.0 | 160.0 | 324.9 | 157.5 | 0.0 | 87.5 | 0.7 | 0.0 | 175.0 | 0.0 | 102.5 |
| May | 1118.2 | 0.0 | 0.0 | 528.0 | 416.4 | 173.7 | 0.0 | 118.3 | 0.0 | 0.0 | 280.0 | 0.0 | 139.0 |
| Jun | 650.0 | 0.0 | 0.0 | 0.0 | 451.6 | 198.4 | 0.0 | 199.7 | 1.4 | 0.0 | 350.0 | 0.0 | 98.7 |
| Jul | 1762.0 | 0.0 | 0.0 | 0.0 | 1466.6 | 295.4 | 0.0 | 36.9 | 1.2 | 0.0 | 244.0 | 0.0 | 164.2 |
| Aug | 1231.5 | 0.0 | 0.0 | 0.0 | 867.5 | 364.0 | 0.0 | 50.9 | 0.9 | 0.0 | 59.0 | 0.0 | 186.9 |
| Sep | 1681.7 | 0.0 | 0.0 | 0.0 | 1342.0 | 339.7 | 0.0 | 52.3 | 0.7 | 0.0 | 77.0 | 0.0 | 265.3 |
| Oct | 483.6 | 0.0 | 0.0 | 0.0 | 242.5 | 241.1 | 0.0 | 374.8 | 0.6 | 0.0 | 24.1 | 0.0 | 128.5 |
| Nov | 822.8 | 0.0 | 0.0 | 0.0 | 344.5 | 478.3 | 0.0 | 948.5 | 0.7 | 0.0 | 140.0 | 0.2 | 219.1 |
| Dec | 601.3 | 0.0 | 0.0 | 0.0 | 236.2 | 365.1 | 0.0 | 903.6 | 0.8 | 0.0 | 320.0 | 0.0 | 241.9 |

| Month | Actual Quantities of Inert C&D Materials Generated Monthly | | | | | | | Actual Quantities of C&D Wastes Generated Monthly | | | | | |
|------------------|--|--------------------------------------|------------------------|--------------------------|-------------------------|------------------------------|---------------|---|----------------------------|-------------|---------------|----------------|-----------------------------|
| | Total Quantity Generated | Hard Rocks and Large Broken Concrete | Reused in the Contract | Reused in other Projects | Disposed as Public Fill | Disposed to Sorting Facility | Imported Fill | Metals | Paper/ Cardboard Packaging | Plastics | Wood/ Timber | Chemical Waste | Others, e.g. General Refuse |
| | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) |
| Sub-total (2017) | 12453.0 | 0.0 | 0.0 | 3168.0 | 6522.6 | 2762.4 | 0.0 | 2985.3 | 8.9 | 0.0 | 1921.1 | 0.2 | 1855.5 |
| 2018 | | | | | | | | | | | | | |
| Jan | 1015.3 | 0.0 | 0.0 | 0.0 | 574.1 | 441.2 | 0.0 | 773.3 | 1.5 | 0.0 | 100.0 | 0.0 | 183.6 |
| Feb | 847.6 | 0.0 | 0.0 | 0.0 | 608.3 | 239.3 | 0.0 | 34.0 | 1.0 | 0.0 | 25.0 | 0.0 | 154.9 |
| Mar | 1507.0 | 0.0 | 0.0 | 0.0 | 1102.1 | 404.9 | 0.0 | 39.5 | 1.5 | 0.0 | 120.0 | 0.0 | 264.1 |
| Apr | 2942.8 | 0.0 | 0.0 | 0.0 | 2542.4 | 400.4 | 0.0 | 60.1 | 0.3 | 0.0 | 100.0 | 0.0 | 252.5 |
| May | 2109.2 | 0.0 | 0.0 | 0.0 | 1593.3 | 515.9 | 0.0 | 37.0 | 0.4 | 0.0 | 70.0 | 0.0 | 311.4 |
| Jun | 1697.6 | 0.0 | 0.0 | 0.0 | 1162.4 | 535.2 | 0.0 | 47.0 | 0.3 | 0.0 | 105.0 | 0.0 | 188.2 |
| Jul | 945.5 | 0.0 | 0.0 | 0.0 | 646.1 | 299.4 | 0.0 | 15.2 | 0.4 | 0.0 | 150.0 | 0.0 | 277.6 |
| Aug | 730.8 | 0.0 | 0.0 | 0.0 | 461.4 | 269.4 | 0.0 | 0.0 | 0.0 | 0.0 | 40.0 | 0.0 | 109.1 |
| Sep | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 |
| Oct | 1193.1 | 0.0 | 0.0 | 0.0 | 895.7 | 297.5 | 0.0 | 129.3 | 2.7 | 0.0 | 200.0 | 0.0 | 116.6 |
| Nov | 1608.9 | 0.0 | 0.0 | 0.0 | 841.1 | 767.7 | 0.0 | 45.8 | 1.1 | 0.0 | 245.0 | 0.0 | 213.9 |
| Dec | 1313.8 | 0.0 | 0.0 | 170.4 | 341.9 | 801.5 | 0.0 | 256.7 | 0.8 | 0.0 | 180.0 | 0.0 | 198.2 |
| Sub-total (2018) | 15911.4 | 0.0 | 0.0 | 170.4 | 10768.7 | 4972.3 | 0.0 | 1437.9 | 9.9 | 0.0 | 1335.0 | 0.0 | 2270.2 |
| 2019 | | | | | | | | | | | | | |
| Jan | 1632.5 | 0.0 | 0.0 | 153.6 | 572.3 | 906.6 | 0.0 | 192.1 | 0.8 | 0.0 | 40.0 | 0.0 | 303.9 |
| Feb | 618.5 | 0.0 | 0.0 | 0.0 | 397.4 | 221.2 | 0.0 | 43.4 | 1.2 | 0.0 | 20.0 | 0.0 | 429.7 |
| Mar | 1555.1 | 0.0 | 0.0 | 441.6 | 920.2 | 193.2 | 0.0 | 31.8 | 0.0 | 0.0 | 20.0 | 0.0 | 645.2 |
| Apr | 327.4 | 0.0 | 0.0 | 0.0 | 127.3 | 200.2 | 0.0 | 48.9 | 1.3 | 0.0 | 300.0 | 0.9 | 477.4 |
| May | 712.8 | 0.0 | 0.0 | 361.9 | 116.7 | 234.3 | 0.0 | 81.0 | 0.0 | 0.0 | 320.0 | 0.0 | 531.1 |
| Sub-total (2019) | 4846.3 | 0.0 | 0.0 | 957.1 | 2133.8 | 1755.4 | 0.0 | 397.2 | 3.2 | 0.0 | 700.0 | 0.9 | 2387.3 |
| Total | 243604.5 | 0.0 | 25232.0 | 141612.9 | 67103.2 | 9656.5 | 0.0 | 5737.7 | 24.4 | 0.0 | 4356.2 | 2.2 | 7508.4 |

- Note:
- 8.64 tonnes and 108.01 tonnes of inert C&D material were disposed of as public fill to Tuen Mun Area 38 and Tseung Kwan O Area 137 Public Fill respectively in the reporting month.
 - For inert C&D materials reused in other projects, the projects refer to (1) Green Valley; (2) Advance Works for Shek Wu Hui Sewage Treatment Works (3) Design and Construction of Kai Tak Cable Tunnel, CLP; (4) MTR Contract 1002 Whampoa Station and Overrun Tunnel; (5) CEDD Tuen Mun Area 54 Contract No. CV/2015/03; (6) Union Construction Ltd.'s site; (7) Foundation Works at Marriot Hotel at Ocean Park; (8) Ming Tai warehouses; (9) No.1 Plantation Road; (10) L1 Lyric Theatre
 - Quantities of waste materials generated for the previous reporting months have been updated by Contractor.

Lyric Theatre Complex

Table I-2: Monthly Waste Flow Table for Lyric Theatre Complex

| Month | Actual Quantities of Inert C&D Materials Generated Monthly | | | | | | | Actual Quantities of C&D Wastes Generated Monthly | | | | | |
|------------------|--|--------------------------------------|------------------------|--------------------------|-------------------------|------------------------------|---------------|---|----------------------------|-------------|--------------|----------------|-----------------------------|
| | Total Quantity Generated | Hard Rocks and Large Broken Concrete | Reused in the Contract | Reused in other Projects | Disposed as Public Fill | Disposed to Sorting Facility | Imported Fill | Metals | Paper/ Cardboard Packaging | Plastics | Wood/ Timber | Chemical Waste | Others, e.g. General Refuse |
| | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) |
| 2016 | | | | | | | | | | | | | |
| Mar | 2702.1 | 0.0 | 0.0 | 0.0 | 2702.1 | 0.0 | 0.0 | 4.5 | 0.1 | 0.0 | 0.0 | 0.0 | 30.6 |
| Apr | 8631.5 | 0.0 | 0.0 | 0.0 | 8631.5 | 0.0 | 0.0 | 16.0 | 0.0 | 0.0 | 0.0 | 0.0 | 19.2 |
| May | 12487.8 | 0.0 | 0.0 | 0.0 | 12487.8 | 0.0 | 0.0 | 34.0 | 0.0 | 0.0 | 0.0 | 0.7 | 60.5 |
| Jun | 8600.8 | 0.0 | 0.0 | 0.0 | 8600.8 | 0.0 | 0.0 | 31.4 | 0.2 | 0.0 | 0.0 | 0.5 | 13.5 |
| Jul | 12624.2 | 0.0 | 0.0 | 0.0 | 12624.2 | 0.0 | 0.0 | 19.6 | 0.0 | 0.0 | 0.0 | 2.0 | 9.9 |
| Aug | 14419.9 | 0.0 | 0.0 | 0.0 | 14419.9 | 0.0 | 0.0 | 43.9 | 0.0 | 0.0 | 0.0 | 0.0 | 11.1 |
| Sep | 13671.3 | 0.0 | 0.0 | 0.0 | 13671.3 | 0.0 | 0.0 | 59.8 | 0.0 | 0.0 | 0.0 | 1.6 | 12.4 |
| Oct | 13088.9 | 0.0 | 0.0 | 0.0 | 13088.9 | 0.0 | 0.0 | 36.9 | 0.2 | 1.5 | 0.0 | 0.0 | 15.2 |
| Nov | 12424.7 | 0.0 | 0.0 | 0.0 | 12424.7 | 0.0 | 0.0 | 74.7 | 0.0 | 0.0 | 0.0 | 1.4 | 10.2 |
| Dec | 12487.6 | 0.0 | 0.0 | 0.0 | 12487.6 | 0.0 | 0.0 | 13.9 | 0.0 | 0.0 | 0.0 | 1.3 | 9.0 |
| Sub-total (2016) | 111138.8 | 0.0 | 0.0 | 0.0 | 111138.8 | 0.0 | 0.0 | 334.5 | 0.4 | 1.5 | 0.0 | 7.6 | 191.6 |
| 2017 | | | | | | | | | | | | | |
| Jan | 9607.8 | 0.0 | 0.0 | 0.0 | 9607.8 | 0.0 | 0.0 | 29.5 | 0.0 | 0.0 | 0.0 | 0.0 | 7.3 |
| Feb | 9108.2 | 0.0 | 0.0 | 0.0 | 9108.2 | 0.0 | 0.0 | 50.2 | 0.2 | 0.0 | 0.0 | 0.7 | 9.8 |
| Mar | 11361.7 | 0.0 | 0.0 | 0.0 | 11361.7 | 0.0 | 0.0 | 16.1 | 0.0 | 0.0 | 0.0 | 1.4 | 8.5 |
| Apr | 2591.5 | 0.0 | 0.0 | 0.0 | 2591.5 | 0.0 | 0.0 | 35.7 | 0.0 | 0.0 | 0.0 | 0.0 | 4.7 |
| May | 2579.3 | 0.0 | 0.0 | 99.0 | 2480.3 | 0.0 | 0.0 | 20.9 | 0.1 | 0.0 | 0.0 | 0.5 | 10.0 |
| Jun | 476.0 | 0.0 | 0.0 | 341.0 | 129.7 | 5.3 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 7.6 |
| Jul | 3419.0 | 0.0 | 0.0 | 804.0 | 2615.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 17.8 |
| Aug | 3730.9 | 0.0 | 0.0 | 1377.5 | 2353.4 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 4.4 |
| Sep | 2108.2 | 0.0 | 0.0 | 1133.5 | 974.7 | 0.0 | 0.0 | 34.6 | 0.2 | 0.0 | 0.0 | 0.0 | 10.8 |
| Oct | 9159.0 | 0.0 | 0.0 | 7868.0 | 1291.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.7 | 9.3 |
| Nov | 5095.4 | 0.0 | 0.0 | 4352.0 | 725.2 | 18.1 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 38.8 |
| Dec | 3856.2 | 0.0 | 0.0 | 3076.0 | 780.2 | 0.0 | 0.0 | 0.0 | 0.2 | 0.0 | 0.0 | 0.4 | 8.4 |
| Sub-total (2017) | 63093.1 | 0.0 | 0.0 | 19051.0 | 44018.7 | 23.4 | 0.0 | 187.1 | 0.7 | 0.0 | 0.0 | 3.8 | 137.3 |

| Month | Actual Quantities of Inert C&D Materials Generated Monthly | | | | | | | Actual Quantities of C&D Wastes Generated Monthly | | | | | |
|------------------|--|--------------------------------------|------------------------|--------------------------|-------------------------|------------------------------|---------------|---|----------------------------|-------------|--------------|----------------|-----------------------------|
| | Total Quantity Generated | Hard Rocks and Large Broken Concrete | Reused in the Contract | Reused in other Projects | Disposed as Public Fill | Disposed to Sorting Facility | Imported Fill | Metals | Paper/ Cardboard Packaging | Plastics | Wood/ Timber | Chemical Waste | Others, e.g. General Refuse |
| | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) | (in tonnes) |
| 2018 | | | | | | | | | | | | | |
| Jan | 4083.7 | 0.0 | 0.0 | 1455.0 | 2628.7 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 2.9 |
| Feb | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 0.0 | 1.2 |
| Mar | 6120.2 | 0.0 | 0.0 | 5782.0 | 338.2 | 0.0 | 0.0 | 0.0 | 0.0 | 1.0 | 0.0 | 0.5 | 17.6 |
| Apr | 14460.3 | 0.0 | 0.0 | 12484.1 | 1976.3 | 0.0 | 0.0 | 0.0 | 0.0 | 0.2 | 0.0 | 0.0 | 7.6 |
| May | 59783.7 | 0.0 | 0.0 | 46989.0 | 12794.7 | 0.0 | 0.0 | 59.6 | 0.0 | 0.0 | 0.0 | 0.0 | 9.4 |
| Jun | 53117.5 | 0.0 | 0.0 | 37642.8 | 15474.7 | 0.0 | 0.0 | 51.5 | 0.2 | 0.0 | 0.0 | 0.0 | 12.8 |
| Jul | 89901.5 | 0.0 | 0.0 | 85317.1 | 4584.4 | 0.0 | 165.1 | 114.6 | 0.0 | 0.0 | 0.0 | 0.0 | 41.3 |
| Aug | 35137.3 | 0.0 | 0.0 | 33731.6 | 1405.7 | 0.0 | 214.3 | 148.1 | 0.0 | 0.0 | 0.0 | 0.0 | 48.5 |
| Sep | 4815.3 | 0.0 | 0.0 | 4619.1 | 109.2 | 87.0 | 174.6 | 40.0 | 0.0 | 0.0 | 0.0 | 0.0 | 179.2 |
| Oct | 19021.9 | 0.0 | 0.0 | 11301.0 | 7564.7 | 156.1 | 0.0 | 106.3 | 0.4 | 0.0 | 0.0 | 0.0 | 450.4 |
| Nov | 104165.3 | 0.0 | 0.0 | 79811.6 | 24348.4 | 5.3 | 0.0 | 54.5 | 0.0 | 0.6 | 0.0 | 0.0 | 28.9 |
| Dec | 62987.1 | 0.0 | 0.0 | 51284.4 | 11697.1 | 5.6 | 0.0 | 95.1 | 0.0 | 0.6 | 0.0 | 0.0 | 63.1 |
| Sub-total (2018) | 453593.7 | 0.0 | 0.0 | 370417.7 | 82922.0 | 254.0 | 553.9 | 669.7 | 0.5 | 2.4 | 0.0 | 0.5 | 862.7 |
| 2019 | | | | | | | | | | | | | |
| Jan | 74479.1 | 0.0 | 0.0 | 69249.5 | 5229.7 | 0.0 | 318.0 | 326.7 | 0.2 | 0.0 | 0.0 | 0.0 | 76.3 |
| Feb | 21969.9 | 0.0 | 0.0 | 17723.9 | 4246.0 | 0.0 | 16.5 | 55.2 | 0.0 | 0.0 | 0.0 | 0.0 | 26.7 |
| Mar | 16408.3 | 0.0 | 0.0 | 5666.3 | 10742.0 | 0.0 | 337.8 | 64.5 | 0.0 | 0.0 | 0.0 | 0.0 | 36.3 |
| Apr | 28673.9 | 0.0 | 0.0 | 21394.3 | 7279.6 | 0.0 | 0.0 | 32.6 | 0.0 | 0.8 | 0.0 | 0.0 | 24.9 |
| May | 37610.2 | 0.0 | 0.0 | 3392.8 | 34217.4 | 0.0 | 0.0 | 27.4 | 0.2 | 0.0 | 0.0 | 0.0 | 33.7 |
| Sub-total (2019) | 179141.4 | 0.0 | 0.0 | 117426.7 | 61714.7 | 0.0 | 672.3 | 506.4 | 0.3 | 0.8 | 0.0 | 0.0 | 197.9 |
| Total | 808193.2 | 0.0 | 0.0 | 506895.4 | 299794.1 | 277.4 | 1226.3 | 1697.6 | 1.9 | 4.7 | 0.0 | 11.9 | 1389.5 |

Note:
- 27,902.32 tonnes and 6,315.09 tonnes of inert C&D material were disposed of as public fill to Tseung Kwan O Area 137 and Tuen Mun Area 38 Public Fill respectively in the reporting month.

J. Environmental Mitigation Measures – Implementation Status

Table J-1: Environmental Mitigation Measures Implementation Status

| EM&A Ref. | Recommendation Measures | Implementation Stage | |
|--|---|----------------------|-----------------------|
| | | M+ Museum | Lyric Theatre Complex |
| Air Quality Impact (Construction) | | | |
| 2.1 & 10.3.1 | <p>General Dust Control Measures</p> <p>Frequent water spraying for active construction areas (12 times a day or once every one hour), including Heavy construction activities such as construction of buildings or roads, drilling, ground excavation, cut and fill operations (i.e., earth moving)</p> | ✓ | ✓ |
| 2.1 & 10.3.1 | <p>Best Practice For Dust Control</p> <p>The relevant best practices for dust control as stipulated in the Air Pollution Control (construction Dust) Regulation should be adopted to further reduce the construction dust impacts from the Project. These best practices include:</p> <p><i>Good Site Management</i></p> <ul style="list-style-type: none"> • Good site management is important to help reducing potential air quality impact down to an acceptable level. As a general guide, the Contractor should maintain high standard of housekeeping to prevent emission of fugitive dust. Loading, unloading, handling and storage of raw materials, wastes or by-products should be carried out in a manner so as to minimise the release of visible dust emission. Any piles of materials accumulated on or around the work areas should be cleaned up regularly. Cleaning, repair and maintenance of all plant facilities within the work areas should be carried out in a manner minimising generation of fugitive dust emissions. The material should be handled properly to prevent fugitive dust emission before cleaning. <p><i>Disturbed Parts of the Roads</i></p> <ul style="list-style-type: none"> • Each and every main temporary access should be paved with concrete, bituminous hardcore materials or metal plates and kept clear of dusty materials; or • Unpaved parts of the road should be sprayed with water or a dust suppression chemical so as to keep the entire road surface wet. <p><i>Exposed Earth</i></p> <ul style="list-style-type: none"> • Exposed earth should be properly treated by compaction, hydroseeding, vegetation planting or seating with latex, vinyl, bitumen within six months after the last construction activity on the site or part of the site where the exposed earth lies. <p><i>Loading, Unloading or Transfer of Dusty Materials</i></p> <ul style="list-style-type: none"> • All dusty materials should be sprayed with water immediately prior to any loading or transfer operation | ✓ | Obs |
| | | ✓ | ✓ |
| | | ✓ | ✓ |
| | | N/A | N/A |
| | | ✓ | ✓ |

| EM&A Ref. | Recommendation Measures | Implementation Stage | |
|--------------|--|----------------------|-----------------------|
| | | M+ Museum | Lyric Theatre Complex |
| | so as to keep the dusty material wet. | | |
| | <i>Debris Handling</i> | | |
| | <ul style="list-style-type: none"> Any debris should be covered entirely by impervious sheeting or stored in a debris collection area sheltered on the top and the three sides. | ✓ | ✓ |
| | <ul style="list-style-type: none"> Before debris is dumped into a chute, water should be sprayed so that it remains wet when it is dumped. | ✓ | ✓ |
| | <i>Transport of Dusty Materials</i> | | |
| | <ul style="list-style-type: none"> Vehicle used for transporting dusty materials/spoils should be covered with tarpaulin or similar material. The cover should extend over the edges of the sides and tailboards. | ✓ | ✓ |
| | <i>Wheel washing</i> | | |
| | <ul style="list-style-type: none"> Vehicle wheel washing facilities should be provided at each construction site exit. Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels. | ✓ | ✓ |
| | <i>Use of vehicles</i> | | |
| | <ul style="list-style-type: none"> The speed of the trucks within the site should be controlled to about 10km/hour in order to reduce adverse dust impacts and secure the safe movement around the site. | ✓ | ✓ |
| | <ul style="list-style-type: none"> Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels. | ✓ | ✓ |
| | <ul style="list-style-type: none"> Where a vehicle leaving the construction site is carrying a load of dusty materials, the load should be covered entirely by clean impervious sheeting to ensure that the dusty materials do not leak from the vehicle. | ✓ | ✓ |
| | <i>Site hoarding</i> | | |
| | <ul style="list-style-type: none"> Where a site boundary adjoins a road, street, service lane or other area accessible to the public, hoarding of not less than 2.4m high from ground level should be provided along the entire length of that portion of the site boundary except for a site entrance or exit. | ✓ | ✓ |
| 2.1 & 10.3.1 | <p>Best Practicable Means for Cement Works (Concrete Batching Plant)</p> <p>The relevant best practices for dust control as stipulated in the Guidance Note on the Best Practicable Means for Cement Works (Concrete Batching Plant) BPM 3/2(93) should be followed and implemented to further reduce the construction dust impacts of the Project. These best practices include:</p> <p>Exhaust from Dust Arrestment Plant</p> | | |

| EM&A Ref. | Recommendation Measures | Implementation Stage | |
|------------------------------------|--|----------------------|-----------------------|
| | | M+ Museum | Lyric Theatre Complex |
| | <ul style="list-style-type: none"> Wherever possible the final discharge point from particulate matter arrestment plant, where is not necessary to achieve dispersion from residual pollutants, should be at low level to minimise the effect on the local community in the case of abnormal emissions and to facilitate maintenance and inspection | ✓ | ✓ |
| | Emission Limits | | |
| | <ul style="list-style-type: none"> All emissions to air, other than steam or water vapour, shall be colourless and free from persistent mist or smoke | ✓ | ✓ |
| | Engineering Design/Technical Requirements | | |
| | <ul style="list-style-type: none"> As a general guidance, the loading, unloading, handling and storage of fuel, raw materials, products, wastes or by-products should be carried out in a manner so as to prevent the release of visible dust and/or other noxious or offensive emissions | ✓ | ✓ |
| - | <p>Non-Road Mobile Machinery (NRMM):</p> <p>All NRMMs operating on-site which are subject to emission control of Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation are approved/exempted (as the case may be) and affixed with the requisite approval/exemption labels.</p> | ✓ | Obs |
| Noise Impact (Construction) | | | |
| 3.1 & 10.4.1 | <p>Good Site Practice</p> <p>Good site practice and noise management can significantly reduce the impact of construction site activities on nearby NSRs. The following package of measures should be followed during each phase of construction:</p> <ul style="list-style-type: none"> only well-maintained plant to be operated on-site and plant should be serviced regularly during the construction works; machines and plant that may be in intermittent use to be shut down between work periods or should be throttled down to a minimum; plant known to emit noise strongly in one direction, should, where possible, be orientated to direct noise away from the NSRs; mobile plant should be sited as far away from NSRs as possible; and material stockpiles and other structures to be effectively utilised, where practicable, to screen noise from on-site construction activities. | ✓ | ✓ |
| 3.1 & 10.4.1 | <p>Adoption of Quieter PME</p> <p>The recommended quieter PME adopted in the assessment were taken from the EPD's QPME Inventory and "Sound Power Levels of Other Commonly Used PME" are presented in Table 4.26 in the EIA report. It should be noted that the silenced PME selected for assessment can be found in Hong Kong.</p> | ✓ | ✓ |

| EM&A Ref. | Recommendation Measures | Implementation Stage | |
|--|--|----------------------|-----------------------|
| | | M+ Museum | Lyric Theatre Complex |
| 3.1 & 10.4.1 | Use of Movable Noise Barriers Movable noise barriers can be very effective in screening noise from particular items of plant when constructing the Project. Noise barriers located along the active works area close to the noise generating component of a PME could produce at least 10 dB(A) screening for stationary plant and 5 dB(A) for mobile plant provided the direct line of sight between the PME and the NSRs is blocked. | N/A | ✓ |
| 3.1 & 10.4.1 | Use of Noise Enclosure/ Acoustic Shed The use of noise enclosure or acoustic shed is to cover stationary PME such as air compressor and concrete pump. With the adoption of the noise enclosure, the PME could be completely screened, and noise reduction of 15 dB(A) can be achieved according to the EIAO Guidance Note No.9/2010. | N/A | N/A |
| 3.1 & 10.4.1 | Use of Noise Insulating Fabric Noise insulating fabric can also be adopted for certain PME (e.g. drill rig, pilling machine etc). The fabric should be lapped such that there are no openings or gaps on the joints. According to the approved Tsim Sha Tsui Station Northern Subway EIA report (AEIAR-127/2008), a noise reduction of 10 dB(A) can be achieved for the PME lapped with the noise insulating fabric. | N/A | ✓ |
| 3.1 & 10.4.1 | Scheduling of Construction Works outside School Examination Periods During construction phase, the contractor should liaise with the educational institutions (including NSRs LCS and CRGPS) to obtain the examination schedule and avoid the noisy construction activities during school examination periods. | N/A | N/A |
| Water Quality Impact (Construction) | | | |
| 4.1 & 10.5.1 | Construction site runoff and drainage The site practices outlined in ProPECC Note PN 1/94 should be followed as far as practicable in order to minimise surface runoff and the chance of erosion. The following measures are recommended to protect water quality and sensitive uses of the coastal area, and when properly implemented should be sufficient to adequately control site discharges so as to avoid water quality impacts: <ul style="list-style-type: none"> At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels, earth bunds or sand bag barriers should be provided on site to direct storm water to silt removal facilities. The design of the temporary on-site drainage system should be undertaken by the WKCDA's Contractor prior to the commencement of construction; Sand/silt removal facilities such as sand/silt traps and sediment basins should be provided to remove sand/silt particles from runoff to meet the requirements of the TM standards under the WPCO. The design of efficient silt removal facilities should be based on the guidelines in Appendix A1 of ProPECC Note PN 1/94. Sizes may vary depending upon the flow rate. The detailed design of the sand/silt traps should be undertaken by the WKCDA's Contractor prior to the commencement of construction. All drainage facilities and erosion and sediment control structures should be regularly inspected and | Obs | ✓ |
| | | ✓ | ✓ |
| | | Obs | Obs/ Rem |

| EM&A Ref. | Recommendation Measures | Implementation Stage | |
|-----------|---|----------------------|-----------------------|
| | | M+ Museum | Lyric Theatre Complex |
| | maintained to ensure proper and efficient operation at all times and particularly during rainstorms. Deposited silt and grit should be regularly removed, at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times. | | |
| | <ul style="list-style-type: none"> Measures should be taken to minimize the ingress of site drainage into excavations. If excavation of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from foundation excavations should be discharged into storm drains via silt removal facilities. | ✓ | ✓ |
| | <ul style="list-style-type: none"> All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and sited wheel washing facility should be provided at construction site exit where practicable. Wash-water should have sand and silt settled out and removed regularly to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-wash bay to the public road should be paved with sufficient backfall toward the wheel-wash bay to prevent vehicle tracking of soil and silty water to public roads and drains. | ✓ | ✓ |
| | <ul style="list-style-type: none"> Open stockpiles of construction materials or construction wastes on-site should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system. | ✓ | ✓ |
| | <ul style="list-style-type: none"> Manholes (including newly constructed ones) should be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and stormwater runoff being directed into foul sewers. | ✓ | ✓ |
| | <ul style="list-style-type: none"> Precautions should be taken at any time of the year when rainstorms are likely. Actions should be taken when a rainstorm is imminent or forecasted and actions to be taken during or after rainstorms are summarized in Appendix A2 of ProPECC Note PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes. | ✓ | ✓ |
| | <ul style="list-style-type: none"> Bentonite slurries used in piling or slurry walling should be reconditioned and reused wherever practicable. Temporary enclosed storage locations should be provided on-site for any unused bentonite that needs to be transported away after all the related construction activities are completed. The requirements in ProPECC Note PN 1/94 should be adhered to in the handling and disposal of bentonite slurries. | N/A | N/A |
| | Barging facilities and activities | | |
| | Recommendations for good site practices during operation of the proposed barging point include: | | |
| | <ul style="list-style-type: none"> All vessels should be sized so that adequate clearance is maintained between vessels and the seabed in all tide conditions, to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash; | N/A | N/A |
| | <ul style="list-style-type: none"> Loading of barges and hoppers should be controlled to prevent splashing of material into the surrounding water. Barges or hoppers should not be filled to a level that will cause the overflow of | N/A | N/A |

| EM&A Ref. | Recommendation Measures | Implementation Stage | |
|---|--|----------------------|-----------------------|
| | | M+ Museum | Lyric Theatre Complex |
| | materials or polluted water during loading or transportation; | | |
| | <ul style="list-style-type: none"> All hopper barges should be fitted with tight fitting seals to their bottom openings to prevent leakage of material; and Construction activities should not cause foam, oil, grease, scum, litter or other objectionable matter to be present on the water within the site. | N/A | N/A |
| 4.1 & 10.5.1 | <p>Sewage effluent from construction workforce</p> <p>Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance.</p> | ✓ | ✓ |
| 4.1 & 10.5.1 | <p>General construction activities</p> <ul style="list-style-type: none"> Construction solid waste, debris and refuse generated on-site should be collected, handled and disposed of properly to avoid entering any nearby storm water drain. Stockpiles of cement and other construction materials should be kept covered when not being used. Oils and fuels should only be stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby storm water drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event. | ✓ | ✓ |
| Waste Management Implications (Construction) | | | |
| 6.1 & 10.7.1 | <p>Good Site Practices</p> <p>Recommendations for good site practices during the construction activities include:</p> <ul style="list-style-type: none"> Nomination of an approved person, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site Training of site personnel in proper waste management and chemical handling procedures Provision of sufficient waste disposal points and regular collection of waste Appropriate measures to minimise windblown litter and dust/odour during transportation of waste by either covering trucks or by transporting wastes in enclosed containers Provision of wheel washing facilities before the trucks leaving the works area so as to minimise dust introduction to public roads Well planned delivery programme for offsite disposal such that adverse environmental impact from transporting the inert or non-inert C&D materials is not anticipated | ✓ | ✓ |
| 6.1 & 10.7.1 | <p>Waste Reduction Measures</p> <p>Recommendations to achieve waste reduction include:</p> | | |

| EM&A Ref. | Recommendation Measures | Implementation Stage | |
|--------------|--|----------------------|-----------------------|
| | | M+ Museum | Lyric Theatre Complex |
| | <ul style="list-style-type: none"> Sort inert C&D material to recover any recyclable portions such as metals Segregation and storage of different types of waste in different containers or skips to enhance reuse or recycling of materials and their proper disposal Encourage collection of recyclable waste such as waste paper and aluminium cans by providing separate labelled bins to enable such waste to be segregated from other general refuse generated by the work force Proper site practices to minimise the potential for damage or contamination of inert C&D materials Plan the use of construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste | ✓ | ✓ |
| 6.1 & 10.7.1 | <p>Inert and Non-inert C&D Materials</p> <p>In order to minimise impacts resulting from collection and transportation of inert C&D material for off-site disposal, the excavated materials should be reused on-site as fill material as far as practicable. In addition, inert C&D material generated from excavation works could be reused as fill materials in local projects that require public fill for reclamation.</p> <ul style="list-style-type: none"> The surplus inert C&D material will be disposed of at the Government's PFRFs for beneficial use by other projects in Hong Kong. Liaison with the CEDD Public Fill Committee (PFC) on the allocation of space for disposal of the inert C&D materials at PFRF is underway. No construction work is allowed to proceed until all issues on management of inert C&D materials have been resolved and all relevant arrangements have been endorsed by the relevant authorities including PFC and EPD. The C&D materials generated from general site clearance should be sorted on site to segregate any inert materials for reuse or disposal of at PFRFs whereas the non-inert materials will be disposed of at the designated landfill site. In order to monitor the disposal of inert and non-inert C&D materials at respectively PFRFs and the designated landfill site, and to control fly-tipping, it is recommended that the Contractor should follow the Technical Circular (Works) No.6/2010 for Trip Ticket System for Disposal of Construction & Demolition Materials issued by Development Bureau. In addition, it is also recommended that the Contractor should prepare and implement a Waste Management Plan detailing their various waste arising and waste management practices in accordance with the relevant requirements of the Technical Circular (Works) No. 19/2005 Environmental Management on Construction Site. | ✓ | ✓ |
| 6.1 & 10.7.1 | <p>Chemical Waste</p> <ul style="list-style-type: none"> If chemical wastes are produced at the construction site, the Contractor will be required to register with the EPD as a chemical waste producer and to follow the guidelines stated in the "Code of Practice on | | |

| EM&A Ref. | Recommendation Measures | Implementation Stage | |
|--|--|----------------------|-----------------------|
| | | M+ Museum | Lyric Theatre Complex |
| | <p>the Packaging Labelling and Storage of Chemical Wastes". Good quality containers compatible with the chemical wastes should be used, and incompatible chemicals should be stored separately. Appropriate labels should be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the chemical waste, such as explosive, flammable, oxidizing, irritant, toxic, harmful, corrosive, etc. The Contractor should use a licensed collector to transport and dispose of the chemical wastes at the approved Chemical Waste Treatment Centre or other licensed recycling facilities, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.</p> <ul style="list-style-type: none"> Potential environmental impacts arising from the handling activities (including storage, collection, transportation and disposal of chemical waste) are expected to be minimal with the implementation of appropriate mitigation measures as recommended. | ✓ | Obs |
| 6.1 & 10.7.1 | <p>General Refuse</p> <p>General refuse should be stored in enclosed bins or compaction units separated from inert C&D materials. A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from inert C&D materials. Preferably an enclosed and covered area should be provided to reduce the occurrence of 'wind blown' light material.</p> | ✓ | ✓ |
| Land Contamination (Construction) | | | |
| 7.1 & 10.8.1 | <p>The potential for land contamination issues at the TST Fire Station due to its future relocation will be confirmed by site investigation after land acquisition. Where necessary, mitigation measures for minimising potential exposure to contaminated materials (if any) or remediation measures will be identified. If contaminated land is identified (e.g., during decommissioning of fuel oil storage tanks) after the commencement of works, mitigation measures are proposed in order to minimise the potentially adverse effects on the health and safety of construction workers and impacts arising from the disposal of potentially contaminated materials.</p> <p>The following measures are proposed for excavation and transportation of contaminated material:</p> <ul style="list-style-type: none"> To minimize the chance for construction workers to come into contact with any contaminated materials, bulk earth-moving excavation equipment should be employed; Contact with contaminated materials can be minimised by wearing appropriate clothing and personal protective equipment such as gloves and masks (especially when interacting directly with contaminated material), provision of washing facilities and prohibition of smoking and eating on site; Stockpiling of contaminated excavated materials on site should be avoided as far as possible; The use of contaminated soil for landscaping purpose should be avoided unless pre-treatment was carried out; Vehicles containing any contaminated excavated materials should be suitably covered to reduce dust | N/A | N/A |
| | | N/A | N/A |

| EM&A Ref. | Recommendation Measures | Implementation Stage | |
|---|---|----------------------|-----------------------|
| | | M+ Museum | Lyric Theatre Complex |
| | emissions and/or release of contaminated wastewater; | N/A | N/A |
| | <ul style="list-style-type: none"> • Truck bodies and tailgates should be sealed to stop any discharge; • Only licensed waste haulers should be used to collect and transport contaminated material to treatment/disposal site and should be equipped with tracking system to avoid fly tipping; • Speed control for trucks carrying contaminated materials should be exercised; • Observe all relevant regulations in relation to waste handling, such as Waste Disposal Ordinance (Cap 354), Waste Disposal (Chemical Waste) (General) Regulation (Cap 354) and obtain all necessary permits where required; and • Maintain records of waste generation and disposal quantities and disposal arrangements. | N/A | N/A |
| Ecological Impact (Construction) | | | |
| No mitigation measure is required. | | | |
| Landscape and Visual Impact (Construction) | | | |
| Table 9.1 & 10.8 (CM1) | Trees should be retained in situ on site as far as possible. Should tree removal be unavoidable due to construction impacts, trees will be transplanted or felled with reference to the stated criteria in the Tree Removal Applications to be submitted to relevant government departments for approval in accordance to ETWB TCW No. 29/2004 and 3/2006. | N/A | N/A |
| Table 9.1 & 10.8 (CM2) | Compensatory tree planting shall be incorporated to the proposed project and maximize the new tree, shrubs and other vegetation planting to compensate tree felled and vegetation removed. Also, implementation of compensatory planting should be of a ratio not less than 1:1 in terms of quality and quantity within the site. | N/A | N/A |
| Table 9.1 & 10.8 (CM3) | Buffer trees for screening purposes to soften the hard architectural and engineering structures and facilities. | N/A | N/A |
| Table 9.1 & 10.8 (CM4) | Softscape treatments such as vertical green wall panel /planting of climbing and/or weeping plants, etc, to maximize the green coverage and soften the hard architectural and engineering structures and facilities. | N/A | N/A |
| Table 9.1 & 10.8 (CM5) | Roof greening by means of intensive and extensive green roof to maximize the green coverage and improve aesthetic appeal and visual quality of the building/structure. | N/A | N/A |
| Table 9.1 & 10.8 (CM6) | Sensitive streetscape design should be incorporated along all new roads and streets. | N/A | N/A |
| Table 9.1 & 10.8 (CM7) | Structure, ornamental planting shall be provided along amenity strips to enhance the landscape quality. | N/A | N/A |
| Table 9.1 & 10.8 (CM8) | Landscape design shall be incorporated to architectural and engineering structures in order to provide aesthetically pleasing designs. | N/A | N/A |

| EM&A Ref. | Recommendation Measures | Implementation Stage | |
|-------------------------|--|----------------------|-----------------------|
| | | M+ Museum | Lyric Theatre Complex |
| Table 9.1 (CM9) | Minimize the structure of marine facilities to be built on the seabed and foreshore in order to minimize the affected extent to the waterbody | N/A | N/A |
| Table 9.2 & 10.9 (MCP1) | Use of decorative screen hoarding/boards | ✓ | ✓ |
| Table 9.2 & 10.9 (MCP2) | Early introduction of landscape treatments | N/A | N/A |
| Table 9.2 & 10.9 (MCP3) | Adoption of light colour for the temporary ventilation shafts for the basement during the transition period. | N/A | N/A |
| Table 9.2 & 10.9 (MCP4) | Control of night time lighting | ✓ | ✓ |
| Table 9.2 & 10.9 (MCP5) | Use of greenery such as grass cover for the temporary open areas will help achieve the visual balance and soften the hard edges of the structures. | N/A | N/A |

N/A - Not Applicable

✓ - Implemented

Obs - Observed

Rem - Reminder

K. Cumulative Statistics on Complaints, Notifications of Summons and Successful Prosecutions

Cumulative statistics for complaints, notifications of summons and successful prosecutions for the Project account for period starting from the date of commencement of construction works (i.e. 31 October 2015 for M+ Museum main works and 1 March 2016 for Lyric Theatre Complex) to the end of the reporting month and are summarised in the **Table K-1** and **Table K-2** below respectively.

Table K-1: Statistics for complaints, notifications of summons and successful prosecutions for M+ Museum Main Works

| Reporting Period | Cumulative Statistics | | |
|--|-----------------------|--------------------------|-------------------------|
| | Complaints | Notifications of summons | Successful prosecutions |
| This reporting month | 0 | 0 | 0 |
| From 31 October 2015 to end of the reporting month | 6 | 1 | 0 |

Table K-2: Statistics for complaints, notifications of summons and successful prosecutions for Lyric Theatre Complex

| Reporting Period | Cumulative Statistics | | |
|---|-----------------------|--------------------------|-------------------------|
| | Complaints | Notifications of summons | Successful prosecutions |
| This reporting month | 0 | 0 | 0 |
| From 1 March 2016 to end of the reporting month | 8 | 0 | 0 |